

PC-1
Revamping of THQ Hospital, Kot Momin District Sargodha

ORIGINAL APPROVED COST	PKR Million. 287.794/-
ORIGINAL APPROVED GESTATION	72 Months Till June 2025
APPROVAL FORUM	DDSC (DDSC)

1. NAME OF THE PROJECT

Revamping of THQ Hospital, Kot Momin District Sargodha

2. LOCATION OF THE PROJECT

- 2.1. DISTRICT(S)
 - I. SARGODHA

3. AUTHORITIES RESPONSIBLE FOR

- 3.1. SPONSORING AGENCY
 - PRIMARY AND SECONDARY HEALTH CARE
- 3.2. EXECUTION AGENCY
 - PRIMARY AND SECONDARY HEALTH CARE
- 3.3. OPERATIONS AND MAINTENANCE AGENCY
- 3.4. CONCERNED FEDRAL MINISTRY
 - NATIONAL HEALTH SERVICES, REGULATIONS AND COORDINATION

3	AUTHORITIES RESPONSIBLE	
	3.1 Sponsoring	Government of the Punjab, Primary and Secondary Healthcare Department
	3.2 Execution	PMU for Revamping Program of Primary and Secondary Healthcare Department, District Health Councils and C&W Department.
	3.3 Operation & Maintenance	PMU for Revamping Program of Primary and Secondary Healthcare Department and District Health Authority
	3.4 Concerned Federal Ministry	Ministry of National Health Services, Regulation and Coordination Pakistan

4. PLAN PROVISION

Sr#	Description
1	Source of Funding: Scheme Listed in ADP CFY
2	Proposed Allocation: 0.000
3	GS No:5221
4	Total Allocation: 0.000
5	Funds Diverted:0.000
6	Balance Funds: 0.000
7	Comments: Funded out of block provision reflected at G.S No.658 with an allocation of Rs. 1,800 million (Capital = Rs. 1,300 Million & Revenue = Rs. 500 Million).

5. PROJECT OBJECTIVES

Attached

5. Project objectives and its relationship with Sectorial Objectives and Components

The Government of Punjab is making strenuous efforts for a better and effective Health Care system. The Defining step in this direction was to recognize the importance of Health Care at Primary & Secondary Levels. As a first step towards better health care at primary and secondary level, the department under the guidance of Government of the Punjab has decided to launch massive revamping of 40 THQ & DHQ Hospitals in the financial year 2016-17 along with revamping of emergencies of 15 selected THQs and emergencies of all Hospitals. In addition to that, Government has assigned the task of revamping of all remaining 85 THQ Hospitals of Punjab during 2017-18. The Project Management Unit, Revamping Program, Primary and Secondary Healthcare Department has started the 2nd Phase of the said revamping program in September, 2017.

5.1 Background of Primary & Secondary Healthcare Department

Effective primary and secondary healthcare is particularly important in resource-poor countries. Effective delivery of vaccinations, maternal and child care (MCH) and treatment of common pathologies (such as malaria, gastroenteritis, respiratory tract infections and other vector borne diseases) is essential for the achievement of Sustainable Development Goals (SDGs). Effective diagnostic triage, an organized system of prescription and queue management, an effective and stringent sterilization regime, quality nursing and consultant care, implementation of minimum service delivery standards (MSDS) and delivery of care for chronic pathologies lie at the center for the provision of universal health care at a cost that the community can afford as envisaged in domains established by the 1978 Alma-Ata Declaration of WHO. Primary care serves as the cornerstone for building a strong healthcare system that ensures positive health outcomes and health equity. The deficiencies in quality of care represent neither the failure of professional compassion nor necessarily a lack of resources rather, they result from gaps in knowledge, inappropriate applications of available technology and unstructured planning. Local health care systems in our setup have practically not been able to implement department's objectives. Result is continuous lack of quality improvement to lower health outcomes.

Quality health care is actually provision of health care by timely, skillful application of medical technology in a culturally sensitive manner within the available resource constraints. Eliminating poor quality involves not only giving better care but also eliminating under provision of essential clinical services (system wide microscopy for diagnosing tuberculosis, for example); stopping overuse of some care (prenatal ultrasonography or unnecessary injections, for example); and ending misuse of unneeded services (such as unnecessary hysterectomies or antibiotics for viral infections). A sadly unique feature of quality is that poor quality can obviate all the implied benefits of good access and effective treatment. At its best, poor quality is wasteful and at its worst, it causes actual harm.

Keeping in view this basic essence of primary and secondary health care, The Government of Punjab is dedicated in making strenuous efforts for ensuring a better and effective Health Care system .The Defining step in this direction was to recognize the importance of Health Care at Primary & Secondary Levels. As a first step towards better health care at primary and secondary level, a separate department was created by bifurcating the Health department into two departments Specialized Health Care & Medical Education Department and Primary & Secondary Health Care (P&SH) Department. The principle reason for bifurcation has been to improve governance and service delivery in the spheres of health care across the province. Primary and Secondary Health Care Department has been entrusted the responsibility of primary and secondary level health facilities including preventive health services and Vertical Programs. P&SH Department accordingly has its functional responsibility in respect of 26 District Headquarter Hospitals (DHQs), 129 Tehsil Headquarter Hospitals (THQs), 322 Rural Health Centers (RHCs) and 2,504 Basic Health Units (BHUs). Moreover, specialized programs like Expanded Program for Immunization (EPI), TB Control (DOTS), Hepatitis Control Programs as well as special campaigns such as Dengue Campaign, Polio Eradication Campaigns also fall in purview of the department. The establishments like Director General Health Services (DGHS), Drug Testing Labs (DTLs) and Biomedical Engineering Workshops also assist the department in discharge of its functions efficiently. Establishment of Internal delivery Unit at Primary and Secondary Health Care Department has been aimed for institutional strengthening and capacity building of Primary and Secondary Health Care Department. Monitoring and follow up remains one of key ingredients for good governance and is at heart of all management models. Therefore, an Internal Delivery Unit, comprising well qualified and experienced persons, is being established within P&SH Department. Internal Delivery Unit shall be manned with qualified and experienced consultants. Internal Delivery Unit shall be responsible for every such task needed to strengthen the PSHD which may range from operational matters to monitoring e.g. tracking pace of all initiatives of the Department through the process such as tracking procurement of medicines by districts, procurement of vaccine by Director EPI, pace of various development schemes and performance of Drug Testing & Bio-mechanical Labs etc.

The basic mandate of Primary & Secondary Health Department is to focus on preventive health care in primary sector along with basic diagnostics and treatment facilities at secondary level. The context is to primarily lessen the load on tertiary care health establishments and to reduce treatment costs. The major challenge for Primary & Secondary Health Department is to boost the confidence of masses and raise the level of trust in the primary health care system. The reality is that most of the health care establishments at secondary level are not currently providing health care services up to the optimal level, owing to a myriad of reasons including heavy patient load, scarcity of resources, human resource constraints and dysfunctional biomedical and allied equipment.

Due to lack of structured planning and monitoring, previous efforts did not materialize into an integrated health care regime, rather these have resulted in haphazard construction, poor repair and maintenance, lack of basic amenities, absence of waiting areas, substandard diagnostics and therapeutics, shabby outlook and suboptimal level of patient care over all. Such state of affairs has severely jolted level of trust in health care system by common man and hence the patients prefer to visit tertiary level hospitals or even private health facilities for treatment of even very common pathologies. This subsequently has a cascade effect on socioeconomics of common man who has to spend more in shape of travelling from villages to district headquarters and then bearing costs of private treatment, secondly, this has also increased disease load on our tertiary health care establishments.

Keeping in view this importance of primary and secondary health care, the department decided to launch massive revamping program for all DHQs and THQs all over the Punjab.

5.2 Project Management Unit (PMU), Primary & Secondary Healthcare Department

In order to successfully complete the program objectives in the given timeframe, it is imperative to establish a dedicated Program Management Unit (PMU) having technical and administrative expertise and autonomy, as the regular machinery of the department is too busy with the routine work and cannot successfully steer the program. The PMU is responsible for the successful implementation of the Revamping Program through completion of all related projects. After the implementation of all these projects, the Primary & Secondary Healthcare network will be improved. The PMU shall ensure that the DHQ & THQ hospitals have a well-constructed physical infrastructure with vibrant management model for efficient service delivery and improved processes to focus on patient distress in prompt manner. It adheres to Minimum Service Delivery Standards (MSDS) to address the patients' needs in the most efficient and systematic manner.

In this regard, a dedicated team of Project Management Unit (PMU) has been established to execute the project. PMU's office is located at 31-E/1, Shahrah-e-Imam Hussain, Gulberg-III, near Qaddaffi stadium, Lahore. It is headed by a Project Director with a committed team comprising of Deputy Project Director, Finance and Administration, ICT), Project Managers, Project Officers, Engineers, supporting administrative and technical staff, experienced and qualified Health consultants., Directors (Operations, Human Resource & Planning and infrastructure, Outsourcing) as well as Procurement Specialist.

5.3 Infrastructural Interventions

The construction of various new blocks of hospital complex is constructed without any proper planning and necessary connection to existing blocks. On the whole, the complete infrastructure of hospital is quite complex and scattered, access to various blocks of hospital is quite inadequate and there is no proper connection or link between different blocks of hospital. In the revamping program of

DHQ and THQ Hospitals, the placement of various facilities of hospitals are replanned keeping in view the layout of existing blocks for facilitation of patients and some modifications/alterations were proposed in the blocks for necessary link or connection between the blocks.

Major infrastructural interventions can be divided in the following four categories

- **5.3.1 External Development**
- **5.3.2 Internal Development**
- **5.3.3 Medical Infrastructure Development**
- **5.3.4 Emergencies Development**

5.3.1 External Development

5.3.1.1 External Platforms

In order to improve the communication between blocks, necessary interventions are taken to improve the existing internal metaled road network. Moreover, new internal metaled road network is also designed and proposed to access the blocks of hospital accordingly. Despite the improvement in metaled road network, external platforms except metaled road is also designed and proposed for patients to access the blocks by simply walking among the blocks.

5.3.1.2 Façade Improvement

In order to improve the aesthetics of hospital, façade uplift with aluminum composite panels with aluminum cladding, false steel structures, façade aluminum windows and aluminum doors are designed in order to give the feel of modern architectural era.

5.3.1.3 Sewerage System

The most important entity of a hospital lies in its cleanliness. Infrastructural interventions to keep the hospital clean were taken in the form of <u>improvement of sewerage system</u> of the hospital. These interventions include the re designing of sewerage system, construction of new manholes, laying of new sewer lines and connection between trunk sewer and hospital sewer.

5.3.1.4 Landscaping (Horticulture)

Landscaping in hospital adds aesthetic & beauty to the built environment as well as improves in reducing the pollution. Soft & hard landscape reduces dust particles moment in air, hence contributes in a clean environment. The hours spent

in a hospital can be stressful for patients, staff and visitors. According to research easy access to a natural environment can contribute to stress management and potentially improve health outcomes: physiological studies indicate that 3-5 minutes spent in such Hospital Outdoor Landscape Design environments reduces anger, anxiety and pain and induces relaxation. Research also shows that "positive distractions" can reduce stress and their visual forms include gardens, scenic views and artwork, which play a critical role in modern hospital design: gardens, fountains, and water features provide patients, staff and visitors with restorative experiences of nature. In this regard complete lawns development, placement of benches, dust bins, playing equipment, fruit trees, flower plants, fruit trees and gazebos are proposed in all hospitals under revamping program

5.3.1.5 Water Filtration Plant

In the modern era, the access to clean water for everyone is becoming rare day by day. Especially in hospitals, the supply of water free from any harmful impurity is one of the most basic needs. To cope up with this problem water filtration system according to the existing nature of water is designed and water filtration plant is proposed accordingly. For ease of patients, drinking water supply network was designed to provide filtered water in wards and in various drinking stations within the hospital building

5.3.1.6 External Electrification

One of the major hindrances in functionality and ineffectiveness of electro medical equipment and other facilitating electrical appliances is either interrupted power supply or power supply with lesser voltage than required. This problem was solved by providing express line or dual electrical supply in all hospitals under revamping. Despite these two facilities based, on the current and proposed electrical load of hospital new transformers were proposed to step down the voltage to desired level and complete generator backup system was designed and generators along with automatic transfer switches were proposed accordingly. Moreover, to fully lighten up the hospital for proper utilization of all facilities of hospital during the low/no-light hours of the day, external pole lights to lighten up the pathways and garden lights to lighten up the lawns were designed and proposed.

5.3.1.7 Parking and Waiting area

Non-clinical facilitation of patients and attendants were specially considered in the revamping program. One such facilitation step is designing the parking and waiting areas on basis of daily influx of vehicles and patients/attendants during the

peak hours. <u>Parking and waiting areas</u> on several places of hospital were then proposed according to the design.

5.3.1.8 External Signage

<u>Eexternal signage system</u> is designed including various signage types for complete guidance of patient attendants and to search concerned facility promptly.

5.3.2 Internal development

5.3.2.1 Aesthetic improvement

In order to improve the aesthetics of hospital wards, corridors, rooms and toilet blocks, flooring and dado design of suitable material in these areas is proposed. Despite of aesthetics, the material of flooring and dado design were chosen to provide ease in cleaning process. For further improvement in aesthetics, paint on exterior and interior part of the hospital, poly-vinyl chloride paneling to conceal the dampness damaged areas and steel cladding of columns are proposed.

5.3.2.2 Ramp and Stretcher improvement

For hospitals having more than one floor, there is a huge problem of patient transfer with stretcher. This problem is solved by proposing new ramps/stretcher ways where needed. Moreover, in order to further improve the communication between various floors of hospitals improvement of stair cases with hand rail or guard rails is proposed.

5.3.2.3 Seamless flooring and Lead Lining

To keep high risk areas like Operation theaters, I.C.U, C.C.U, and Gynecology Operation Theater bacteria free is one of the basic medical practices. In the revamping program of hospitals low epoxy paint is proposed in these areas to provide seamless flooring so that the bacterial growth within the groves can be prevented. Moreover, to make the X-Ray rooms radio-resistant and to keep the patients away from the harm of rays, interventions are taken in X-ray rooms regarding provision of lead lining in walls, ceiling and floor.

Interventions were taken regarding hazardous radiation emitting areas to make them radio-resistant in order to keep patients/attendants away from harmful radiations. These interventions were in the form of provision of lead lining in ceiling, walls and roofs of X-Ray rooms.

5.3.2.4 Aluminum doors and windows

In order to make sound and heat proof the doors and windows of wards, corridors and major health facilities are proposed as aluminum doors and windows. Which despite of above benefits are also aesthetically pleasing. Corridor wire mesh windows and rolling blinds for windows are proposed in order to invite or stop the day light within the wards according to the requirement. Moreover, existing wooden doors having shabby and dirty look are proposed to be re-polished and washroom doors are proposed to be replaced with PVC doors to make them resistant against water.

5.3.2.5 Improvement of washroom blocks

The area of hospital which can be dirty at most is its washroom or toilet blocks. To improve the cleanliness of hospital the special interventions were taken regarding the renovation of toilet block of hospital. This renovation includes the re tiling of existing damaged flooring and skirting and addition of water closets etc.

5.3.2.6 Facilitation of attendants and patients

The facilitation of attendants is also one of the most basic things to be provided in the hospital. The facilitation of attendants contributes towards the facilitation of patients. In order to facilitate the attendants, pantries are designed at that location of hospital where attendants can be effectively facilitated. These pantries include stoves and washing machines. Moreover, it is also very important to educate the patients and attendants regarding the seasonal and general diseases along with its cure and prevention. Installation of LED televisions in various locations of hospitals especially in wards and waiting areas is also proposed in the design in this regard.

5.3.2.7 Furniture and Fixtures

One more step towards the facilitation of attendants or patients is placement of benches in waiting areas. The most rush positions of hospital are chosen in this regard and placement of benches is designed according to the patient number and flow. In order to improve the efficiency of consultants or doctors, interventions regarding the renovations of doctor or consultant office are designed in this regard. The doctor room furniture is designed for this purpose keeping in view the existing area of room and necessary required equipment. To carry and dispose of the medical and general waste material of hospital, waste bin sets are designed to place at various positions of the hospital. These positions are marked by keeping in view the general circulation of the public and sensitivity of the area.

5.3.2.8 Air Conditioners, Refrigerators and LEDs

According to the different standards, there is a separate requirement of temperature to control the environment of particular place with respect to the nature of facility. In this regard, air conditioners are proposed according to the required tonnage of the specific area. For better efficiency and performance delivery, cabinet air conditioners are proposed in the wards and other facilities having larger areas. The maintenance and repair services of these air conditioners are outsourced so that uninterrupted performance can be delivered. For further facilitation of patients and attendants, placement of refrigerator is proposed on each nursing counter. These refrigerators are proposed for items requiring specific temperature for storage purposes. LEDs will also be placed at various points to facilitate the patients and attendants.

5.3.2.9 Internal Signage and Paintings

As described earlier, the information regarding the positions of major health facility especially emergency and labor room etc. is very much essential for any person entering inside the covered area of hospital. For these purposes, different types of signage are proposed including corridor hanging signage, floor map boards, room numbers and room names plaques. For general information duty rooster boards, janitorial station signage, waste bin set signage, emergency exit signage.

Different kinds of paintings are designed according to the nature of area where it is desired to be fixed. These paintings are beneficial in a sense that it improves the aesthetics of hospital and moreover, such painting patterns are designed so that it give the relaxation and soothing feelings to aid in the healing of patients. Moreover, in order to create a healthy, positive, entertaining and friendly environment for interest of children, paintings on children wards is proposed.

5.3.3 Medical Infrastructure Development

To cope with the emergency condition of clinically serious patient, oxygen supply system is designed by proposing an individual oxygen supply system for each major health facility. This oxygen supply network comprises on copper pipe line, flow meter with bed head units, cylinders and setup and individual central oxygen supply system. The contract of filling of oxygen gas in cylinders is outsourced for uninterrupted oxygen gas supply to the patients.

For patient receiving, information, guidance, appointment or for any other task, separate reception counters are proposed in various blocks so that, all necessary information regarding the block is available on the counter round the clock. In this way, utilization of clinical facilities will be optimized. For indoor patient department, complete facilitation and care of patients admitted in wards is ensured

by proposal of nursing counter in each ward. This nursing counter will be placed or constructed in such a placement that each bed can be monitored by the nurse available.

The design regarding architectural planning of above mentioned facilities are designed according to the patient facilities and architectural planning standards. These designed facilities are then designed in the existing building structure according to the patient flow and sensitivity of facility.

5.3.3.1 Emergency Department:

All THQS and DHQs are already providing emergency services to critical ill patients. As far as the existing sources including human resources & equipment are not sufficient to fulfill the requirement. Primary and secondary healthcare department is going to take the initiative to improve emergencies of hospitals by providing new equipment and human resource in form of recruitment of doctors, nurses and paramedical staff along with Infrastructure of Causality Department. Ultimate goal of revamping of emergencies is to enhance the quality of medical services to critical ill patient in golden hour to decrease the mortality and morbidity rate in causality department of each hospital.

5.3.3.1.1 General Overview of Emergency Department

In any hospital, the most important and critical area is its emergency block. Specially, if hospital is situated on a highway where there is a huge flux of rapidly moving traffic which can be a major source of causalities, if patient treatment is not proper. Besides road trauma cases, cardiac cases and burn cases etc. are also more likely to be initially treated in emergency. Proper first aid to patient reduces morbidity and mortality. The emergency department of hospital is a block where in time service delivery is so much essential that delay in proper treatment can cause lot of lives to suffer from serious diseases for rest of their life. In a nutshell, the efficiency and in time service delivery of emergency block depicts the overall efficiency of the hospital.

In order to improve the emergency department and to ensure in time service delivery of the same, special initiatives are being taken in this regard. Infrastructure of emergency department depends a lot on its service delivery and efficiency. An emergency department with all necessary medical and general equipment and equipped with all essential medical facilities but without ineffective and poorly planned infrastructure will never fulfill its need. Conclusively, such infrastructural interventions are planned in this program so that the efficiency of emergency department can be optimized. Some of the following major interventions are listed below:

5.3.3.1.2 Position of Emergency Department

It is planned that new construction of building should be avoided at most because already existing blocks with no proper utilization are existing in all of the hospitals. The emergency block should be on such a location that the distance between that department and main entrance gate should be minimum with respect to other locations or positions of complex. To fulfill this purpose, that portion of this building block is selected for re planning of emergency department which is most near to the entrance gate. The far positioning of emergency department will result the lost in time for patient during its travelling which can be crucial.

5.3.3.1.3 Access towards the Emergency Department

The route leading towards the emergency department is important in this aspect that a smooth track and a widened path will be feasible for the movement of vehicle or stretcher. Initiatives are taken in this program for construction of new pathways or renovation of existing ones leading towards the emergency department. Such material of the external platform is selected so that a smooth movement should be observed over it rather than jerks bumps. Moreover, the width of the passage from entrance gate up to emergency department is designed by keeping in view the flux of the vehicles rushing towards the emergency block.

5.3.3.1.4 Medical Infrastructure Emergency:

The existing emergency department or other block of the hospital according to its access from entrance gate, is designed and re planned according to the above described emergency facilities. The changings or amendments in the existing covered area of the hospital are proposed according space availability. Due to the rush of patients and increased number of minor surgeries performed in the emergency department make it one of the dirtiest department of the hospital. Hence, in this regards it is very much essential to keep the floors of certain area of emergency department bacteria free. Seamless flooring is proposed in this regard to avoid the groves so that the cleaning process can be made easy. Low epoxy paint is designed and proposed in this regard on Minor OT, Gurney area and specialized healthcare unit.

Provision of medical gasses is essential to facilitate the patients suffering from breathing issue due to some disease and ailment. The filling process of oxygen in the cylinders is outsourced to ensure the continuous supply of the oxygen among the beds. The oxygen system comprises on copper pipe, central oxygen supply system for pressure maintenance, oxygen cylinders and flow meter with bed head units.

5.3.3.1.5 General Building Interventions:

In order to improve the over building condition of emergency blocks following major interventions are taken:

- 1. Provision of flooring and skirting
- 2. Painting on interior and exterior side of department

- 3. Provision of false ceiling
- 4. Replacement of damaged and renovation of existing wooden doors
- 5. Provision of aluminum doors and windows
- 6. Public health work regarding supply of water and gas along with improvement of sewerage system
- 7. Provision of LED panel lights, ceiling fans, exhaust and wall bracket fans
- 8. Improvement of existing wiring and distribution including replacement of damaged equipment and proposal of new equipment

5.3.3.2 Monitoring and Quality Assurance (Process Interventions)

During construction phase, "Construction Supervision" will be carried out by the Procuring Agency (Director Infrastructure) along with Punjab Buildings department (C&W D) who will certify construction activity.

5.3.3.2.1 MSDS (Minimum Service Delivery Standards)

MSDS are minimum level of services, which the patients and service users have a right to expect. MSDS include minimum package of services, standards of care (level specific) and mandatory requirements/systems for delivery of effective health care services. The World Health Assembly in Alma-Atta in 1978 expressed the need of action to protect and promote the health for all the people of the world. Essential health is to be made universally accessible to individuals and families through their full participation and at a cost that the community and country can afford. MSDS is now being deemed to be of vital importance at Secondary HealthCare level. The THQ hospital provides promotive, preventive, curative, diagnostics, in patients, referral services and also specialist care.

THQ hospitals are supposed to provide basic and comprehensive EmONC. THQ hospital provides referral care to the patients including those referred by the Rural Health Centers, Basic Health Units, Lady Health Workers and other primary care facilities. The District Head Quarters Hospital is located at District headquarters level and serves a population of 1 to 3 million, depending upon the category of the hospital. The THQ hospital provides promotive, preventive, curative, advance diagnostics, inpatient services, advance specialist and referral services. Services package and standards of care at SHC level are also not well defined. Deficient areas include: weak arrangements to deal with non-communicable diseases, mental, geriatric problems and specialized surgical care especially at THQ. There is disproportionate emphasis on maternal and child health services at SHC facilities. Services-package being provided at PHC and SHC are also deficient in terms of Health care providers' obligations, patients' rights and obligations.

MSDS umbrella is very vast and it requires a very extensive and planned approach towards, gap analysis, planning, development, implementation,

monitoring and evaluation. MSDS comprises of 10 thematic area, 30 standards and 162 indicators. Government of Punjab has taken an initiative to standardize all hospitals of Punjab in accordance with Punjab Health Care Commission Minimum service delivery standards. PMU team segregated MSDS indicators into various targets and sub-targets to make these targets achievable. Manuals for both clinical and non-clinical specialties are being prepared comprising of departmental organizational plan, criteria for essential human resource, essential equipment, general and specialized SOPs, departmental safety guidelines etc. Standardized Medical Protocols (SMPs) are standard steps to be taken by a health facility during medical or surgical management of a patient. Standard Operating Procedure (SOPs) are detailed description of steps required in performing a task including specifications that must be complied with and are vital to ensure the delivery of these services .It requires literature review, departmental view, facility visits, consultative visits and development of action plan for implementation of MSDS. Effective MSDS implementation requires essential documentation. Documentation is a key for record keeping, monitoring and auditing. For this purpose, registers, forms, displays have to be designed with coding for effective tracking. In addition to this it also requires analysis from field from utilization point of view.

Displays constituting of public serving messages, health related information and general facility related guidelines. In order to monitor effective implementation, compliance monitoring is required to be carried out by field experts which is followed up by further planning to ensure continuous delivery of effective, accessible, continuous and quality services to masses in uninterruptable manner.

MSDS implementation is a complex procedure. Because it requires

- 1. Capacity building for understanding, development and continuous implementation of MSDS.
- 2. Ecosystem for establishing its implementation by full cooperation, collaboration, commitment of
- 3. Continuous monitoring
- 4. Continuous audit
- 5. Continuous training, refresher courses with purpose of reinforcement
- 6. Continuous quality improvement
- 7. Continuous Strengths, Weaknesses, Opportunities, and Threats (SWOT) analysis and gap identification
- 8. Continuous strategy making and implementation with backup plan for secondary options.
- 9. Responsibility designation for clinical and non-clinical procedures and activities.
- 10. Effective utilization, calibration and maintenance of equipment with record maintenance and their audit
- 11. Establishment of plans, implementation, analysis of gaps with alternate planning regarding fire evacuation plan, hospital inflectional control plan, hospital operational and

strategic plans, disaster plan both internal (partial / complete) and external.

The PDSA cycle

- 1. Developing a plan to test the change (Plan),
- 2. Carrying out the test (Do),
- 3. Observing and learning from the consequences (Study), and
- 4. Determining what modifications should be made to the test (Act).
- 5. Monitoring effective load sharing of Human resource and equipment within hospitals.
- Addition of new HR/ rationalization on requirement of MSDS indicator compliance for effective departmental organization and their planned trainings by MPDD, UHS ETC
- 7. Standard optimization of Standard operating procedures and methods for their effective adoption by hospital human resource.
- 8. We have also extended our MSDS implementation in 20 more departments such as dentistry, ICU, CCU, Dialysis, mortuary, burn unit, physiotherapy, orthopedics, medicine, nursing, paeds, ophthalmology, derma, TB, urology, patient transfer system, store and purchase, audit and accounts, procurement, planning etc. We are also in process of preparing manuals, SOPS, plans, universal forms, and universal registers with universal tracking system of record.
- 9. We have developed an application for continuous monitoring of MSDS compliance.

Health managers are considered essential at both the strategic and operational levels of health systems. To gain an initial understanding of the management workforce for service deliver. Every health system desires managers who are competent and have the knowledge, skills and demeanor to be effective. The performance of health services managers will depend in part on how certain standard support systems function. Even good managers will have problems if procedures for running finances, staff, etc., are not working well. Functional systems should have clear rules and regulations, good guides and forms, effective monitoring and supervision and appropriate support staff, e.g. account staff, supplies and information staff and secretarial support A health manager is supposed to be competent in planning, budgeting, financial management systems personnel management systems, including performance management, procurement and distribution systems for drugs and other commodities, information management and monitoring systems, systems for managing assets and other logistics, infrastructure and transport. Support systems help to ensure uniformity in management practices and ensure that management and administrative systems function and get results.

5.3.3.3 Laboratory

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the Laboratory in THQ hospitals. Majority of patients are suffering problems some time life threatening phases due to delay in diagnosis and treatment according to diagnosis in case of lack of laboratory in vicinity.

5.3.3.4 X-Ray

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the Radiology unit in THQ hospitals. Majority of patients are suffering problems some time life threatening phases due to delay in diagnosis and treatment according to diagnosis in case of lack of Radiology unit in vicinity. A healthy human being enables not only nutrition of the physical body but also enhances social interaction and promotes self-esteem and feelings of self-esteem and feelings of wellbeing. The radiology equipment serves as a "window "to the patient treatment regarding the body.

5.3.3.5 CCU

Understanding these ground realities Primary and Secondary Healthcare Department, Government of the Punjab has decided to establish coronary care units (CCU) in THQ hospitals as a part of its Revamping Program. This will improve the quality of healthcare and timely provision of life saving treatment will be possible to large number of patients. A coronary care unit (CCU) is a special department of a hospital or health care facility that provide coronary care to patients. Coronary care units cater to patients with severe and life-threatening cardiac illnesses and which require constant, close monitoring and support from specialized equipment and medications in order to ensure normal bodily functions.

Coronary care units are staffed by highly trained doctors and nurses who specialize in caring for cardiac patients. They are also distinguished from normal hospital wards by a higher staff-to-patient ratio and access to advanced medical resources and equipment that are not routinely available elsewhere. Common conditions that are treated within CCUs including angina, myocardial infection, cardiac arrhythmia, cardiac shock etc. Patients may be transferred directly to coronary care unit from an emergency department or from a ward if they rapidly deteriorate, and immediately require cardiac care treatment.

5.3.3.6 Dialysis Unit

Chronic kidney disease is now a significant public health problem worldwide. Chronic kidney disease globally affects almost 10 % of general population with Incidence in prevalence of disease are still rising especially in

developing countries .The rise in chronic kidney disease is by aging of the populations and growing problems of obesity, diabetes, high blood pressure and cardiovascular diseases.

Tehsil head Quarter Hospital (THQ) serve large catchment populations of the district and provide a range of specialist care in addition to basic outpatient and inpatient services. Patient who are in need of dialysis, are referred to tertiary care hospital due to non-availability or insufficient number of dialysis machines. Patient's condition not only deteriorate but also compromise the effectiveness of life saving intervention due to approaching to other cites or to costly private setups of dialysis. Primary and Secondary Healthcare Department has decided to establish & strengthening already existing 5 bedded dialysis unit at THQ hospitals. This will improve the quality of healthcare and timely provision of life saving treatment will be possible to large number of patients.

Dialysis unit is a special department of a hospital or health care facility that provides a lifesaving support to patients with chronic renal disease along with pre-existing diseases like diabetes, hypertension, ischemic heart disease to ensure normal bodily functions. Dialysis units are staffed by highly trained doctors, dialysis technicians and dialysis nurses who have done specialized training in caring for such patients. Patients are usually admitted from out door and often from emergency and registered for their timing and schedule of dialysis because these patients are given regular appointments twice or thrice a week as per defined by nephrologist/physician.

5.3.3.7 <u>Labor Rooms/Nurseries</u>

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the Labor Rooms/Nursery unit in THQ hospitals.

5.3.3.8 Operation Theater

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the Operation Theater in THQ hospitals. Majority of patients are suffering problems some time life threatening phases due to delay in treatment according to diagnosis in case of lack of Operation Theater in vicinity.

5.3.3.9 Orthopedic unit

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the orthopedic unit in THQ

hospitals. Majority of patients are suffering problems some time life threatening phases due to delay in diagnosis and treatment according to diagnosis in case of lack of orthopedic unit in vicinity.

5.3.3.10 Gynecology Department

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the gynecology unit in THQ hospitals. Majority of patients are suffering problems some time life threatening phases due to delay in diagnosis and treatment according to diagnosis in case of lack of gynecology unit in vicinity.

5.3.3.11 Surgical Unit

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the surgical unit in THQ hospitals. Majority of patients are suffering problems some time life threatening phases due to delay in diagnosis and treatment according to diagnosis in case of lack of surgical unit in vicinity.

5.3.3.12 Intensive Care Unit (ICU)

Tehsil Headquarter Hospitals (THQ) serve catchment populations of the whole Tehsil (0.5-1 million) and provide a range of specialist care in addition to basic outpatient and inpatient services. They typically have about 80 to 150 beds and a broad range of specialized services including surgery, medicine, paediatrics, obstetrics, gynaecology, ENT, ophthalmology, orthopaedics, urology, neurosurgery etc. Patient who are in need of intensive care are usually referred to tertiary care hospital but due to long distance they had to travel and time consumed on road due to heavy traffic and other unavoidable circumstance ,patient's condition not only deteriorate but also compromise the effectiveness of life saving intervention. Understanding these ground realities Primary and Secondary Healthcare Department, Government of the Punjab has decided to establish intensive care units (ICU) in THQ hospitals as a part of its Annual Development Plan. This will improve the quality of healthcare and timely provision of life saving treatment will be possible to large number of patients.

Primary and Secondary Healthcare Revamping programme (PSHRP) is the initiative by the Chief Minister of Punjab to strengthen the healthcare delivery system in the province Acquisition of licenses for all THQ Hospital by developing and implementing uniform set of standard Operating procedures (SOPs) & standard medical protocol (SMP) for compliance to MSDS of PHC is planned as a part of PSHRP.

An **intensive care unit (ICU)** is a special department of a hospital or health care facility that provides <u>intensive treatment medicine</u>. Intensive care units cater to patients with <u>severe and life-threatening</u> illnesses and injuries, which require constant, close monitoring and support from specialized equipment and medications in order to ensure <u>normal bodily functions</u>. Intensive care units are staffed by highly trained <u>doctors</u> and <u>nurses</u> who specialize in caring for critically ill patients. They are also distinguished from normal hospital wards by a higher staff-to-patient ratio and access to advanced medical resources and equipment that are not routinely available elsewhere. Common conditions that are treated within ICUs include <u>ARDS</u>, <u>trauma</u>, <u>multiple organ failure</u> and <u>sepsis</u>. Patients may be transferred directly to an intensive care unit from an <u>emergency department</u> if required, or from a ward if they rapidly deteriorate, or immediately after surgery if the surgery is very invasive and the patient is at high risk of complications.

5.3.3.13 Mortuary Unit

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the mortuary unit in THQ hospitals. Postmortem or autopsy is a part of medico legal investigation into a death which is conducted by a judicial medical officer. Realizing the problems countered medico legal process focusing on following important areas;

- 1. Improving quality and motivation levels of human resource conducting medico legal Examination.
- 2. Improve methods to collect and preserve samples so that so that these may best be available for further forensic analysis.
- Improving physical infrastructure at tehsil level to provide enabling environment for better conduct of medico legal cases including improvement in state of mortuaries at tehsil level.
- 4. Improvement in legal framework including improved forms.

5.3.3.14 Dental Unit

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the dental unit in THQ hospitals. Majority of patients are suffering problems some time life threatening phases due to delay in diagnosis and treatment according to diagnosis in case of lack of dental unit in vicinity.

5.3.3.15 Physiotherapy Unit (33 THQ Hospitals)

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the physiotherapy unit in all THQ hospitals. Majority of patients are suffering problems some time life threatening phases due to delay in diagnosis and treatment according to diagnosis in case of lack of physiotherapy unit in vicinity.

- 1. Physiotherapy is a "science of healing and art of caring". It pertains to the clinical examination, evaluation, assessment, diagnosis and treatment of musculoskeletal, Neurological, Cardio-Vascular and Respiratory systems 'functional disorders including symptoms of pain, edema, and physiological, structural and psychosomatic ailments. It deals with methods of treatment based on movement, manual therapy, physical agents, and therapeutics modalities to relieve the pain and other complications. Hence, Physical therapy covers basic parameters of healing sciences i.e. preventive, promotive, diagnostic, rehabilitative, and curative.
- Physiotherapy practice has a very long history and a modern clinical practice is heavily reliant on research and evidence based practice. The Primary and Secondary Healthcare Department Government of Punjab attests to this commitment by adopting and promoting the Standards of Practice for Physiotherapy.

Importance of Physiotherapy and Rehabilitation department

- 1. Physiotherapy provides services to individuals and populations to develop maintain and restore maximum movement and functional ability throughout the lifespan. This includes providing services in circumstances where movement and function are threatened by aging, injury, disease or environmental factors. Functional movement is central to what it means to be healthy.
- 2. Physiotherapy is concerned with identifying and maximizing quality of life and movement potential within the spheres of promotion, prevention, treatment/intervention, habilitation and rehabilitation. This encompasses physical, psychological, emotional, and social wellbeing. Physiotherapy involves the interaction between physical therapist, patients/clients, other health professionals, families, care givers, and communities in a process where movement potential is assessed and goals are agreed upon, using knowledge and skills unique to physical therapists.
- 3. The proposed project entails setting up a Physiotherapy and Rehabilitation Department. Being one of the major players in human service sector, rehabilitation Departments provide a wide range of services relating to physical impairments and disabilities of all age groups. These services range from assessment, evaluation, diagnosis, treatment and plan of care of individuals, from newborns to the very oldest, who have medical problems or other health-related conditions that limit their abilities to move and perform functional activities in their daily lives. These services will be provided by qualified Physiotherapists Consultants. Our consultants

examine each individual and develop a plan using treatment techniques to promote the ability to move, reduce pain, restore function, and prevent disability. In addition, our doctor work with individuals to prevent the loss of mobility before it occurs by developing fitness- and wellness-oriented programs for healthier and more active lifestyles. The proposed Physiotherapy and Rehabilitation Department will provide all these services under one roof.

Opportunity Rationale

Due to vast media exposure over past few years, women, as well as men, have become more conscious about their health especially youngsters. In Pakistan, Rehabilitation Clinics and Fitness Centers have grown over the years. It is easy to open GP clinic as space and skill requirement is very basic. But a Rehabilitation clinic provides more professional services with qualified staff including Physiotherapy doctors and experienced support staff and therefore, requires more planning and arrangement. Quite a few Physiotherapy and Rehabilitation Departments have opened in Lahore, Islamabad, Karachi and other relatively larger cities of Pakistan, which are catering to the demand of the people, but still there is a lot of unfulfilled demand as can be judged from excessive rush at the existing Physiotherapy Departments. The patient's ratio and problems with musculoskeletal disorders and neurological disorders are same in the tehsils and districts levels of Punjab. The business is service-oriented and carries large potential for serving poor people due to its unique nature and uncontrolled spreading of joints and muscles, and neurological problems, especially in the areas where our THQ Hospitals are located. There is lot of potential in this domain, especially for those who are committed to providing quality service.

5.3.3.16 Queue Management System (QMS)

OPD in THQ has enormous patient load, due to the only big public sector serving hospital in Tehsils. At the moment the ticket system is prevailing but there is no mechanism to handle that ticket and assign number to the ticket and its being issued in manual format. This will also create dependency on the person issuing the ticket. After getting the tickets, patient will be provided with no guidance on where to go and when his term will come to meet the doctor and get the required service. This will create confusion and delayed service delivery. On the other hand it will waste lots of time on the end of doctor and patient as patient and doctor has no direct liaison with each other. Moreover, patient will again have to be dependent on some person to check that either doctor is free or any patient sitting in his facility. Here again, human intervention and dependency will come into play.

This project basically aims to remove all the human related dependency till the patient reach the doctors. Moreover, it also includes, recording basic information for a patient and guiding him to the doctors room from registration count to triage without any dependency on hospital staff. This will improve the transparency as per the vision of good governance and serve the patient in an efficient and transparent manner. This will also help the patient in estimating that time estimate till his term which will give him relief and more belief on the fair system. On the other hand doctor will always have an idea that how many patients will be in queue and give him direct liaison with the patient sitting outside.

The need of queue management system is evident in hospital from the fact of lack of proper mechanism of patient queue management at OPD's, human resource deficiency and non-functional equipment. The Implementation of Queue Management System will provide and streamline Patient Queue Management at OPD with Ticket Generation and Display of Numbers on the counters. This will help in maintaining the queue on First IN First OUT (FIFO) basis. The system will also provide the information counter to the general public to educate them in the use of queue management system and short description of the process. After implementation of this system, the incoming patient will be guided in a manner to get the service on his turn without any dependency or interference of an external resource. All will be handled in an automated way with patient are being served at their turn.

The system manages the patients load, organizes the patient's queues in an adequate manner and gives them the ease in waiting area; and they will be examined gracefully by doctors at their turn. Basic information of the patient is also linked with its ticket, being taken at the first counter. This will help established a unique ID against each patient. This will also lead to the establishment of Electronic Medical Record. The Process flow of Queue Management System at THQ is given as follows:

There are 25 counters at THQ level including basic registration counter, triage counter, consultant office and hospital pharmacy. There is one ticketing machine with a bifurcation of male, female and old age person. The ticket will be issued to the relevant category accordingly. After receiving the ticket the said number will be blinked on male, female and old age counter. The person will move to that counter where he will be asked about his basic details which will be entered in the basic registration form software linked with QMS and that specific token / ticket number. He will also be asked about the disease and accordingly the relevant consultant / specialty area e.g. pediatrics, ophthalmology etc. after registering, he will take the printout and give the slip to patient / attendant along with its token number.

The basic fee of OPD will be received at the registration counter and accounted for in the basic registration software linked with QMS. The same token number will be displayed on the triage counter where his vitals will be taken and written on the same registration slip available with the patient. Now, keeping in view the specialty area the token number will be displayed on the relevant consultant office and he will be checked by relevant consultant. The consultant than diagnosed the medicine or either to admit it after his examination. In case of medicine he will be sent to hospital pharmacy where again the same ticket number will be displayed. There have to be an option available with the doctor to either redirect him to the hospital pharmacy or other (medical tests, referred to IPD). On displaying the same token number at pharmacy counter the patient will move to pharmacy counter along with his token number and registration slip and take prescribed medicine. Patient will be disposed from that window and process of QMS will be completed. There will be no entry in the basic registration software on the counters of triage, doctor at the moment. Detail of equipment is attached.

The process described above for THQ will be implemented. The important constraints for the systems are:

- Same token number will be used at all the counters and patient will be getting the ticket from ticketing machine only once at the time of entry.
- 2. QMS will cater for missed, skipped or delayed patient at any counter.
- 3. There will be two LED displayed at different location in the waiting area to guide patients about the process details and to display token number along with announcement in URDU.
- 4. The gap between each display panel from ticketing machine to pharmacy can be customized according to requirement e.g. 5, 10, 30, 60 seconds etc.

5.3.3.17 Electronic Medical Record (EMR)

Establishment of network infrastructure, establishing a central data center, connectivity of different building through fiber, are also the major components of the revamping project in terms of ICT. This will including provision of networking point at all nursing stations and important areas where entries regarding patients' needs to be made e.g. Radiology/Pathology, Indoor, outdoor etc. This will serve as backbone to implement the Electronic Medical Record System in the Hospital which has the key feature of generating Unique Medical Record Number for each patient.

This MR number will serve as an identity for patients during their treatment, retrieval of records and for decision making.

EMR will also be able to log the patient for treatment being provided to him in different areas of hospital i.e. OPD, Pathology, Radiology, Surgery, Indoor, etc. and their integration. This will be achieved by entering the relevant information at each department against specific MR number of a patient in the Customized / Purpose build software (EMR) for these public healthcare facilities.

This entry of MR number against each patient in hospital will build a large database for patient and relevant diseases. This will help in analysis disease / epidemic prevention and better patient care through retrieval of patient history and proper diagnoses at physician end. Implementation of patient registration, Record keeping, physical queue management, E-prescription, supporting IT interventions for EMR and medicine dispensation. Detail of equipment is attached.

5.3.3.18 Video Surveillance through CCTVs

Installation of network based CCTV cameras is an important module in the ICT part of revamping project. Scope of this component is to install 60 to 80 cameras in each hospitals at important location i.e. entry, exit, OPD, waiting areas, Parking for surveillance and security purposes. This will also serve as major input to the security services by Outsourced Security Company in the hospitals. Moreover, there will be small scale central control room at each hospital to monitor the allocated locations where the cameras have been installed. This system will also have the facility to record the video for 15 days for all the cameras so that recording of specific duration can be produced on demand. This will also have the facility of central control room which has the capacity to access the camera of THQ hospitals and to view and monitor the area of specific camera within specific hospital at any given time. Therefore, it will establish a centralized surveillance and security mechanism for these 85 public sector healthcare facilities. Detail of equipment is attached.

5.3.3.19 Medicine Store

To improve the quality of medical care of patients, primary and secondary Healthcare Department has decided to improve the medicine store in THQ hospitals.

5.3.3.20 Day Care Center

On-site (or near-site) child care would lead to improve workplace satisfaction by allowing employers more frequent contact with their children,

reducing stress and anxiety over scheduling, and potentially providing financial benefit to the hospital. Therefore, P&SH Department has decided to establish the Day Care Center at every THQ Hospital. The Medical Superintendent of the concerned hospital will be the overall in-charge of the Day Care Center.

5.4 Out Sourcing of Non Clinical Services

It was planned to provide Outsourcing of following Non-clinical services through development Budget later on decided to shift to non-development Budget as per the decision of progress review meeting chaired by the Chairman P&D Board dated 01-01-2018 w.e.f. 30-06-2018:-

- 1. Janitorial services
- 2. Laundry services (On hold)
- 3. MEPG Services
- 4. CT scan
- 5. Security

5.4.1 Janitorial services

These services include cleaning of hospitals and its roads and ROW areas. Internal cleaning comprises of complete cleaning along with washrooms cleanliness and material for these services such as hand wash/sanitizer. The Outsourcing is hereby designed keeping in view the sizes of areas assigned to each sanitary worker along with condition and nature of service. Human resources are planned after measuring the total area of hospital, built up area excluding the areas of horticultural land and residential buildings. The workers shall work in three shifts in a day. Half of the total strength of sanitary workers shall work in morning shift due to patients load in OPD. The concerned sanitary work company is bound to provide cleaning services materials and their refilling as and when required.

The companies providing janitorial services will be required to provide quality janitorial services, complete their personnel strength on daily basis which will be ensured through biometric attendance. Also, the companies will be subject to pecuniary penalties by hospital authorities if services provided are not according to the contracts.

5.4.2 Laundry Services

Different models were being applied by the hospital administrations individually which were not properly catering the basic requirement of washing and disinfection of different items used for hospitals. This model includes the initial procurement of different daily use items such as three different colors bed sheets and pillow covers and are to be changed thrice a day. Moreover, the concerned company must provide washing and cleaning services of bed sheets, pillow covers, blankets along with covers, apparels/OT clothes.

5.4.3 MEPG Services

The service of the hospitals is suffering badly due to improper functionality of the existing electrical and mechanical equipment which arises due to lack of maintenance. This model satisfies the need of proper maintenance plan which comprises of regular visits of technicians for looking after of electrical and mechanical equipment and accessories. Outsourcing company will be responsible for immediate response and above mentioned services.

5.4.4 CT Scan Services

CT Scan Services in selected Hospitals of Punjab are also being undertaken as a component of Government's decision to revamp all Secondary Healthcare. The objective of this initiative is to provide high quality CT Scan Services to widely scattered population of low socio-economic groups at their door steps. It will ensure provision of satisfactory diagnose infections, muscle disorders, and bone fractures. The imaging technique of CT Scan can help doctor to study the blood vessels and other internal structures and assess the extent of internal injuries and internal bleeding.


5.4.5 Security

The outsourcing model is designed due to non-provision of security arrangements and improper parking in different areas of premises of hospital. This model consists of guards who shall work in two shifts to provide security and surveillance for complete premises of hospital excluding residential areas. The devices required for this service to operate are arms, walkie talkie, Base set per unit and torch etc.


5.6 HR & Management Interventions Structure

HR Interventions can be broadly classified into introduction of New Management Structure (NMS) staff.

New Organogram of Hospital

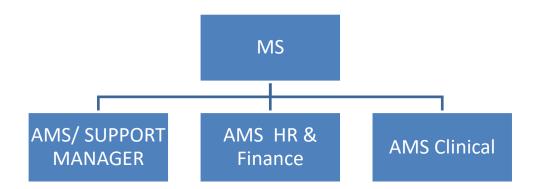

MS •AMS/ SUPPORT MANAGER •IT/Data Analysis •IT/ Statistical Officer •4 Data Entry Operators Admin Admin Officer •4 Monitors Security Transport Parking Janitorial Canteen •External House Keeping •Civil Works Technical works •Electrical Works •Internal House Keeping Laundry •Stores & Supplies

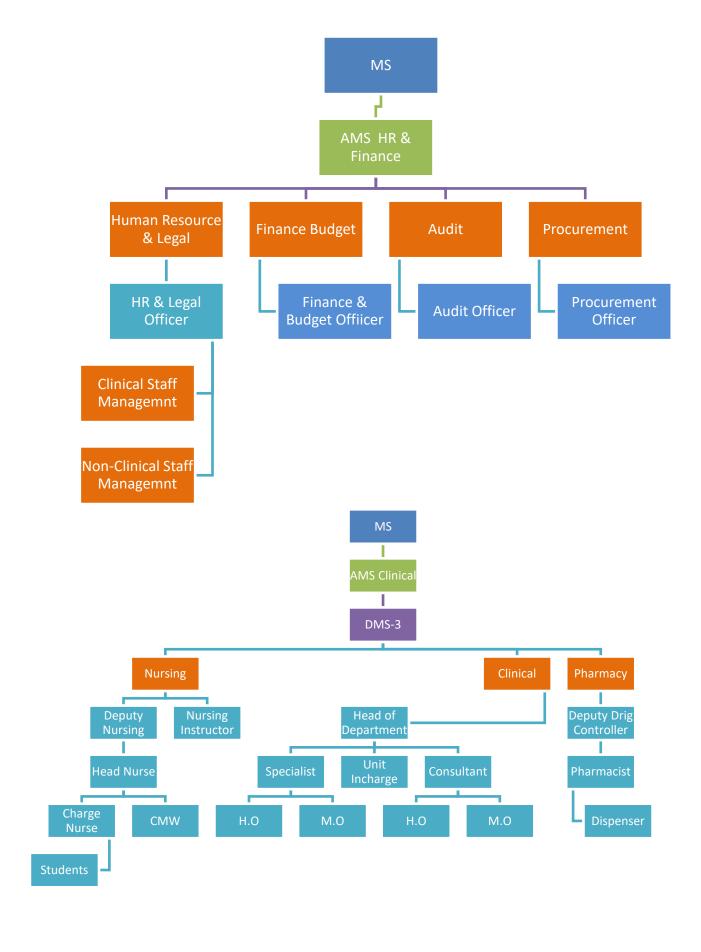

5.6.1 <u>Non Clinical HR Interventions (Human Resource (HR) Plan</u> <u>Management Structure)</u>

Institution will run under the administrative control of Medical Superintendent, who will control this with the collaboration and cooperation of 3 Additional Medical Superintendents including AMS (Admin), AMS (HR & Budget) and AMS (clinical), 3 Deputy Medical Superintendents (morning, evening and night) will be reporting to AMS Clinical. Each clinical facility will be further controlled by head of concerned department and 6 administrative posts of HR & Legal Officer, IT/Static Officer, Budget & Account Officer, Admin Officer, Procurement Officer and Audit Officer will be provided as supporting hands for AMS Admin and AMS HR & Budget for smooth execution of hospital tasks.

Responsibilities / Job Descriptions, Eligibility & Financial Implications for Management Structure of Hospital

5.6.2.1 Medical Superintendent

Shall be overall responsible for all the affairs of the Hospital

5.6.2.2 AMS Admin.

Shall be responsible for following functions in addition to his own duties:

- 1. General administration
- 2. IT/Data analysis/statistics keeping (biometric machines, etc.).
- In case of outsourced interventions like QMS/EMR he shall be responsible for enforcement of contract and in case of violation shall ensure action has been taken as envisaged in the contract.
- 4. He shall be responsible for entry of data on Citizen Feedback Model.
- 5. He shall be responsible for ensuring collection of report of actions taken on CFM reports and entry of that on CFM.
- 6. He shall be responsible for implementation of any IT related initiative in the hospital.
- 7. He shall be responsible for better record keeping of hospital
- 8. He shall devise and implement systems for better record keeping of hospital

9. He shall ensure generation of all types of reports/information required of hospital by District Government/P&SHD/any other authorized Public agency

New Management Structure (NMS)

In place of the clerical positions, the P&SH Department has introduced a New Management Structure (NMS), in all District and Tehsil Headquarters Hospitals. The officers recruited as a part of the NMS have a minimum of 16 years of education. Their minimum qualification is MBA / B.Sc. Engineering / M.Com / Pharm-D / M.Cs / LLB / MPA / CA Inter / ACCA / ACMA / Master Degree or equivalent in relevant field etc. Their recruitments were undertaken through a competitive process by a third party testing service.

5.6.2.3 Admin Officer

Shall be responsible for general administrative affairs of hospital along with following functions:

- 1. Security
- 2. Transport
- 3. Parking
- 4. Janitorial
- 5. External housekeeping
- 6. Electrical works
- 7. Internal housekeeping
- 8. Laundry
- 9. Stores & supplies

In case these functions have been outsourced, he shall be responsible for enforcement of these contracts and shall ensure that penalties are imposed in case of violation of contract. In case he fails to enforce contract and the outsourced function is not performed at par as per contract and penalties have not been imposed he shall be liable for non-action. Moreover, only reporting of violation of contract shall not suffice but he has to ensure follow up till the penalty has been imposed and action as envisaged in contract in case of violation has been taken.

Eligibility Criteria

 Minimum qualification Masters' degree in Economics/ Public Administration/ Finance/ MBA Finance/Administration or equivalent from HEC recognized University 2. Minimum 2 years post degree experience of administration (Additional credit may be given for hospital administration/ Public sector administration of similar nature)

5.6.2.4 <u>Human Resource Officer</u>

Shall be responsible for following:

- Issuance of monthly Duty rosters & special duty rosters of Eid,
 Muhurram etc. of all clinical & non-clinical staff in hospital
- 2. Issuance of Transfer/postings orders within hospital
- 3. Taking of joining from new incumbents and charge relieving orders of relinquishing officials
- 4. File maintenance of all employees of hospital
- 5. Record of all enquires of employees of hospital
- 6. Leave record of employees
- 7. Adjustment of officials on duty during leave of concerned employee
- 8. Litigation/ legal issues of hospital (shall ensure all court cases are well attended and all legal matters of hospital are well taken care of)
- 9. Any other HR related function assigned by MS/AMS

Eigibility Criteria

- Minimum qualification Masters' degree in Economics/ Public Administration/ Finance/ MBA HR/Management/ Finance/Administration or equivalent from HEC recognized University
- 2. Minimum 1 year post degree experience of administration (Additional credit may be given for hospital administration/Public sector experience of similar nature)

5.6.2.5 IT/Statistical Officer

He shall be responsible for IT support for all IT interventions in the hospital.

He shall be in liaison with HISDU, P&SHD for proper reflection of hospital record on HISDU dashboard. In case there is any discrepancy or error he shall resolve the issue. Moreover, he shall be responsible for functionality of all IT equipment.

Eligibility Criteria

- Minimum qualification Masters' degree in Computer Science or equivalent from HEC recognized University
- 2. 2 years post degree experience of IT/Data analysis(Additional credit may be given for similar assignment experience)

5.6.2.6 Finance & Budget Officer

Shall be responsible for following:

- 1. Handling of all financial matters of hospital
- 2. Petty cash handling
- 3. Preparation of budget
- 4. Budget review
- 5. Maintenance of accounts and record
- Any other function assigned by AMR HR & Finance/MS/P&SHD

Eigibility Criteria

- Minimum qualification Masters' degree in Finance/ MBA Finance or equivalent from HEC recognized University (Additional credit may be given to Charter accountant/ACCA)
- Minimum 2 years post degree experience of Finance, Accounts
 Budget (Additional credit may be given for Public sector experience of similar nature)

5.6.2.7 Procurement Officer

Shall be responsible for following functions:

- 1. Procurement of all kinds for hospital
- 2. Shall be in liaison with P&SHD for procurements being conducted
- 3. Any other function assigned by AMS HR & Finance /MS/P&SHD

Eigibility Criteria

- Minimum qualification Masters' degree in Finance/ MBA Finance or equivalent from HEC recognized University
- 2. 2 years post degree experience of procurement (Additional credit may be given for public sector experience of procurement)

5.6.2.8 **Quality Assurance Officer**

He shall be responsible for quality of all things in the hospital.

Eligible Criteria

 Masters in Total Quality Management / Masters in Public Health/ Masters in Health Administration/ Masters in Hospital Management / Masters in Biochemistry / Biotechnology / Molecular Biology / Microbiology from an HEC recognized University or equivalent.

OR

16 years education along with Post graduate diploma in Total Quality Management/ Post graduate diploma in Health Safety and Environmental Management System / Post graduate diploma in Healthcare and Hospital Management / Quality Assurance or equivalent.

2. Minimum 1 Year post degree relevant experience.

5.6.2.9 Logistics Officer

He shall be responsible for Supply Chain, logistics, fleet, warehousing and inventory management, clearing and forwarding in the hospital.

Eligible Criteria

- 1. M.Sc. Supply Chain Management/ MBA or Equivalent.
- 2. One year experience in Supply Chain, logistics, fleet, warehousing and inventory management, clearing and forwarding.

5.6.2.10 Data Entry Operators (DEO)

Four Data entry operators shall help IT officer in dispensation of his responsibilities.

Eligible Criteria

 Minimum qualification BA / B.Sc / B.COM / BCS or equivalent from HEC recognized University. In case of BA/B.COM candidate must have six months computer course / Diploma.

- 2. Proficient in MS Word/ MS Excel/ MS Power point (additional credit may be given for additional relevant certified computer courses)
- 3. 1 years post degree relevant experience

5.6.2.11 Assistant Admin Officer

Shall be responsible for general administrative affairs of hospital and assist the admin officer.

Eligibility Criteria

- Minimum qualification Masters' degree in Social Sciences/Economics/ Public Administration/ Finance/ MBA Finance/Administration or equivalent from HEC recognized University
- 2. Minimum 2 years post degree experience of administration (Additional credit may be given for hospital administration/Public sector administration of similar nature).

5.7 HR for QMS and MSDS and Day Care Center.

5.7.1.1 QMS Supervisor / Information Desk Officer

Shall be responsible whole QMS networking

Eligible Criteria

- M.Sc. (Comp. Engineering, Electronics, Electrical Engineering, IT, Telecommunication, Com. Science, Software Engineering, MCS), BCS (Comp. Engineering, Electronics, Electrical Engineering, IT, Telecommunication, Com. Science, Software Engineering, MBA, BBA, MPA, IT related 16 years Education.
- 2. Experience in the field of Software/Hardware/Network/DATA Quality Assurance, IT projects, IT enabled organizations, CCTV Control Room monitoring, Call Centre, Networking, Software Development will be considered as an added advantage during interview process.
- 3. Excellent communication Skill (Urdu, English) and IQ level
- 4. Age Limit of 21-28 years for Male & 21-30 years for Female
- 5. Typing Speed: 30WPM.

5.7.1.2 Computer Operators

Eight Computer operators shall help QMS Supervisor in dispensation of his responsibilities.

Eligible Criteria

- 1. Minimum qualification 14 year or Masters' degree from HEC recognized University
- 2. Proficient in MS Word/ MS Excel/ MS Power point (additional credit may be given for additional relevant certified computer courses)
- 3. 35 Word per Minute. Excellent communication in English and Urdu.

5.7.2 Consultants (MSDS) Implementation & Clinical Audit

Eligible Criteria

- 1. MBBS & Masters in Public Health, or equivalent qualification.
- 2. The consultant must have 10 years of hands on experience of third party validation, clinical audit of hospitals, Minimum Service Delivery Standards (MSDSs) implementation / hand holding; Report Writing; working knowledge of international best practices in hospital management will be preferred. Proficiency in MS Office is must. Must have strong communication skills.

5.7.2.1 <u>Terms of Reference (TORs) for Consultants Minimum Service</u> <u>Delivery Standards (MSDS) Implementation & Clinical Audit</u>

Government of the Punjab, Primary and Secondary Healthcare Department (P&SHD) is implementing multiple initiatives to improve the quality of healthcare at DHQ/THQ level across the province. One of the initiatives is Primary and Secondary Healthcare Revamping program which is being implemented by the Project Management Unit (PMU). Currently PMU is also involved in the standardization of quality of care at facility level through uniform set of Standard Operating Procedures (SOPs) & Standard Medical Protocols (SMPs) for compliance. The department intends to make all DHQs and THQ hospitals of Punjab as MSDS compliant which have been devised by Punjab Healthcare Commission.

Punjab Healthcare Commission was established under the PHC Act 2010 as an autonomous regulatory body for health sector; with the purpose of improving the quality, safety and efficiency of healthcare service delivery for all Public and Private Healthcare Establishments (including Allopaths, Homeopaths and Tibbs) in the province of Punjab. The Punjab Healthcare Commission has developed

Minimum Service Delivery Standards (MSDS) for all hospitals to improve the quality of healthcare services all over the Punjab. All Healthcare Establishments are required to implement MSDS to acquire a License to deliver healthcare services in Punjab.

This standardization effort will not only ensure availability of minimum services delivery standards (MSDS), SOPs, SMPs at all levels, but also the other essential inputs for functioning of systems and processes to ensure the smooth and safe delivery of quality healthcare services. These will also create conducive working environment for healthcare providers.

5.7.2.2 Objectives

The objective of this assignment is to implement & check all SOPs, SMPs, Minimum Service Delivery Standards (MSDS) & conduct clinical audit for 125 DHQ/THQ hospitals. Furthermore, the consultant will also monitor ongoing multiple trainings at DHQ/THQ hospitals.

5.7.2.3 Scope of Work

- 1. Develop policy & strategy for clinical audit of 125 hospitals.
- 2. Develop detailed clinical audit plan, with expected deliverables from hospitals. 360 degrees clinical audit.
- Visit DHQ/THQ hospitals, to assess MSDS implementation and detailed report generation with short coming & highlight areas of improvement.
- 4. Review SOPs, SMPs & ISO Standards in hospitals to identify non-compliance.
- Visit DHQ/THQ hospitals to implement clinical audit as per devised strategy, as well as monitoring and implementing MSDS standards.
- 6. Prepare detailed visit reports of clinical short comings; and suggest, and implement improvement plan.
- 7. Monitoring & auditing of patient referral system, detailed report on error and recommendations on rectification of errors.
- Visit DHQ/THQ hospitals to implement clinical audit as per devised strategy, as well as monitoring and implementing MSDS standards.
- 9. Prepare detailed visit reports of clinical short comings; and suggest, and implement improvement plan.
- 10. Monitoring & auditing of patient referral system, detailed report on error and recommendations on rectification of errors.
- 11. Monitoring and evaluation of multiple trainings imparted at DHQ/THQ hospitals.
- 12. Any other relevant task assigned by Project Director/Director Quality Assurance / Project Manager.

5.7.2.4 Reporting Arrangements

 The Consultant (MSDS & Clinical Audit) will report to the Project Director/Director Quality Assurance/Senior Project Manager, P&SHD

5.7.2.5 <u>Duration of Assignment</u>

 The duration of assignment will initially be for THREE MONTHS / 120 DAYS which will be extendable subject to satisfactory performance.

5.7.2.6 Outputs / Key Deliverables

- Study/desk review the relevant Minimum Service Delivery Standards (MSDS) prescribed by PHC & ISO Standards, train the hospital staff/monitor/facilitate their implementation.
- Study/desk review the existing Standard Operating Procedures (SOPs), train the hospital staff/monitor/facilitate their implementation and suggest improvements where necessary.
- Study/desk review the existing SMPs, train the hospital staff/monitor/facilitate their implementation and suggest improvements where necessary.
- Conduct hospital visits of 125 DHQ/THQ hospitals (each DHQ hospital to be visited monthly & each THQ hospital every three months).
- Conduct formal hospital survey for confirming the implementation of MSDS on the relevant Scoring Matrix.
- Submit detailed report of each hospital visit on a standard format prescribed for the purpose.
- Conduct a system, process analysis with special emphasis on clinical audit and submission of detailed report accordingly.

5.7.2.7 Remunerations

- The consultant will be paid amount of Rs. **4500-6500/- per day** with no other benefits.
- All logistics will be arranged/reimbursed by PMU for field visits (accommodation, refreshments etc).

5.7.2.8 Terms of Payment

 Consultant will be paid on monthly basis throughout the contract period.

5.7.3 HR for Day Care Center

5.7.3.1 Manager Day Care Center (DCC)

Shall be responsible for general administrative affairs of DCC.

Eligibility Criteria

- Minimum qualification Masters' degree in Economics/ Public Administration/ Finance/ MBA Finance/Administration or equivalent from HEC recognized University
- 2. Minimum 2 years post degree experience of administration (Additional credit may be given for hospital administration/ Public sector administration of similar nature)

5.7.3.2 Montessori Trained Teacher

Shall be responsible for basic education of children.

Eligibility Criteria


- 1. Minimum qualification BA/BSC or equivalent from HEC recognized University along with B.Ed.
- Minimum 1 years post degree experience of teaching (Additional credit may be given for Public sector teaching of similar nature)

5.7.3.3 Attendant / Care Giver

Shall be responsible for special care of the children.

Eligibility Criteria

Minimum qualification Matric or equivalent alongwith diploma in relevant field

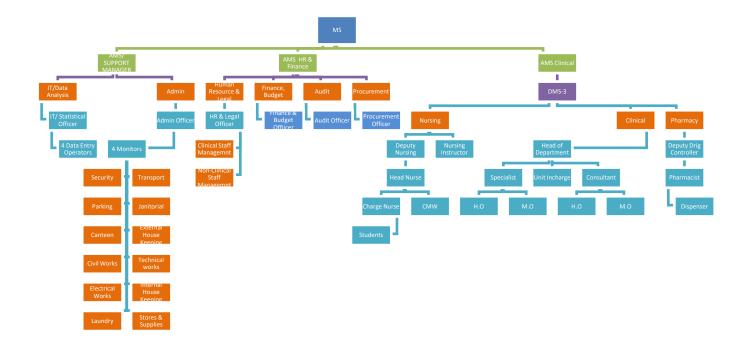

The Planning & Development Board vide letter No.12(24)PO(COORD-II)P&D/2022 dated 14-07-2022 has informed that revised standard pay package were discussed and approved by the 83rd PDWP meeting held on 28-06-2022 under the chairmanship of Chairman P&D Board for all ADP funded Project posts of Department /Organizations working in Government of the Punjab:

Project Pay Scale (PPS)	Revised Project Pay Scales (Permissible Range) (PKR)	Annual Increment Up to % age
PPS-1	28,000 44,800	10
PPS-2	35,00056,000	10
PPS-3	43,750 70,000	10
PPS-4	52,500 84,000	10
PPS-5	70,000112000	10
PPS-6	105,000 172,200	8
PPS-7	157,500258,300	8
PPS-8	218,750358,750	8
PPS-9	306,250502,250	8

PPS-10	437,500700,000	5
PPS-11	612,500 980,000	5
PPS-12	875,0001,400,000	5

In view of the above the Pay package of NMS staff has been revised. Financial Implications of New Management Structure Model based on revised Standard Pay Package (PPS) approved by the 83rd PDWP meeting held on 28-06-2022:

	No. of	Original Pa	ay package	Revised Pay package			
Name of Post	Employees	Per Month Salary	Salary for One Year	Per Month Salary	Salary for One Year		
Admin Officer	1	80,000	960,000	105,000	1,260,000		
Human Resource Officer	1	80,000	960,000	105,000	1,260,000		
IT/Statistical Officer	1	80,000	960,000	105,000	1,260,000		
Finance & Budget Officer	1	80,000	960,000	105,000	1,260,000		
Procurement Officer	1	80,000	960,000	105,000	1,260,000		
Quality Assurance Officer	1	80,000	960,000	105,000	1,260,000		
Logistics Officer	1	80,000	960,000	105,000	1,260,000		
Data Entry Operator (DEO)	2	35,000	840,000	44,000	1,056,000		
Assistant admin Officer	2	50,000	1,200,000	70,000	1,680,000		
Total	11		8,760,000	849,000	11,556,000		

5.8 Other Initiatives:

There are many other initiatives which government plans to undertake in order to improve healthcare services in the province. These include:

- Rehabilitation of Emergency Ward
- Fixture of Benches
- Addition of Bracket Fans/Water Coolers/LCDs with signage
- Supply of Laboratory/ Equipment/USG/ECG etc.
- CCU Improvement
- Installation of Water filtration plants
- Replacement of Bed sheets/Pillows/Matrasses
- Installation of Transformers/Dual Connection
- Improvement of Labor rooms/Nurseries

- Maintenance and replacement of Air-conditioners through Outsourcing
- Blood Bank improvement
- Installation of CCTV Cameras
- Installation of Basic Fire-fighting Equipment
- Up gradation of Pharmacy and medicine Store
- Improvement of Internal Roads and laying of Tough pavers
- External Development
- Rehabilitation of Hepatitis/T.B Control

The PMU is essential to deliver the project end-item within budget and time limitations, in accordance with technical specifications, and, when specified, in fulfillment of project objectives.

5.9 Patient Management Protocol

5.9.1 Emergency:

- 1. Initial reception and computerization of data, issuance of medical record number and preparation of record file.
- 2. Patients seen by C.M.O. initial assessment (brief history and physical examination) is entered on the emergency slip/file initial treatment is started.
- 3. C.M.O calls the medical officer / house officer of the relevant department who takes on of the following action:
 - i. Discharges the patient from emergency department after the patient is stabilized (himself or after consultation).
 - ii. Returns the patient in emergency department and inform the consultant or call such patient is either discharged after some time i.e. 2 hours of admitted later on
 - iii. Patient is straight way admitted by the medical officer himself or in consultation with the consultant
- A separate record is maintained by each department. Each patient discusses at the morning meeting and any pitfalls are any pitfalls are corrected.
- 5. The patient who is admitted is again entered into the computer in the ward, complete history and physical examination is carried out and relevant lab & radiological investigations are ordered. (If not already done in the emergency department).

- 6. The definitive management is either started by the medical officer himself or in consultation with the consultant. (Telephone or physically). The patient is prepared for surgery if required.
- 7. At the evening round of the ward, the patients admitted throughout the day (Through OPD or emergency) are seen by the specialist. Appropriate changes in the management are carried out.
- 8. During the night, medical officer & house officer will be on duty and they will remain in contact with consultant.
- 9. In the morning round all the new admissions and old patients are thoroughly discussed management / treatment changed, surgery ordered or discharge ordered.
- 10. The discharge certificate is either prepared by the house officer or medical officer. If prepared by the house officer, it is countersigned by the medical officer

Appropriate changes are made in the computer record after discharge. The file is sent to the central record.

5.9.2 O.P.D:

- 1. After the initial registration and issuance of computerized number patient is sent to the relevant medical officer with the OPD slip/file.
- 2. The medical officer / house officer of the relevant department performs the initial assessment. The medical officer himself advises the treatment / investigation or refers the patients to the specialist or admits the patient.
- 3. After admission. The same routine is followed which has been mentioned in the case of admission through emergency.

5.9.3 Death or End of Life Management.

- 1. The decision regarding resuscitation is made at the initial stages by the medical officer / house officer or specialist in consultation with the patient himself and / attendants.
- 2. The DNR (Do not resuscitate) patients are only seen by the medical officer/ hose officer at the time of death.
- 3. For the patients to be resuscitated, a special code (blue code) is declared when patient go onto cardiac or the terminal events.
- The policy for very sick / terminal and dying patients is formulated at the hospital administration level and appropriate modifications are decided in the relevant department for each patient.

Every death is discussed weekly at the mortality committee at the department and at the hospital level cleared by the Medical Superintendent.

5.9.4 Inventory Control System

The stock keeping and issuance of such items shall also be controlled and monitored through closer supervision and checks and balance system built in the software. The stock and expense of durable and consumable items will be kept in the system and also as hard copies. The main stores computers will be linked with the sub stores computers through networking. The areas like emergency. Outpatient department, Indoor registration desks, Laboratory and Radiology Department, ICUs, etc., will have linkages with the main and sub stores to know about:-

- 1. Stock in hand of various items
- 2. New receipt of these items
- 3. The items which have been issued to other departments
- 4. The Items which are not available
- 5. The expenditure incurred on the purchase.

The budget and details of account shall be linked with the financial control system.

5.9.5 Project Monitoring Committee

A Project Monitoring Committee is proposed hereby as under to monitor the project regarding Revamping of THQ Hospital:

1.	Deputy Commissioner	(Chairman)
2.	District Monitoring Officer	(Member)
3.	Executive Engineer Buildings	(Member)
4.	Assistant Commissioner Concerned	l (Member)
5.	MS THQ Hospital (S	Secretary/Member)

The committee will monitor the progress of the project and will hold regular weekly meeting to review the progress.

5.10 Relationship with Sectoral Objectives

The Government of the Punjab, Primary & Secondary Healthcare Department is in the process of undertaking number of initiatives to improve health care delivery system in the province. The Government of the Punjab is firmly committed to provide health care services at the doorstep of the community through integrated approach. A number of projects to improve emergency health care service particularly targeting on the promptness and quality have been

initiated. Although major focus is on disease prevention and health promotion strategies by providing specialist health care services to victims of various diseases in the patients is one of the top most priority. The instant project will be a major wing to health department with line departments.

Mainly the linkage with social welfare and human empowerment, labour and manpower, Education Department, Special Education, Home of the project will be in a vibrant environment in the holistic manner. The scope of the project itself aims to establish horizontal linkage with all the stakeholders through multisectorial approach. The health care facilities and ongoing services provided in the hospital will seek strength and viability from its linkage and public ownership.

6. DESCRIPTION AND JUSTIFICATION OF PROJECT

6.1 JUSTIFICATION OF PROJECT

Attached

6. <u>Description, Justification and Technical Parameters</u>

The scheme has been estimated on face of the factual basic requirements and if needed, alterations and has been quoted in this PC-1. The Population of Tehsil Kot Momin District Sargodha is more than 0.423 million. The area of the THQ Hospital Kot Momin District Sargodha is 33,872 SFT land.

6.1 <u>Description and Justification</u>

The Project Management Unit, Revamping Program, Primary and Secondary Healthcare Department planned to start the 2nd Phase of the said revamping program. The instant PC-I is also meant for provision of requisite biomedical and non-biomedical equipment, Electricity, Furniture & Fixture, Signage, HR and outsourcing for Revamping of THQ Hospital Kot Momin District Sargodha

Revamping of THQ Hospital Kot Momin District Sargodha constitutes of value addition in all major domains of the hospital including improvement of Civil infrastructure, addition of water filtration plant facility, value addition in Emergency ward and making the health facility more equipped with modern bio-medical equipment. State of the art furniture and fixtures complemented by interior and exterior decors are also part of this revamping project backed by the thought of dedicated express line of electricity to ensure smooth operations of hospitals will bring the modern health facilities in healthy and comfortable environment at the door step of masses. Introduction of new model of outsourcing of laundry services to ensure provision of neat and clean bed sheets, pillow covers, blankets etc. round the clock is also a part of this project. Fool proof security and adequate cleanliness measures of whole health facility are also proposed in this PC-I.

Civil work component will be carried out through C&W Department instead of District Health Authority for this hospital. Value addition in Emergency block is proposed in four domains i.e. Triage, Minor O.T, Specialized care room and emergency ward. Addition of Water Filtration Plant facility where it is not available as unclean or polluted water is devastating for human health. A key consideration was made while selecting furniture and its compatibility with hospital grade cleaners, detergents and disinfectants. Signage is an effective interface between the user and intended facility. Effective signage promotes the healthcare facility in a patient friendly manner. Access is an important part of quality of care. A crucial aspect for patient satisfaction is their comfort levels with the facility itself i.e. a person's ease in navigating a facility, and the timeliness in receiving care. Clear and proper signage at strategic points helps patients in reaching their destination without losing much of their valuable time and saves lot of their efforts in unnecessary enquiring from persons. In this regard, the Equipment of Emergency, Bio-Medical, Non-Bio-Medical, Electricity, Signage, Janitorial, Security, Laundry, Maintenance of Generator and Horticulture have been added as per actual requirement of the Hospital. The Equipment of MSDS, IT, Furniture Fixture, Day Care Center, HR, Medical Gases, Cafeteria are fixed in all hospitals as per yardstick established by P& SH Department. Prior to initiation of this exercise standardization of required facilities was done by committee of experts in P & SH Department and on the basis of it, gaps were identified which would be covered under this PC-I.

Justification for 3rd Revision of PC-I

- 1. Originally the Civil work component of the scheme was planned to be executed by the Health Council of the concerned District Health Authority based on cost estimates prepared by the Infrastructure Wing of PMU and approved by the DDSC. Accordingly, funds of Rs.3, Rs.5 and Rs.10 million were provided during FY 2017-18 for the execution of work as per parameters provided to these THQ Hospitals. However, no reasonable revamping civil work was carried out and hence did not fulfil the requirement and the objectives of the Revamping Program. Now P&SHD has decided to carry out further revamping of Civil work through Communication and Works Department Punjab to accomplish the uniformity of THQ Hospitals with already revamped hospitals of Phase-I. Hence the Rough Cost Estimates of the Punjab Buildings Department has been included in the civil work cost of this scheme.
- 2. Primary & Secondary Healthcare Department (P&SHD) made a decision to shift all the clerical posts in DHQ / THQ hospitals of Punjab to District Health Authorities as per notification dated 24th October, 2017. This administrative decision was taken due to a multiplicity of reasons which were adversely affecting healthcare service delivery in the hospitals. Primarily, these clerical posts were not specialized in any particular field, and therefore, the HR hired against these posts were generalized to the extent that they were not able to perform functions of Hospitals and Health Specific tasks that any medical administration should ideally perform. Additionally, public complaints against the clerical staff on issues such as behavior, performance created an environment of malfeasance in all hospitals. In place of the clerical positions, the Department introduced a New Management Structure (NMS), in all District and Tehsil Headquarters Hospitals. The officers/officials recruited as a part of the NMS have a minimum of 16 years of education. Introduction of New Management Structures (NMS) across all secondary hospitals in the Punjab, has allowed for the overall efficiency of District and Tehsil Headquarters Hospitals. In each Tehsil Headquarter Hospital HR under MNS has been provided for smooth running of the health services. Pay Package for NMS Staff was never been revised since 2017-18, therefore it was decided to approach the P&D Department for revision of Pay package. The PDWP approved revised pay page in its meeting held on 08-02-2022 based on PPS approved in 60th PDWP meeting as under: -

	60 th PDWP Meeting								
Name of Posts	PPS Assigned	Permissible Range (PKR) & Annual increment	Approved Pay Package						

HR & Legal Officer, IT & Statistical Officer, Admin Officer, Procurement Officer, Finance & Budget Officer, Logistics Officer, Quality Assurance Officer, Audit Officer and Biomedical Engineer	PPS-6	75,000-105,000 (8% annual incr.)	75,000
Assistant Admin Officer	PPS-5	50,000-75000 (10% annual incr.)	50,000
Data Entry Operator	PPS-3	35,000-55,000 (10% annual incr.)	35,000

Now the Planning & Development Board vide letter No.12(24)PO(COORD-II)P&D/2022 dated 14-07-2022 has informed that revised standard pay package were discussed and approved by the 83rd PDWP meeting held on 28-06-2022 under the chairmanship of Chairman P&D Board for all ADP funded Project posts of Department /Organizations working in Government of the Punjab. Therefore, the revised Pay Package has been incorporated in the revised PC-I.

- 3. As the gestation period of the PC-I till 30.06.2023, therefore, the cost of NMS has been revised for smooth running of the Tehsil Headquarter Hospitals and hence PC-I has been proposed till 30- 06-2025.
- 4. Infrastructure team has conducted the Joint visits with the team of C&W Department. During the field visits, few alterations were recommended by the technical teams which have been incorporated in the Revised Rough Cost Estimates of the subject scheme and have been attached with the PC-I along with comparative statement. Therefore, Civil works component cost has been increased from Rs. 47.788 million to Rs. 49.281 million due to few changes in the scope and MRS rates (2nd Bi-annual 2022).

85 THQ Hospitals covered under the Program:

The location map of the 85 THQ hospitals that will be taken up for rehabilitation in this program is given below:

PROJECT MANAGEMENT UNIT PRIMARY & SECONDARY HEALTHCARE DEPARTMENT



LOCATION OF DHQ AND THQ HOSPITALS IN PUNJAB



6.2 SECTORAL SPECIFIC INFORMATION

Social Sectors health department

7. CAPITAL COST ESTIMATES

Financial Components: Revenue Grant Number: Development - (PC22036)

Cost Center:OTHERS- (OTHERS)

LO NO:LO17010545

Fund Center (Controlling): N/A

A/C To be Credited: Assan Assignment

PKR Million

S r #	Object Code	2019	2019-2020		20 2020-2021		2021-2022		2022-2023		2023-2024		-2025
		Local	Foreign	Local	Foreign	Local	Foreign	Local	Foreign	Local	Foreign	Local	Foreign
1	A05270 -To Others	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
2	A12403-Other Buildings	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
	Total	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000

Financial Components: Capital Grant Number: Government Buildings - (PC12042)

Cost Center:OTHERS- (OTHERS)

LO NO:LO22010025

Fund Center (Controlling):LE4203 A/C To be Credited:Account-I

PKR Million

S r #	Object Code	2019	2019-2020		2019-2020 2020-2021		2021-2022		2022-2023		2023-2024		2024-2025	
		Local	Foreign	Local	Foreign	Local	Foreign	Local	Foreign	Local	Foreign	Local	Foreign	
-	A12403-Other Buildings	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	
2	2 A05270 -To Others	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	

Total	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Total	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000

			Ab	strac	ct of C	ost						
Name of THQ Hospital						Kot	Momin					
Scope of work							n million					
COOPS SI WORK		Original		1st Revised			2nd Revised				3rd Revise	d
	Capital	Revenue	Total	Capital	Revenue	Total	Capital	Revenue	Total	Capital	Revenue	Total
Capital component	- Cupital	1101011010			1101011010		- Capital	1101011010		- upitui	1101011010	
Internal Development	0.000	8.678	8.678	0.000	8.678	8.678	40.424	3.000	43.424	42.887	3.000	45.887
External Development	0.000	1.311	1.311	0.000	1.311	1.311	5.411	0.000	5.411	6.394	0.000	6.394
Water filtration plant	0.000	5.600	5.600	0.000	5.600	5.600	1.953	0.000	1.953	0.000	0.000	0.000
Total Capital Component	0.000	15.589	15.589	0.000	15.589	15.589	47.788	3.000	50.788	49.281	3.000	52.281
Emergency	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
MSDS	0.000	8.647	8.647	0.000	8.647	8.647	0.000	9.654	9.654	0.000	13.438	13.438
Med. Machinery and Equipment	0.000	50.387	50.387	0.000	50.387	50.387	0.000	67.079	67.079	0.000	101.760	101.760
Electricity	0.000	11.840	11.840	0.000	11.840	11.840	0.000	12.790	12.790	0.000	19.990	19.990
IT & QMS & Surveillance	0.000	14.515	14.515	0.000	14.515	14.515	0.000	16.715	16.715	0.000	20.120	20.120
Furniture and Fixtures	0.000	13.504	13.504	0.000	13.504	13.504	0.000	13.504	13.504	0.000	18.788	18.788
Interior and Exterior decorations/ Signage	0.000	3.066	3.066	0.000	3.066	3.066	0.000	4.271	4.271	0.000	4.271	4.271
Day Care Center	0.000	1.600	1.600	0.000	1.600	1.600	0.000	1.600	1.600	0.000	1.600	1.600
Human resource (HR) plan	0.000	17.220	17.220	0.000	17.220	17.220	0.000	35.480	35.480	0.000	52.928	52.928
LC Deficit during procurement (currency fluctuation)								2.571	2.571		2.571	2.571
Total Revenue component	0.000	120.778	120.778	0.000	120.778	120.778	0.000	163.663	163,663	0.000	235.465	235.465
Outsourcing component				0.000			0.000	100.000	100.000	0.000		
Janitorial Services	0.000	12.664	12.664	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Security and Parking services	0.000	4.833	4.833	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Laundry Services	0.000	2.400	2.400	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Maintenance (Generator)	0.000	1.670	1.670	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
MEP	0.000	3.481	3.481	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Medical Gases	0.000	1.304	1.304	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Cafeteria	0.000	6.743	6.743	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Horticulture services	0.000	5.149	5.149	0.000	0.048	0.048	0.000	0.048	0.048	0.000	0.048	0.048
Total outsourcing cost	0.000	38.245	38.245	0.000	0.048	0.048	0.000	0.048	0.048	0.000	0.048	0.048
Total	0.000	174.611	174.611	0.000	136.415	136.415	47.788	166.711	214.500	49.281	238.513	287.794
Contingency (1%) only on Civil Component	0.000	0.156	0.156	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Third Party Monitoring (TPM) (1%)	0.000	1.746	1.746	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Third Party Validation (TPV) (1%)	0.000	1.746	1.746	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Grand Total	0.000	178.259	178.259	0.000	136.415	136.415	47.788	166.711	214.500	49.281	238.513	287.794

MSDS

		Original				t Revi	sed	2n	d Revi	sed	3rd Revised			
Sr. No.	ITEM DESCRIPTION	Quantity Required	Actual Unit Price	Actual Total Cost(Rs)										
1	Histology slide boxes	3	3,100	9,299	3	3,100	9,299	3	4,500	13,500	3	4,500	13,500	
2	Labeling Device connected with Computer	3	60,000	180,000	3	60,000	180,000	3	80,000	240,000	3	80,000	240,000	
3	Safe Transportation Boxes	2	15,750	31,500	2	15,750	31,500	2	18,000	36,000	2	18,000	36,000	
4	Portable Safety Exhaust Hood	1	160,000	160,000	1	160,000	160,000	1	250,000	250,000	1	450,000	450,000	
5	Centrifuge Machine	0	149,336	-	0	149,336	-	0	250,000	-	0	325,000	-	
6	Hot plates	2	26,250	52,500	2	26,250	52,500	2	45,000	90,000	2	55,000	110,000	
7	Water bath	1	157,500	157,500	1	157,500	157,500	1	157,500	157,500	1	300,000	300,000	
8	Complaint boxes	10	3,150	31,500	10	3,150	31,500	10	3,150	31,500	10	3,150	31,500	
9	Spine boards with Neck holders	4	31,080	124,320	4	31,080	124,320	4	31,080	124,320	4	31,080	124,320	
10	Sensitometer	1	137,325	137,325	1	137,325	137,325	1	137,325	137,325	1	137,325	137,325	
11	Densitometer personal	2	191,391	382,782	2	191,391	382,782	2	191,391	382,782	2	191,391	382,782	
12	Box of Films	2	26,250	52,500	2	26,250	52,500	2	30,000	60,000	2	30,000	60,000	
13	Aluminium Step Wedge		26,250	26,250	10	26,250	26,250	1	26,250	26,250	-	26,250	26,250	
14	Non-Mercury thermometer	10	305	3,045	2	305	3,045	10	350	3,500	10	750	7,500	
15	Brass or copper mesh screen Wheel Chairs	0	5,250	10,500	0	5,250	10,500	0	5,250	10,500	0	5,250	10,500	
16 17	Statures	0	31,500 67,830	-	0	31,500	-	0	35,000		0	35,000 75,000	-	
18	Blood Warmer	3	246,750	740,250	3	67,830 246,750	740,250	3	75,000 275,000	825,000	3	275,000	825,000	
19	Sequence Compression Device	2	246,750	420,000	2	246,750	420,000	2	275,000	460,000	2	600,000	1,200,000	
20	Blood Bank Refrigerators with	0	682.500	420,000	0	682,500	420,000	0	700,000	460,000	0		1,200,000	
21	Data Coder	1	84.000	84,000	1	84,000	84,000	1	100,000	100.000	1	1,469,900		
22	Plasma Separator 1	0	4,200,000	64,000	0	4,200,000	-	0	4,500,000	100,000	0	4,500,000		
23	Blood Storage Cabinet	1	682,500	682,500	1	682,500	682,500	1	700,000	700,000	1	1,469,900	1,469,900	
24	Resuscitation Trolley	0	244,733	-	0	244,733	-	0	400,000	700,000	0	491,350	1,403,300	
25	Ultra sound machine gyne	0	1,403,325	-	0	1,403,325	-	0	1,700,000	_	0	2,150,000	_	
26	Delivery Table	0	47,250	-	0	47,250	-	0	47.250	-	0	48,500	-	
27	Height and weight scale	4	8,400	33,600	4	8,400	33,600	4	10,000	40.000	4	31,500	126.000	
28	Suction Electronic	0	259,350	-	0	259,350	-	0	275,000	-	0	275,000	-	
29	Fetal Heart Rate Detector	1	144,375	144,375	1	144,375	144,375	1	175,000	175,000	1	275,000	275,000	
30	Ambo bag	0	17,325	-	0	17,325	-	0	19,000	-	0	19,000	-	
31	Neonatal size face mask	4	578	2,310	4	578	2,310	4	1,200	4,800	4	1,500	6,000	
32	Exchange transfusion trays	2	10,000	20,000	2	10,000	20,000	2	10,000	20,000	2	12,000	24,000	
33	Shoe racks SS	4	39,900	159,600	4	39,900	159,600	4	39,900	159,600	4	39,900	159,600	
34	Sterilizer	0	2,940,000	-	0	2,940,000	-	0	3,500,000	-	0	7,800,000	-	
35	Washer disinfector	0	-	-	0	-	ı	0	-	1	0	-	-	
36	Packing table	0	-	-	0	-	-	0	-	-	0	-	-	
37	Digital Sealer Printer	1	420,000	420,000	1	420,000	420,000	1	480,000	480,000	1	520,000	520,000	
38	Backup Auto Clave	0	441,000	-	0	441,000	-	0	550,000	-	0	789,625	-	
39	Racks for Manual	10	21,000	210,000	10	21,000	210,000	10	37,500	375,000	10	56,160	561,600	
40	Locked Racks for MSDS Data	2	21,000	42,000	2	21,000	42,000	2	37,500	75,000	2	56,160	112,320	
41	Eye Wash Station with shower	3	300,000	900,000	3	300,000	900,000	3	350,000	1,050,000	3	350,000	1,050,000	
42	Air Curtain	4	50,190	200,760	4	50,190	200,760	4	60,000	240,000	4	60,000	240,000	
43	Fire Sand Buckets with stand	5	15,000	75,000	5	15,000	75,000	5	20,000	100,000	5	20,000	100,000	
44	Smoke Detectors	10	7,350	73,500	10	7,350	73,500	10	8,500	85,000	10	8,500	85,000	
45	Heat Detector	5	8,400	42,000	5	8,400	42,000	5	10,000	50,000	5	10,000	50,000	
46	Gas Detector	5	6,300	31,500	5	6,300	31,500	5	7,500	37,500	5	7,500	37,500	
47	Fire Blankets	10	2,783	27,825	10 10	2,783	27,825	10	3,200	32,000	10 10	3,200	32,000	
48 49	Fire Alarms	100	5,250	52,500	100	5,250	52,500	10 100	6,500	65,000	100	6,500	65,000	
50	Identification Bands	0	3	315	0	3	315	0	3	300	0	3	300	
50	Wet Flooring Signages Key Box	6	431 8,190	49,140	6	431 8,190	49,140	6	550 10,000	60,000	6	750 10,000	60,000	
01	Dehumidifier	0	58,800	49,140	0	58,800	49,140	0	70,000	00,000	0	10,000	00,000	

MSDS

		Original			1s	t Revi	sed	2n	d Revi	sed	3rd Revised		
Sr. No.	ITEM DESCRIPTION	Quantity Required	Actual Unit Price	Actual Total Cost(Rs)									
53	Tourniquet	4	840	3,360	4	840	3,360	4	850	3,400	4	1,500	6,000
54	LAB SAFETY BOX	2	3,150	6,300	2	3,150	6,300	2	4,000	8,000	2	4,000	8,000
55	densitometer	0	210,000	-	0	210,000	-	0	210,000	-	0	210,000	-
56	vending machine	0	630,000	-	0	630,000	-	0	630,000	-	0	630,000	-
57	Automatic shoe cover machine	2	296,100	592,200	2	296,100	592,200	2	332,500	665,000	2	332,500	665,000
58	Vein Finder	2	630,000	1,260,000	2	630,000	1,260,000	2	630,000	1,260,000	2	630,000	1,260,000
59	Blood Sample Vials (BOXES)	3	13	38	3	13	38	3	15	45	3	15	45
60	Bassinets	5	21,000	105,000	5	21,000	105,000	5	22,000	110,000	5	22,000	110,000
61	Chemical Spill Cleanup kit	2	100,000	200,000	2	100,000	200,000	2	100,000	200,000	2	100,000	200,000
62	Digital Tempurature Humidity Guage	4	15,000	60,000	4	15,000	60,000	4	15,000	60,000	4	15,000	60,000
63	Bio Cleaning and Disinfection System	1	650,000	650,000	1	650,000	650,000	1	650,000	650,000	1	2,200,000	2,200,000
	Total			8,647,094			8,647,094			9,653,822			13,437,942
				8.647			8,647			9.654			13.438

					Medi	cal Equi	pmen	ıt										
					ginal				Revised	d		2nd	Revise	ed			Revise	d
Sr. Area	Name of Equipment	Yard Stick	Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost
1	Semi Auto Clinical Chemistry Analyzer	1	1	0	449,295	-	1	0	449,295	-	1	0	550,000	0	1	0	550,000	-
2	Hematology Analyzer	1	1	0	427,350	-	1	0	427,350	-	1	0	550,000	1	1	0	750,000	-
3	Electrolyte Analyzer	1	0	1	427,350	427,350	0	1	427,350	427,350	0	1	550,000	550,000	0	1	550,000	550,000
4	Blood Gas Analyzer	0	0	0	2,744,858	-	0	0	2,744,858	-	0	0	3,200,000	-	0	0	1,400,000	-
5	Clinical Microscope	1	3	0	132,825	-	3	0	132,825	-	3	0	180,000	-	3	0	250,000	-
6 Laboratory	Water Bath	1	1	0	60,000	=	1	0	60,000	=	1	0	157,500	-	1	0	325,000	-
7	Hot air Oven	1	0	1	210,000	210,000	0	1	210,000	210,000	0	1	385,000	385,000	0	1	450,000	450,000
8	Distilled water plant	1	0	1	52,500	52,500	0	1	52,500	52,500	0	1	75,000	75,000	0	1	125,000	125,000
9	Auto pipettes	10	4	6	31,500	189,000	4	6	31,500	189,000	4	6	40,500	243,000	4	6	45,000	270,000
10	glass wares	0	100	0	105,000	-	100	0	105,000	-	100	0	105,000	-	100	0	105,000	-
	Centrifuge Machine	2	1	1	149,336	149,336	1	1	149,336	149,336	1	1	250,000	250,000	1	1	400,000	400,000
12	Static X-ray Machine	1	0	1	4,200,000	4,200,000	0	1	4,200,000	4,200,000	0	1	6,000,000	6,000,000	0	1	12,000,000	12,000,000
13	Mobile X-Ray Machine	0	0	0	3,850,524	-	0	0	3,850,524	-	0	0	4,300,000	-	0	0	9,800,000	-
15	Computerized Radiography System	0	0	0	4,018,245		0	0	4,018,245	-	0	0	4,500,000	-	0	0	4,500,000	
16 X-Rays	Dental X-Ray	0	0	0	282,975	-	0	0	282,975		0	0	350,000		0	0	525,000	
17	Lead apron and PPE	2	1	1	52,500	52,500	1	1	52,500	52,500	1	1	60,000	60,000	1	1	85,000	85,000
18	Density meter personal (Add)	0	0	0	210,000	-	0	0	210,000	-	0	0	210,000	=	0	0	250,000	
19	Lead glass /shield	0	·	-	105,000		·	-	105,000	-		0	105,000	-		0	150,000 525,000	-
20	Lead Walls	0	0	0	525,000		0	0	525,000		0	0	525,000	,	0	-		
21 Ultrasound	Portable/Mobile Ultrasound	0	0	0	1,371,331 3,698,310	3,698,310	0	0	1,371,331 3,698,310	3,698,310	0	1	1,500,000 4.500.000	4,500,000	0	0	2,400,000 5,500,000	5,500,000
22	Color Doppler RADIOLOGY ICU MONITOR	2	1	1	301,665	301,665	1	1	301,665	301,665	0	1	900,000	900,000	1	1	1,250,000	1,250,000
23	Temporary pace maker	0	0	0	315,000	301,003	0	0	315,000	301,003	0	0	315,000	500,000	0	0	550,000	1,230,000
24	Defibrillator	1	1	0	299,153	-	1	0	299,153		1	0	650,000		1	0	800,000	
25 CCU	FCG Machine Three Channel	2	3	0	169,785		3	0	169,785		3	0	169,785	-	3	0	300,000	
26	ETT Machine	0	0	0	2,021,838		0	0	2,021,838		0	0	2,200,000		0	0	3,000,000	
27	Color doplor CARDIOLOGY	0	0	0	4,681,790	-	0	0	4,681,790	_	0	0	4,800,000	-	0	0	6,000,000	
28	Suction Pump	2	6	0	259,350		6	0	259,350		6	0	275,000	-	6	0	300,000	
29	Blood Cabinet	1	0	1	690,539	690,539	0	1	690,539	690,539	0	1	700,000	700,000	0	1	1,500,000	1,500,000
30	Centrifuge Machine	2	0	2	149.336	298.673	0	2	149,336	298,673	0	2	250,000	500,000	0	2	400,000	800,000
31 Blood Bank	Slide viewer	1	0	1	42,000	42,000	0	1	42,000	42,000	0	1	55,000	55,000	0	1	55,000	55,000
32	Clinical Microscope	1	0	1	132,825	132,825	0	1	132,825	132,825	0	1	180,000	180,000	0	1	250,000	250,000
33 Dialysis Unit	Computerized Hemo Dialysis Machine	5	0	5	1,050,000	5,250,000	0	5	1,050,000	5,250,000	0	5	1,600,000	8,000,000	0	5	3,200,000	16,000,000
(10 beds)			-				-	-			-	-			-	-		
35	Baby Cot	10	0	10	14,669	146,685	0	10	14,669	146,685	0	10	16,000	160,000	0	10	16,000	160,000
36	Phototherapy Unit Infant Warmer	2	0	2	130,200 335,638	260,400 671,276	0	2	130,200 335,638	260,400 671,276	0	2	655,000 985,000	1,310,000 1,970,000	0	2	850,000 1,050,000	1,700,000 2,100,000
37 Nursery			0	6	104,500	627,000	0	6	104,500	627,000		6	160,000	960,000	0	6	225,000	1,350,000
38 Nursery	Pulse Oximeter	6	0	-	858.932	1,717,864	0	2	858,932	1,717,864	0	2	900,000	1,800,000	0	-	1,750,000	3,500,000
39	Infant Incubator	1	U	2	259,350	259.350	U	4	259,350	259.350	U	1	275,000	275.000	U	2	300,000	300,000
40	Suction Pump Hospital Grade Nebulizer Heavy Duty	2	0	2	125,265	259,530	0	2	125,265	250,530	0	2	215,000	430,000	0	2	300,000	600,000
41	Anesthesia Machine with Ventilator	1	1	0	2,509,554	250,550	1	0	2,509,554	230,330	1	0	3,000,000	430,000	1	0	7,000,000	- 000,000
42	BED SIDE PATIENT MONITOR	2	0	2	441,000	882,000	0	2	441,000	882,000	0	2	550,000	1,100,000	0	2	1,200,000	2,400,000
43	Defibrillator	2	0	2	308,713	617,425	0	2	308,713	617,425	0	2	650,000	1,300,000	0	2	800,000	1,600,000
44	Electrosurgical Unit	1	1	0	507,530	017,420	1	0	507,530	017,420	1	0	700,000	1,500,000	1	0	900,000	1,000,000
45	Operation Table	1	1	0	1,426,215		1	0	1,426,215		1	0	2,000,000	-	1	0	2,500,000	
⁴⁶ O.T (04)	Ceiling Operating Light	1	1	0	413.013		1	0	413.013		1	0	800,000	-	1	0	950.000	
47	STEAM STERILIZER	1	1	0	3.465.000	-	1	0	3.465.000		1	0	4,000,000	-	1	0	7,800,000	-
48	Suction Pump	2		2	259,350	518,700	·	2	259,350	518,700	·	2	275,000	550,000	· ·	2	300,000	600,000
49	Resuscitation trolley With Crash Cart	2	1	1	244,733	244,733	1	1	244,733	244,733	1	1	400,000	400,000	1	1	600,000	600,000
50	mayo table	4	0	4	21,000	84,000	0	4	21,000	84,000	0	4	23,000	92,000	0	4	23,000	92,000
51	MOBILE OPERATING LIGHT	1	1	0	304,220		1	0	304,220	-	1	0	400,000	- ,,,,,,,,	1	0	900,000	-
52	Operation Table	0	0	0	1,426,215	-	0	0	1,426,215	-	0	0	2,000,000	-	0	0	5,000,000	-
53	ORTHOPEDIC DRILL	0	0	0	1,108,740	-	0	0	1,108,740	-	0	0	1,500,000	-	0	0	4,000,000	-
54 Orthopedic	Plaster Cutting Pneumatic	1	0	1	276,250	276,250	0	1	276,250	276,250	0	1	450,000	450,000	0	1	1,500,000	1,500,000
55	Pneumatic Tourniquets	0	0	0	262,500	-	0	0	262,500	-	0	0	262,500	-	0	0	300,000	
56	Orthopedic Instruments	0	0	0	432,623	-	0	0	432,623	-	0	0	550,000	-	0	0	550,000	-
	1 1																	

					Medi	cal Equi	pinen	t										
				- ,	ginal				Revised	d			Revise	ed			Revise	d
Sr. Area	Name of Equipment	Yard Stick	Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost
57	Portable/Mobile Ultrasound	1	1	0	1,418,958	÷	1	0	1,418,958	-	1	0	1,500,000	-	1	0	2,400,000	-
58	Autoclave	1	1	0	441,000	-	1	0	441,000	-	1	0	550,000	-	1	0	850,000	-
59	Delivery Set	10	4	6	31,500	189,000	4	6	31,500	189,000	4	6	40,000	240,000	4	6	65,000	390,00
60	Delivery Table	2	2	0	47,250	-	2	0	47,250	-	2	0	47,250	-	2	0	55,000	-
61	BED SIDE PATIENT MONITOR	2	0	2	294,000	588,000	0	2	294,000	588,000	0	2	550,000	1,100,000	0	2	1,200,000	2,400,00
62 Gynea (20	D & C Set	2	2	0	34,650	-	2	0	34,650	-	2	0	40,000	-	2	0	60,000	-
heds)	Vaccume Extractor	1	0	1	259,350	259,350	0	1	259,350	259,350	0	1	300,000	300,000	0	1	350,000	350,00
64	CTG Machine	1	1	0	628,049	-	1	0	628,049	-	1	0	725,000	-	1	0	900,000	-
65	ECG Machine Three Channel	1	0	1	169,785	169,785	0	1	169,785	169,785	0	1	180,000	180,000	0	1	300,000	300,00
66	Portable O.T Light	2	2	0	304,220	-	2	0	304,220	-	2	0	400,000	-	2	0	900,000	
67	Baby Cot	2	1	1	14,669	14,669	1	1	14,669	14,669	1	1	16,000	16,000	1	1	16,000	16,00
68	Delivery trolly	2	1	1	47,250	47,250	1	1	47,250	47,250	1	1	47,250	47,250	1	1	47,250	47,25
69	Desktop Fetal Heart Rate Detector	1	0	1	144,375	144,375	0	1	144,375	144,375	0	1	175,000	175,000	0	1	200,000	200,00
70	Steam Sterilizer	0	0	0	3,355,849	-	0	0	3,355,849	-	0	0	4,000,000	-	0	0	7,800,000	-
71	Operation Table	0	0	0	1,426,215	-	0	0	1,426,215	-	0	0	2,000,000	-	0	0	2,500,000	-
72 Surgical Emergency (1	MOBILE OPERATING LIGHT	0	0	0	285,466	-	0	0	285,466	-	0	0	400,000	-	0	0	900,000	-
/3 beds)	Suction Pump	0	1	0	259,350	-	1	0	259,350	-	1	0	275,000	-	1	0	300,000	-
74	Laryngoscope	0	1	0	9,744	-	1	0	9,744	-	1	0	12,000	-	1	0	20,000	-
75	Set of Surgical Instruments	0	0	0	141,750	-	0	0	141,750	-	0	0	160,000	-	0	0	220,000	-
76	Stretcher	10	4	6	68,250	409,500	4	6	68,250	409,500	4	6	69,300	415,800	4	6	69,300	415,80
77	wheel chair	10	4	6	31,500	189,000	4	6	31,500	189,000	4	6	35,000	210,000	4	6	35,000	210,00
78	foot support	6	0	6	4,200	25,200	0	6	4,200	25,200	0	6	4,500	27,000	0	6	5,148	30,88
79	Resuscitation trolly With Crash Cart	5	0	5	237,618	1,188,091	0	5	237,618	1,188,091	0	5	400,000	2,000,000	0	5	600,000	3,000,00
80	BP Appratus	15	1	14	15,750	220,500	1	14	15,750	220,500	1	14	16,000	224,000	1	14	16,000	224,00
81 Others	Ventilator	0	0	0	2,195,080	-	0	0	2,195,080	-	0	0	3,500,000	-	0	0	5,500,000	-
82	CPAP	1	0	1	1,098,510	1,098,510	0	1	1,098,510	1,098,510	0	1	2,100,000	2,100,000	0	1	2,800,000	2,800,00
83	X-RAY PROCESSOR	1	0	1	858,440	858,440	0	1	858,440	858,440	0	1	925,000	925,000	0	1	1,200,000	1,200,00
84	Hand wash Scrub Double Bay	2	0	2	94,500	189,000	0	2	94,500	189,000	0	2	100,000	200,000	0	2	140,000	280,00
85	Image Inensifier	0	0	0	4,667,460	-	0	0	4,667,460	-	0	0	4,667,460	-	0	0	12,000,000	-
86	Central Medical Gass Pipe Line System	7	0	7	850,000	5,950,000	0	7	850,000	5,950,000	0	7	-	-	0	7	-	-
87	Motorized Patient bed with bed	4	0	4	210,000	840,000	0	4	210,000	840,000	0	4	400,000	1,600,000	0	4	600,000	2,400,00
88	side,Mattress,IV stand, Attendant Bench	4			15,750	63.000		4	15,750	63.000		4	30,000	120,000		4	35,000	140.00
89	Sphygmomanometer wall mtd		0	4	244,733	489.466	0		244,733	489,466	0		400,000	800,000	0		600,000	1,200,00
90	Resuscitation trolly With Crash Cart	2	0	2		299.153	0	2		299.153	0	2	650.000	650,000	0	2	800,000	800,00
91	Defibrilator Defibrillator with Monitor	0	0	0	299,153 330,750		0	0	299,153 330,750		0	0	650,000	***************************************	0	0	800,000	800,00
92					169,785	-			169,785	-			180,000	-			300,000	-
93	ECG Machine Three Channel	0	0	0			0	0			0	0	,		0	0		
	Syringe pump	1	0	1	108,780	108,780	0	1	108,780	108,780	0	1	125,000	125,000	0	1	200,000	200,00
94 ICU 95	Suction Pump	0	0	0	259,350	-	0	0	259,350	· ·	0	0	275,000	-	0	0	300,000	-
96	ICU Monitor	0	0	0	298,200 55,000		0	0	298,200 55,000		0	0	900,000 55.000	55,000	0	0	1,250,000	55.00
97	Instrument Trolley	1	0	1	55,000	55,000	0	1	55,000	55,000	0	1	55,000	55,000	0	1	55,000	55,00
98	Ward instruments	0	0	0		-	0	0	-	-	0	0	-		0	0	-	
99	Ventilator intensive care	2	0	2	1,600,000	3,200,000	0	2	1,600,000	3,200,000	0	2	3,500,000	7,000,000	0	2	5,500,000	11,000,00
100	CPAP with humidifier DELIVERY TROLLY STAINLESS STEEL	0	0	0	1,098,510 23,835	23,835	0	0	1,098,510 23,835	23,835	0	0	2,100,000 47,250	47,250	0	0	2,800,000 47,250	47,25
101	Ambu-Bag, adult	4	0	4	17,325	69,300	0	4	17,325	69,300	0	4	19,000	76,000	0	4	19,000	76,00
102	Ambu-Baq, paeds	4	0	4	17,325	69,300	0	4	17,325	69,300	0	4	19,000	76,000	0	4	19,000	76,00
103 MORTUERY	TWO BODY REFRIGERATOR WITH CASTERS 220v 50Hz	1	0	1	2,470,546	2,470,546	0	1	2,470,546	2,470,546	0	1	3,000,000	3,000,000	0	1	3,500,000	3,500,00
104	Along with Atopsy Table & Lifter Trolley Dental Unit	2	0	2	2,190,000	4,380,000	0	2	2,190,000	4,380,000	0	2	2,820,000	5,640,000	0	2	2,820,000	5,640,00
105		1		1	441.000	441,000	0	4	441,000	441,000		1	550,000	550,000	0	1	850,000	850,00
106	Autoclave Dental X-RAY Machine	1	0		282,975	282,975	0	1	282,975	282,975	0		350,000	350,000			525,000	525,00
107		0	0	1	94,500	202,975	0	1	94,500	202,975	0	1	150,000	350,000	0	1	600,000	525,00
108	Digital Intra Oral Camera			0		-		0		-	0	0		-		0		-
109 Dental Unit	DENTAL CAUTERY	0	0	0	84,000	- 400 750	0	0	84,000	- 100 750	0	0	160,000	475.000	0	0	900,000	
103	Ultrasonic scaling	1	0	1	120,750	120,750	0	1	120,750	120,750	0	1	175,000	175,000	0	1	300,000	300,000
110	Curing lights	1	0	1	52,500	52,500	0	1	52,500	52,500	0	1	95,000	95,000	0	1	150,000	150,000

						Medi	cal Equi	pmen	t										
					Ori	ginal			1st	Revise	d		2nd	Revise	ed		3rd	Revised	b
Sr. No.	Area	Name of Equipment		Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost	Available Quantity	Required Quantity	Cost per Unit	Total Cost
112		Dental cabinet	0	0	0	42,000	-	0	0	42,000	-	0	0	70,000	-	0	0	160,000	-
113		Dental examination/surgical instrument sets	4	0	4	157,500	630,000	0	4	157,500	630,000	0	4	175,000	700,000	0	4	175,000	700,000
114	Beds	Fowler beds with Mattress	40	0	40	70,000	2,800,000	0	40	70,000	2,800,000	0	40	110,000	4,400,000	0	40	150,000	6,000,000
		Total					50,386,786				50,386,786				67,079,300				101,760,188
							50.387				50.387				67.079				101.760

				Elec	tricity								
			Origina		,	1st Revise	ed	2	2nd Revis	ed	;	3rd Revis	ed
Sr. No.	Item Name	Quantity	Per Unit Cost	Total Cost	Quantity	Per Unit Cost	Total Cost	Quantity	Per Unit Cost	Total Cost	Quantity	Per Unit Cost	Total Cost
1	Transformers (200 KVA)	1	600,000	600,000	1	600,000	600,000	1	1,200,000	1,200,000	3	1,600,000	4,400,000
2	Transformers (100 KVA)	1	450,000	450,000	1	450,000	450,000	1	800,000	800,000	1	800,000	800,000
3	Transformers (50 KVA)	0	300,000	-	0	300,000	-	0	300,000	-	0	300,000	-
4	Generator (200 KVA)	0	4,000,000	-	0	4,000,000	-	0	4,000,000	-	0	4,000,000	-
5	Generator (100 KVA)	1	2,300,000	2,300,000	1	2,300,000	2,300,000	1	2,300,000	2,300,000	1	2,300,000	2,300,000
6	2 Ton air conditioners (split)	27	55,500	1,498,500	27	55,500	1,498,500	27	55,500	1,498,500	27	55,500	1,498,500
7	2 Ton air conditioners (Cabinet)	19	78,000	1,482,000	19	78,000	1,482,000	19	78,000	1,482,000	19	78,000	1,482,000
8	4 Ton air conditioners (Cabinet)	1	120,000	120,000	1	120,000	120,000	1	120,000	120,000	1	120,000	120,000
9	Ceiling Fans 56"	40	3,090	123,600	40	3,090	123,600	40	3,090	123,600	40	3,090	123,600
10	Exhaust Fans	36	3,000	108,000	36	3,000	108,000	36	3,000	108,000	36	3,000	108,000
11	Bracket Fans 18"	48	3,280	157,440	48	3,280	157,440	48	3,280	157,440	48	3,280	157,440
	Dual Connection of Electricity / Express Line	1	5,000,000	5,000,000	1	5,000,000	5,000,000	1	5,000,000	5,000,000	1	9,000,000	9,000,000
	Total			11,839,540			11,839,540			12,789,540			19,989,540
				11.840			11.840			12.790			19.990

					IT &	QMS 8	& Surve	eillar	ice				
			Origin	nal	1:	st Rev	ised	2 r	nd Rev	rised	31	rd Rev	ised
Sr. No.	Item Name	Quantit y	Per Unit Cost	Total Cost									
1	Desktop, UPS, LED	30	75,000	2,250,000	30	75,000	2,250,000	30	130,000	3,900,000	30	216,000	6,480,000
2	MS Windows License	30	20,000	600,000	30	20,000	600,000	30	20,000	600,000	30	20,000	600,000
3	Scanner Flatbed with ADF	3	90,000	270,000	3	90,000	270,000	3	150,000	450,000	3	150,000	450,000
4	Heavy duty Printer	7	40,000	280,000	7	40,000	280,000	7	50,000	350,000	7	110,000	770,000
5	Multimedia Projector with Screen	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000
6	Tabs	4	50,000	200,000	4	50,000	200,000	4	50,000	200,000	4	50,000	200,000
7	Laptop	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000
8	MS Windows License	1	20,000	20,000	1	20,000	20,000	1	20,000	20,000	1	20,000	20,000
9	QMS System	1	3,700,000	3,700,000	1	3,700,000	3,700,000	1	4,000,000	4,000,000	1	4,000,000	4,000,000
10	Networking	1	995,000	995,000	1	995,000	995,000	1	995,000	995,000	1	1,200,000	1,200,000
11	Monitoring & Surveillance (CCTV)	1	5,000,000	5,000,000	1	5,000,000	5,000,000	1	5,000,000	5,000,000	1	5,000,000	5,000,000
12	Public Address System	1	1,000,000	1,000,000	1	1,000,000	1,000,000	1	1,000,000	1,000,000	1	1,200,000	1,200,000
	Total			14,515,000			14,515,000			16,715,000			20,120,000
				14.515			14.515			16.715			20.120

Furniture and Fixtures

			Origin	al	19	st Rev	ised	2n	d Rev	ised	3r	d Rev	ised
Sr. No.	Item Name	Quantity	Unit Price	Total									
1	Benches (internal)	60	30,000	1,800,000	60	30,000	1,800,000	60	30,000	1,800,000	60	40000	2,400,000
	Benches (external)	10	10,000	100,000	10	10,000	100,000	10	10,000	100,000	10	40000	400,000
3	Electric Water Cooler	8	45,000	360,000	8	45,000	360,000	8	45,000	360,000	8	60000	480,000
4	Doctors rooms Furniture	30	70,000	2,100,000	30	70,000	2,100,000	30	70,000	2,100,000	30	125000	3,750,000
	Examination couches	10	35,000	350,000	10	35,000	350,000	10	35,000	350,000	10	35000	350,000
6	Fire Blanket	5	2,500	12,500	5	2,500	12,500	5	2,500	12,500	5	3000	15,000
7	Fire Extinguisher (Water Based)	30	8,000	240,000	30	8,000	240,000	30	8,000	240,000	30	2500	75,000
8	Acrylic Board	150	2,200	330,000	150	2,200	330,000	150	2,200	330,000	150	2000	300,000
9	Rostrum	2	18,000	36,000	2	18,000	36,000	2	18,000	36,000	2	20000	40,000
10	Blinds for windows	6000	150	900,000	6000	150	900,000	6000	150	900,000	6000	200	1,200,000
11	Paintings	100	6,000	600,000	100	6,000	600,000	100	6,000	600,000	100	5000	500,000
12	Waste Bin Sets (3 bin)	40	6,000	240,000	40	6,000	240,000	40	6,000	240,000	40	9000	360,000
13	Printing		,	1,000,000		,	1,000,000		,	1,000,000			1,000,000
	Machinery and Equipment's												
14	Refrigerator(Domestic) front glass double door	2	160,000	320,000	2	160,000	320,000	2	160,000	320,000	2	150000	300,000
	Refrigerator glass single door	5	80.000	400,000	5	80,000	400,000	5	80,000	400,000	5	90000	450,000
	Refrigerator 16 cft	5	36,000	180,000	5	36,000	180,000	5	36,000	180,000	5	50000	250,000
	Air Curtain On Door	5	50,000	250,000	5	50,000	250,000	5	50,000	250,000	5	75000	375,000
18	Washing machines for pantries	3	13,000	39,000	3	13,000	39,000	3	13,000	39,000	3	11000	33,000
19	Gas Burner for pantries	10	4,800	48,000	10	4,800	48,000	10	4,800	48,000	10	80000	800,000
20	Fire Extinguishers DCP	30	4,800	144,000	30	4,800	144,000	30	4,800	144,000	30	6500	195,000
21	LED TV	15	55,000	825,000	15	55,000	825,000	15	55,000	825,000	15	140000	2,100,000
22	Industrial Exhaust	5	50,000	250,000	5	50,000	250,000	5	50,000	250,000	5	60000	300,000
23	Acrylic Display Board	4	20,000	80,000	4	20,000	80,000	4	20,000	80,000	4	20000	80,000
	Laundry & Washing			-						•			-
24	Bed Sheets and pillow covers	300	1,250	375,000	300	1,250	375,000	300	1,250	375,000	300	2500	750,000
25	Pillows	150	400	60,000	150	400	60,000	150	400	60,000	150	500	75,000
26	Blankets with covers	100	5,000	500,000	100	5,000	500,000	100	5,000	500,000	100	4000	400,000
	Medicine Store												
27	Medicine (Iron Racks) 8x6x2 (Required)	20	50,000	1,000,000	20	50,000	1,000,000	20	50,000	1,000,000	20	60000	1,200,000
	Moveable Iron Stairs (Required)	2	15,000	30,000	2	15,000	30,000	2	15,000	30,000	2	20000	40,000
	Lifters (Required)	2	37,000	74,000	2	37,000	74,000	2	37,000	74,000	2	35000	70,000
30	Pallets 3x4 (Plastic) (Required)	20	12.000	240,000	20	12.000	240,000	20	12.000	240,000	20	10000	200,000
	Dehumidifier (Required)	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000	1	125000	125,000
	Insect Killer (Required)	25	8.000	200,000	25	8.000	200,000	25	8.000	200,000	25	6500	162,500
33	Thermometer (Required)	20	16.000	320,000	20	16.000	320,000	20	16,000	320,000	20	600	12,000
- 33	Total	20	10,000	13,503,500	20	10,000	13,503,500	20	16,000	13,503,500	20	000	18,787,500
	I Olai										-		
		1		13.504			13.504			13.504	· I		18.788

Signage and plaques

			O	rigin	al		Revi	sed	2nd	Rev	ised	3rd	Rev	ised
												ļ		
Sr No		Kinds of Sign Boards	Quantity	Rates	Cost									
		External Sign Boards	_											
1		External Platform/Road Signage (Circular)	6	10,017	60,102	6	10,017	60,102	6	13,951	83,706	6	13,951	83,706
2	A2	External Platform/Road Signage (Triangular)	6	9,163	54,978	6	9,163	54,978	6	12,762	76,574	6	12,762	76,574
3	B1	Main Directional Board	1	111,359	111,359	1	111,359	111,359	1	155,107	155,107	1	155,107	155,107
4	C1	Directional Board (Single Sheet)	10	14,308	143,080	10	14,308	143,080	10	19,929	199,290	10	19,929	199,290
5	C2	Directional Board (Two Sheets)	1	22,268	22,268	1	22,268	22,268	1	31,016	31,016	1	31,016	31,016
6	C3	Directional Board (Three Sheets)	1	29,854	29,854	1	29,854	29,854	1	41,581	41,581	1	41,581	41,581
7	C4	Directional Board (Four Sheets)	1	36,867	36,867	1	36,867	36,867	1	51,351	51,351	1	51,351	51,351
8	C5	Directional Board (Five Sheets)	1	44,771	44,771	1	44,771	44,771	1	62,360	62,360	1	62,360	62,360
9	C6	Directional Board (Six Sheets)	1	52,274	52,274	1	52,274	52,274	1	72,810	72,810	1	72,810	72,810
10	C7	Additional Panel (For Fixation on existing Foundation & Posts)	3	7,864	23,592	3	7,864	23,592	3	10,952	32,857	3	10,952	32,857
11	D1	Departmental Signage on Building	6	46,729	280,374	6	46,729	280,374	6	65,087	390,524	6	65,087	390,524
12	E1	External Map Boards	2	40,771	81,542	2	40,771	81,542	2	56,788	113,576	2	56,788	113,576
		Internal Signage	0		-	0		-	0	-	-	0	-	-
1	F1	Internal Hanging Signage (Main Entrance)	5	89,955	449,775	5	89,955	449,775	5	125,294	626,472	5	125,294	626,472
2	F2	Internal Hanging Signage (Main Entrance 2)	5	68,489	342,445	5	68,489	342,445	5	95,396	476,980	5	95,396	476,980
3	F3	Internal Hanging Signage (Corridor)	4	50,724	202,896	4	50,724	202,896	4	70,651	282,604	4	70,651	282,604
4	F4	Internal Hanging Signage (Corridor 2)	4	51,312	205,248	4	51,312	205,248	4	71,470	285,880	4	71,470	285,880
5	G1	Internal Department Signage on wall	7	12,974	90,818	7	12,974	90,818	7	18,071	126,498	7	18,071	126,498
6	H1	Specialist Name Plaques fixed on wall	20	3,729	74,580	20	3,729	74,580	20	5,194	103,880	20	5,194	103,880
7	J1	Room Name Plaques and Numbers fixed on wall	100	858	85,800	100	858	85,800	100	1,194	119,420	100	1,194	119,420
8	K1	Internal Wall Signage	100	1,408	140,800	100	1,408	140,800	100	1,961	196,140	100	1,961	196,140
9	L1	Room Numbers Fixed on Wall	50	3,574	178,700	50	3,574	178,700	50	4,978	248,920	50	4,978	248,920
10	M1	Advance Fire Exit Sign	10	1,819	18,190	10	1,819	18,190	10	2,534	25,340	10	2,534	25,340
11	M2	Fire Exit Sign Mounted Above the Door	10	1,258	12,580	10	1,258	12,580	10	1,753	17,528	10	1,753	17,528
12	N1	Fire Safety/Equipment Signage	20	2,410	48,200	20	2,410	48,200	20	3,357	67,144	20	3,357	67,144
13	P1	Floor Map Board	5	20,875	104,375	5	20,875	104,375	5	29,075	145,376	5	29,075	145,376
14	Q1	Caution Signage	25	2,151	53,775	25	2,151	53,775	25	2,996	74,900	25	2,996	74,900
15	Q2	Caution Signage	5	647	3,235	5	647	3,235	5	902	4,508	5	902	4,508
16	Q3	Caution Signage	10	1,132	11,320	10	1,132	11,320	10	1,576	15,764	10	1,576	15,764
17	Q4	Caution Signage	15	879	13,185	15	879	13,185	15	1,225	18,375	15	1,225	18,375
		Total	434		2,976,983	434		2,976,983	434	•	4,146,482	434		4,146,482
		Designing and Site Supervision			89,309			89,309			124,394			124,394
		Grand Total			3,066,292			3,066,292			4,270,877			4,270,877
					3.066			3.066			4.271			4.271

		(Original		1st	Revised	I	2nd	d Revised	i	3rc	l Revised	i
Sr. No.	ITEMS	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total
1	Cylinder Block	1	3,000	3,000	1	3,000	3,000	1	3,000	3,000	1	3,000	3,000
2	Geometrical Cabinet (36 pcs)	1	4,000	4,000	1	4,000	4,000	1	4,000	4,000	1	4,000	4,000
3	Geometrical Solids (10 pcs)	1	2,200	2,200	1	2,200	2,200	1	2,200	2,200	1	2,200	2,200
4	Base for Geometrical Solids (14 pcs)	1	2,000	2,000	1	2,000	2,000	1	2,000	2,000	1	2,000	2,000
5	Constructive Triangles (4 box)	1	400	400	1	400	400	1	400	400	1	400	400
6	Metal Insets (10 - shape)	1	1,000	1,000	1	1,000	1,000	1	1,000	1,000	1	1,000	1,000
7	Stand for metal insets	1	2,000	2,000	1	2,000	2,000	1	2,000	2,000	1	2,000	2,000
8	Paper Board for metal insets (10 Boards)	1	5,000	5,000	1	5,000	5,000	1	5,000	5,000	1	5,000	5,000
9	Sandpaper Alphabets (English)	3	2,000	6,000	3	2,000	6,000	3	2,000	6,000	3	2,000	6,000
10	Sandpaper Alphabets (Urdu)	3	3,500	10,500	3	3,500	10,500	3	3,500	10,500	3	3,500	10,500
11		3	2,000	6,000	3	2,000	6,000	3	2,000	6,000	3	2,000	6,000
12	Hammer Case	2	1,000	2,000	2	1,000	2,000	2	1,000	2,000	2	1,000	2,000
13	Soft Reading Book	15	200	3,000	15	200	3,000	15	200	3,000	15	200	3,000
14	Shape Sorting Case	2	500	1,000	2	500	1,000	2	500	1,000	2	500	1,000
15	Transport Set (Model)	2	700	1,400	2	700	1,400	2	700	1,400	2	700	1,400
16	Model Puzzles (S)	7	300	2,100	7	300	2,100	7	300	2,100	7	300	2,100
17	Model Puzzles (B)	7	500	3,500	7	500	3,500	7	500	3,500	7	500	3,500
18	Storybook	20	100	2,000	20	100	2,000	20	100	2,000	20	100	2,000
19	Information Book (Large)	20	350	7,000	20	350	7,000	20	350	7,000	20	350	7,000
20	Basket (L)	10	1,000	10,000	10	1,000	10,000	10	1,000	10,000	10	1,000	10,000
	Basket (S)	10	600	6,000	10	600	6,000	10	600	6,000	10	600	6,000
22	Color table Box	2	1,000	2,000	2	1,000	2,000	2	1,000	2,000	2	1,000	2,000
23	ABC Block	4	500	2,000	4	500	2,000	4	500	2,000	4	500	2,000
	Number Block	4	500	2,000	4	500	2,000	4	500	2,000	4	500	2,000
25	Color Pensils (Large)	5	450	2,250	5	450	2,250	5	450	2,250	5	450	2,250
26	Color Crayons (Large)	5	300	1,500	5	300	1,500	5	300	1,500	5	300	1,500
27	Marker Color (Board and Permanent)	15	395	5,925	15	395	5,925	15	395	5,925	15	395	5,925
28	Fruits Basket (Model Set)	2	1,000	2,000	2	1,000	2,000	2	1,000	2,000	2	1,000	2,000
29	Vegetables Basket (Model Set)	2	1,000	2,000	2	1,000	2,000	2	1,000	2,000	2	1,000	2,000
30	Animal Sets	2	600	1,200	2	600	1,200	2	600	1,200	2	600	1,200
31	Insects sets	2	400	800	2	400	800	2	400	800	2	400	800
32	Shape Sorting House	2	1,500	3,000	2	1,500	3,000	2	1,500	3,000	2	1,500	3,000
33	Flash card (Small)	10	120	1,200	10	120	1,200	10	120	1,200	10	120	1,200
34	Flash card (Big)	10	325	3,250	10	325	3,250	10	325	3,250	10	325	3,250
35	Sand Play	2	1,000	4,000	2	1,000	4,000	2	1,000	4,000	2	1,000	4,000
36	Gym Play	2	2,000	3,000	2	2,000	3,000	2	2,000	3,000	2	2,000	3,000
37	Straight Mats	20	1,500	40,000	20	1,500	40,000	20	1,500	40,000	20	1,500	40,000
38	Folding Mats	20	2,000	6,000	20	2,000	6,000	20	2,000	6,000	20	2,000	6,000
39	Diaper Changing Mats	3	300	1,500	3	300	1,500	3	300	1,500	3	300	1,500
40	Cube Cushion	2	500	1,000	2	500	1,000	2	500	1,000	2	500	1,000
41	Square Cushion	2	500	600	2	500	600	2	500	600	2	500	600
42	Baby Mirror	3	300	2,400	3	300	2,400	3	300	2,400	3	300	2,400
43	Pink Tower With Stand	1	800	500	1	800	500	1	800	500	1	800	500
44	Dressing Frames	10	500	8,000	10	500	8,000	10	500	8,000	10	500	8,000
	Monkey Stuffed	2	800	2,400	2	800	2,400	2	800	2,400	2	800	2,400
46	Lion Stuffed	2	1,200	3,400	2	1,200	3,400	2	1,200	3,400	2	1,200	3,400

		(Original		1st	Revised		2nc	l Revised	i	3rd	Revised	
Sr. No.	ITEMS	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total
47	Cater Pillar Stuffed	2	1,700	3,000	2	1,700	3,000	2	1,700	3,000	2	1,700	3,000
	Stuffed toys (Animal shaped i.e. Moneky, lion, caterpillar etc)	6	1,500	9,000	6	1,500	9,000	6	1,500	9,000	6	1,500	9,000
49	Long Roads with Stands	1	1,500	1,500	1	1,500	1,500	1	1,500	1,500	1	1,500	1,500
50	Number Rods	1	500	500	1	500	500	1	500	500	1	500	500
51	Stand Number Rods	1	800	800	1	800	800	1	800	800	1	800	800

		(Original		1s	t Revised		2nd	d Revised	t	3rd	d Revised	ı
Sr. No.	ITEMS	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total
	Soft toys	2	700	1,400	2	700	1,400	2	700	1,400	2	700	1,400
53	Infants Manual Weight Machine	1	1,000	1,000	1	1,000	1,000	1	1,000	1,000	1	1,000	1,000
54	Toddlers Manual Weight Machine	1	1,000	1,000	1	1,000	1,000	1	1,000	1,000	1	1,000	1,000
55	Tri Cycles	4	3,500	14,000	4	3,500	14,000	4	3,500	14,000	4	3,500	14,000
56	Wooden Cots	10	10,000	100,000	10	10,000	100,000	10	10,000	100,000	10	10,000	100,000
57	Mattresses for Cots	10	1,200	12,000	10	1,200	12,000	10	1,200	12,000	10	1,200	12,000
58	Pillows	10	300	3,000	10	300	3,000	10	300	3,000	10	300	3,000
59	Bed Sheets and pillow covers	20	400	8,000	20	400	8,000	20	400	8,000	20	400	8,000
60	Nets	10	600	6,000	10	600	6,000	10	600	6,000	10	600	6,000
61	High Chairs for feeding	15	3.000	45.000	15	3.000	45,000	15	3.000	45,000	15	3.000	45,000
62	Rockers Cum Bouncer	8	2,500	20,000	8	2,500	20,000	8	2,500	20,000	8	2,500	20,000
	Cot Mobile	10	1,500	15,000	10	1,500	15,000	10	1,500	15,000	10	1,500	15,000
64	Plastic Chairs (Round edges Animal Shapes)	7	600	4,200	7	600	4,200	7	600	4,200	7	600	4,200
65	Multi-Purpose Table	2	3,000	6,000	2	3,000	6,000	2	3,000	6,000	2	3,000	6,000
	Writing Board	1	500	500	1	500	500	1	500	500	1	500	500
67	Electric Sterilizer	2	5,000	10,000	2	5,000	10,000	2	5,000	10,000	2	5,000	10,000
68	Electric Warmer	2	5,000	10,000	2	5,000	10,000	2	5,000	10,000	2	5,000	10,000
69	Table sets	2	4,000	8,000	2	4,000	8,000	2	4,000	8,000	2	4,000	8,000
70	Rocker	6	3,200	19,200	6	3,200	19,200	6	3,200	19,200	6	3,200	19,200
71	Activity Gym (Infants)	5	2,000	10,000	5	2,000	10,000	5	2,000	10,000	5	2,000	10,000
72	Play Gym	5	2,700	13,500	5	2,700	13,500	5	2,700	13,500	5	2,700	13,500
73	Activity Gym (Toddlers)	5	2,000	10,000	5	2,000	10,000	5	2,000	10,000	5	2,000	10,000
74	Toiler Training Seat	10	3,000	30,000	10	3,000	30,000	10	3,000	30,000	10	3,000	30,000
75	Infant Toys	30	4,000	120,000	30	4,000	120,000	30	4,000	120,000	30	4,000	120,000
76	Bath Toys	15	1,000	15,000	15	1,000	15,000	15	1,000	15,000	15	1,000	15,000
77	Fun Links Teether	15	300	4,500	15	300	4,500	15	300	4,500	15	300	4,500
78	Fun Pal Teether	15	500	7,500	15	500	7,500	15	500	7,500	15	500	7,500
79	Fun Rattle	15	400	6,000	15	400	6,000	15	400	6,000	15	400	6,000
80	Mother feeding Chair	1	3,000	3,000	1	3,000	3,000	1	3,000	3,000	1	3,000	3,000
81	Soft Books (duplication)	20	500	10,000	20	500	10,000	20	500	10,000	20	500	10,000
82	Bottle Brushes	3	300	900	3	300	900	3	300	900	3	300	900
List	of others Items i.e. Kitchen, Office,	Electric items		-			-			-			-
1	Water Dispenser	1	14,000	14,000	1	14,000	14,000	1	14,000	14,000	1	14,000	14,000
2	Microwave Oven	1	12,400	12,400	1	12,400	12,400	1	12,400	12,400	1	12,400	12,400
3	Fridge	1	34,000	34,000	1	34,000	34,000	1	34,000	34,000	1	34,000	34,000
4	Kitchen Accessories / Cutleries etc.	24	200	4,800	24	200	4,800	24	200	4.800	24	200	4,800
5	Sofa Set	1	40.000	40.000	1	40,000	40,000	1	40.000	40.000	1	40.000	40,000
6	Office Table	<u> </u>	5,000	5,000	1	5,000	5,000	1	5,000	5,000	1	5,000	5,000
7	Office Table Office Chairs	5	10,000	50,000	5	10,000	50,000	5	10,000	50,000	5	10,000	50,000
8	Air Conditioner	2	42,000	84,000	2	42,000	84,000	2	42,000	84,000	2	42,000	84,000
9	LCD	1	27,000	27,000	1	27,000	27,000	1	27,000	27,000	1	27,000	27,000
10	DVD player	1	5,000	5,000	1	5,000	5,000	1	5,000	5,000	1	5,000	5,000
11	CCTV Cameras	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000
12	Fire Alarms	3	5,000	15,000	3	5,000	15,000	3	5,000	15,000	3	5,000	15,000
13	UPS	1	10,000	10,000	1	10,000	10,000	1	10,000	10,000	1	10,000	10,000
14	Vacuum Cleaner	1	7,000	7,000	1	7,000	7,000	1	7,000	7,000	1	7,000	7,000
15	Fire Extinguishers (Large)	2	5,000	10,000	2	5,000	10,000	2	5,000	10,000	2	5,000	10,000
	Electric Insect Killer	2	7.800	15,600	2	7.800	15,600	2	7.800	15,600	2	7.800	15,600

		(Original		1st	Revised	i	2nd	Revised	t	3rd	Revised	i
Sr. No.	ITEMS	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total	Yard Stick (DCC of 25 Kids)	Unit Cost	Total
17	Electric Hand Dryer	1	4,000	4,000	1	4,000	4,000	1	4,000	4,000	1	4,000	4,000
18	Electric Heater	2	5,000	10,000	2	5,000	10,000	2	5,000	10,000	2	5,000	10,000
19	Ceiling/bracket Fans	4	8,000	32,000	4	8,000	32,000	4	8,000	32,000	4	8,000	32,000
20	Curtains	2	45,000	90,000	2	45,000	90,000	2	45,000	90,000	2	45,000	90,000
21	Carpets	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000	1	100,000	100,000
22	Other miscellaneous items	1	218,675	218,675	1	218,675	218,675	1	218,675	218,675	1	218,675	218,675
	TOTAL			1,600,000			1,600,000			1,600,000			1,600,000
				1.600			1.600			1.600			1.600

			Hu	ıman R	esourc	e Mode	l of TH	Q Hosp	oital									
			Oriç	ginal			1st Re	evised			2nd R	Revised				3rd Re	vised	
Sr. No.	NAME OF POST	No. of Employees	Per Month Salary	Per Month Salary for Person	Salary for One Year	No. of Employees	Per Month Salary	Per Month Salary for Person	Salary for One Year	No. of Employees	Per Month Salary	Per Month Salary for Person	Salary for Two Years	No. of Emplyees	Project Pay Scale	Per Month Salary	Per Month Salary for all Person	Salary for Two Years
1	ADMIN OFFICER	1	60,000	60,000	720,000	1	60,000	60,000	720,000	1	80,000	80,000	1,920,000	1	6	105,000	105,000	3,255,000
2	HUMAN RESOURCE & LEGAL OFFICER	1	60,000	60,000	720,000	1	60,000	60,000	720,000	1	80,000	80,000	1,920,000	1	6	105,000	105,000	3,255,000
3	IT/STATISTICAL OFFICER	1	60,000	60,000	720,000	1	60,000	60,000	720,000	1	80,000	80,000	1,920,000	1	6	105,000	105,000	3,255,000
4	FINANCE, BUDGET & AUDIT OFFICER	1	60,000	60,000	720,000	1	60,000	60,000	720,000	1	80,000	80,000	1,920,000	1	6	105,000	105,000	3,255,000
5	PROCUREMENT OFFICER	1	60,000	60,000	720,000	1	60,000	60,000	720,000	1	80,000	80,000	1,920,000	1	6	105,000	105,000	3,255,000
6	QUALITY ASSURANCE OFFICER	1	60,000	60,000	720,000	1	60,000	60,000	720,000	1	80,000	80,000	1,920,000	1	6	105,000	105,000	3,255,000
7	LOGISTICS OFFICER	1	60,000	60,000	720,000	1	60,000	60,000	720,000	1	80,000	80,000	1,920,000	1	6	105,000	105,000	3,255,000
8	DATA ENTRY OPERAOTOR (DEO)	2	25,000	50,000	600,000	2	25,000	50,000	600,000	2	35,000	70,000	1,680,000	2	3	44,000	88,000	2,728,000
9	ASSISTANT ADMIN OFFICER	2	40,000	80,000	960,000	2	40,000	80,000	960,000	2	50,000	100,000	2,400,000	2	5	70,000	140,000	4,340,000
	HR FOR QMS and MSDS and Day Care Center																	
11	QMS Supervisor / Information Desk Officer	2	25,000	50,000	600,000	2	25,000	50,000	600,000	2	25,000	50,000	600,000	2		25,000	50,000	600,000
12	Computer Operator	8	20,000	160,000	1,920,000	8	20,000	160,000	1,920,000	8	20,000	160,000	1,920,000	8		20,000	160,000	1,920,000
	Consultants (MSDS) Implementation & Clinical Audit	1	100,000	100,000	1,200,000	1	100,000	100,000	1,200,000	1	100,000	100,000	1,200,000	1		100,000	100,000	1,200,000
	Training on MSDS Compliance for Staff of THQ Hospital	1000	4,000	4,000,000	4,000,000	1000	4,000	4,000,000	4,000,000	1000	4,000	4,000,000	4,000,000	1000		4,000	4,000,000	4,000,000
15	Rent for Vehicle				500,000				500,000				500,000				0	500,000
	Manager Day Care Center	1	45,000	45,000	540,000	1	45,000	45,000	540,000	1	45,000	45,000	540,000	1		45,000	45,000	540,000
	Montessori Trained Teacher	1	35,000	35,000	420,000	1	35,000	35,000	420,000	1	35,000	35,000	420,000	1		35,000	35,000	420,000
	Attendant / Care Giver	4	25,000	100,000	1,200,000	4	25,000	100,000	1,200,000	4	25,000	100,000	1,200,000	4		25,000	100,000	1,200,000
19	Office Boy	1	20,000	20,000	240,000	1	20,000	20,000	240,000	1	20,000	20,000	240,000	1		20,000	20,000	240,000
	Sub Total of HI	R Model		4,860,000	17,220,000			4,860,000	17,220,000			5,040,000	28,140,000				5,273,000	
					17.220				17.220				28.140					40.473
	Utilization of HR 0								7.340				12.45					
	Total of HR Cor	nponent											35.48					52.928

Janitorial Services								
0		Origin	al	From 1st Revised to onward				
Assumptions Covered area excluding residential area Covered area assigned to one sweeper Number of sweepers required for covered area Road and ROW area Road and ROW assigned to one sweeper Number of sweepers required for road and ROW area Number of sweepers required for road and ROW area Number of washroom blocks Number of washroom block assigned to one sweeper Number of sweepers required for total washroom blocks Total sweeper in morning shift Total number of sweepers in evening shift Total number of sweepers in all shifts Number of sweepers in all shifts Number of sweer men required Number of supervisors	29,663 7,500 4 72,010 15,000 5 8 3 3 12 6 6 6 23	sft Sft Persons Sft Persons blocks Persons		In the light of decision made during the Progress Review Meeting of Revamping of DHQ/THQ Hospitals held on 01-01-2018 under the Chairmanship of Chairman, P&D Board; it was inter alia decided as under: "It would be made sure by the P&SH Department that the outsourcing would be shifted to the non-development side from 1st July 2018 next FY". In view of above, Outsourcing cost has been excluded from this PC-I.				
Salary component Type of worker	No of workers	Salary per month	Salary for One Year					
Sweepers / Janitors	23	22,000	6,136,275					
Sewer men	3	22,000	792,000					
Supervisors	3	26,000	936,000					
Cost of Supply per Month 400,000 Sub Total (Salary component)			4,800,000 12,664,275					

Security and Parking								
		Original			From 1st Revised to onward			
Assumptions	•				In the light of decision made during the Progress Review Meeting			
Covered area excluding residences	29,663				of Revamping of DHQ/THQ Hospitals held on 01-01-2018 under			
Covered Area per guard	15,000				the Chairmanship of Chairman, P&D Board; it was inter alia			
Number of guards	2				decided as under:			
Open area excluding parking area	72,010				"It would be made sure by the P&SH Department that the			
Area covered per guard per shift for	15,000				outsourcing would be shifted to the non-development side from			
open area excluding parking	13,000				1st July 2018 next FY". In view of above, Outsourcing cost has been excluded from this PC-			
Number of guards for total area	5				I.			
excluding parking area	3				1.			
Number of gates	2							
Number of guards at gates	4							
Total No of Guard	11							
Total number of all guards for second	5							
shift	3							
Lady Searcher	2							
Number of parking areas	1							
Number of guards for parking lot per	2							
shift (Morning+ Evening)	2							
Total no. of Supervisors	2							
Type of worker	No of workers	Salary per month	Salary per Month for all Person	Salary for One year				
Supervisors	2	24,675	49,350	592,200]			
Ex-Army	5	21,525	107,625	1,291,500				
Civilian	8	21,000	168,000	2,016,000				
Lady Searcher	2	21,525	43,050	516,600				
Parking	2	21,525	43,050	516,600				
Sub total				4,932,900				
Equipment cost								
Lump sum Provision (Walk Through								
Gate=1, Metal Detector=4, Walkies				400,000				
Talkies=8, Base Set=1)								
Sub total				400,000	1			
Subtracting Parking Fees				500,000	-			
Total Security and Parking Services				4,832,900				
•				4.833	1			

Laundry Services

		Original				
Number of beds	40					
Type of Item	No of Beds	Per bed cost per year	Total Cost			
No of Bed	40	30,000	1,200,000			
Transport Charges			1,200,000			
Total for laundry items			2,400,000			
Total			2.400			

From 1st Revised to onward

In the light of decision made during the Progress Review Meeting of Revamping of DHQ/THQ Hospitals held on 01-01-2018 under the Chairmanship of Chairman, P&D Board; it was inter alia decided as under:

"It would be made sure by the P&SH Department that the outsourcing would be shifted to the non-development side from 1st $\,$ July 2018 next FY".

In view of above, Outsourcing cost has been excluded from this PC-I.

		rigin	al	From 1st Revised to onward		
Item Name	Quantity	Cost per year	Total Cost	In the light of decision made during the Progress Review Meeting of Revamping of DHQ/THQ Hospitals held on 01-01-2018 under the		
Periodical Maintenance Cost				Chairmanship of Chairman, P&D Board; it was inter alia decided as		
Number of Generators (200 KVA)	-	500,000	-	under:		
Number of Generators (100 KVA)	-	300,000	-	"It would be made sure by the P&SH Department that the		
Number of Generators (50 KVA)	1	175,000	175,000	outsourcing would be shifted to the non-development side from 1s		
Repairs Cost	1	175,000	175,000	July 2018 next FY". In view of above, Outsourcing cost has been excluded from this PC-I		
HR Cost				in view of above, Outsoutcing cost has been excluded from this FC-1		
Supervisor	1	40,000	240,000			
Generator Operator	3	30,000	1,080,000			
Technical Staff/Mechanic	-	30,000	-			
Total			1,670,000			
			1.670			
			1.670			

MEP

		Ori	ginal		From 1st Revised to onward
Type of worker / Component	No of workers	Salary per month	Salary per Month for all persons	Salary for One Year	In the light of decision made during the Progress Review Meeting of Revamping of DHQ/THQ Hospitals held on 01-01-2018 under the Chairmanship of Chairman, P&D Board; it was inter alia decided as under:
Supervisors	1	56,420	56,420	677,040	"It would be made sure by the P&SH Department that the
Plumber	1	32,550	32,550	390,600	outsourcing would be shifted to the non-development side from 1st July 2018 next FY".
AC/ Technician	1	34,720	34,720	416,640	In view of above, Outsourcing cost has been excluded from this PC-I.
Electrician	2	31,465	62,930	755,160	
Car painter	1	30,380	30,380	364,560	
Total (Salary com	oonent)		217,000	2,604,000	
	No.	Per Unit	Cost per	Cost for One	
		Cost per Year	Year for all Items	Year	
A/C	36	6,665	239,940	239,940	
Fridge	4	4,000	16,000	16,000	
UPS	12	8,000	96,000	96,000	
Water Cooler	15	4,000	60,000	60,000	
Exhaust	7	3,000	21,000	21,000	
Geyser	15	4,000	60,000	60,000	
Water Pump	3	3,000	9,000	9,000	
Carpentry Work		-	180,000	180,000	
Electrical Work		-	120,000	120,000	·
Plumbing Work		-	75,000	75,000	
Sub Total				876,940	
General Total				3,480,940	
	1			3.481	

			Med	lical	Gases	i
	Original			From 1st Revised to onward		
	Scope of Work	Monthly Consumption per THQ Hospital	Annual Consumption per THQ Hospital	Rate per Cylinder	Total Annual Cost per THQs	In the light of decision made during the Progress Review Meeting of Revamping of DHQ/THQ Hospitals held on 01-01-2018 under the Chairmanship of Chairman, P&D Board; it was inter alia decided as under:
	Medical Oxygen Gas in 240 CFTCylinder (MM)	12	144	1850	266,400	"It would be made sure by the P&SH Department that the outsourcing would be shifted to the non-development side from 1st
	Medical Oxygen Gas in 48 CFTCylinder (MF)	30	360	1,000	360,000	July 2018 next FY". In view of above, Outsourcing cost has been excluded from this PC-I.
	Medical Oxygen Gas in 24 CFTCylinder (ME)	40	480	800	384,000	
Nitrous	Nitrous Oxide in 1,620 Liter (XE)	2	24	5,000	120,000	
Oxide	Nitrous Oxide in 16,200 Liter (XM)	1	12	12,500	150,000	
Nitrogen Gas	Nitrogen Gas	1	12	2,000	24,000	
		Total			1,304,400	
	·	·	·	-	1.304	

Cafeteria

Pre-Fabrication Cateen (Procurement)

			(Origin	al	From 1st Revised to onward
Sr. No.	Description of work	Unit	Qty	Rate (Rs)	Amount (Rs)	In the light of decision made during the Progress Review Meeting of Revamping of DHQ/THQ Hospitals held on 01-01-2018 under the Chairmanship of Chairman, P&D Board; it was inter alia decided as
1	Excavation in foundation of building, bridges and other structures, including dagbelling, dressing, refilling around structure with excavated earth, watering and ramming lead upto one chain (30 m) and lift upto 5 ft. (1.5 m) for ordinary soil	Cft	2545	6.13	15,602	under: "It would be made sure by the P&SH Department that the outsourcing would be shifted to the non-development side from 1st July 2018 next FY". In view of above, Outsourcing cost has been excluded from this PC-I.
2	Spraying anti-termite liquid mixed with water in the ratio of 1:40.	Sft	4305	2.21	9,514	
3	Supplying and filling sand of approved quality from outside sources under floors etc complete in all respects.	Cft	2268	15.62	35,426	
1	Providing, laying, watering and ramming brick ballast 1½" to 2"(40 mm to 50 mm) gauge mixed with 25% sand, for floor and foundation, complete in all respects.	Cft	998	39.15	39,069	
	Providing and laying damp proof course (1½" thick (40 mm)) of cement concrete 1:2:4, with one coat bitumen and one coat polythene sheet 500gauge	Sft	318	43.34	13,789	
6	Brick work with cement, sand mortar ratio 1:5	Cft	1792	180.25	323,071	
7	Cement concrete plain Ratio 1: 4: 8 including placing, compacting, finishing and curing complete (including screening and washing of stone aggregate)	Cft	427	170.72	72,893	
8	Cement concrete plain Ratio 1: 2: 4 including placing, compacting, finishing and curing complete (including screening and washing of stone aggregate)	Cft	1043	190.48	198,746	
9	Placing Granite tiles (24"x24"x0.5") using white cement over a bed of ¾" (20 mm) thick cement mortar 1:6.	Sft	2160	200.00	432,000	
10	Providing and laying Tuff pavers, having 7000 PSI, crushing strength of approved manufacturer, over 2" to 3" sand cushion i/c grouting with sand in joints i/c finishing to require slope. complete in all respect.	Sft	720	118.00	84,960	
	Total Amount of Platform Construction				1,225,070	
	Fabrication of Canteen Structure Providing and fixing aluminium frame window with double glazzed glass 6mm+6mm thick complete in all respect as approved by engineer	Sft	48	1100.00	52,800	
	Providing and fixing aluminium frame door with single glazzed glass 6mm thick complete in all respect as approved by engineer	Sft	56	700.00	39,200	
13	Fixing of frameless Glass wall of approved quality and design as approved by engineer	Sft	550	1500.00	825,000	
14	Providing Granite skirting or dado 4/8"(13 mm) thick including rounding of corner and straight ening of top edge and finishing to smooth surface afterplastering	Sft	491	212.00	104,177	
	Placing & erection of pre-painted Box section tube Columns of M.S sheet 4mm thick of size 4" x4" complete in all respect.	Kg	693	150.00	103,950	
	Placing & erection of pre-painted Box section tube Rafters of M.S sheet 4mm thick of size 3" x3" with all fittings, complete in all respect.	Kg	1040	150.00	155,925	
17	Placing & erection of pre-painted Box section tube Purlins of M.S sheet 1.6 mm thick (16 Gauge) of size 2" x2", with all fittings, complete in all respect.	Rft	676	120.00	81,144	
18	Placing & erection of pre-painted, Galvanized Sandwitched board of 0.5 mm thick M.S sheet with 50mm PU insulation with all fittings, complete in all respect.	Sft	2640	400.00	1,055,800	
19	Placing & fixing glass wool complete in all respect.	Sft	3024	50.00	151,200	
20	Placing & fixing Gypsum False Ceiling, complete in all respect.	Sft	3024	70.00	211,680	
	Providing & Fixing corrugated galvanized iron sheets 22 gauge with EPDM screw fittings, complete in all respect.	Sft	3629	145.00	526,176	

Cafeteria

Pre-Fabrication Cateen (Procurement)

		Original	From 1st Revised to onward				
To	otal Cost of Pre-Fabrication of Canteen Structure	3,307,052					
	Total Amount (Rs)	4,532,121					
22 EI	ectrification	998,735					
23 PI	umbing and Sanitory	410,000					
24 Ki	tching Fixtures	802,000					
	Grand Total Amount (Rs)	6,742,856					

6.743

			Original				
Sr. No.	Description	Unit	Quantity	Unit Rate Rs.	Amount Rs.		
1	SOFT LANDSCAPE						
1.1	TOP SOIL						
	Providing, spreading and leveling of topsoil (sweet soil including manure and fertilizers) as required complete in all respects as per Drawings, Specifications and as approved by the Engineer.	Cft	15,614	20	312,280		
1.2	STONE / PEBBLES						
	Supply and laying a layer of pebbles/stone at specified locations with Landscape base as in Landscape Design approved by the Engineer.	Truck	1	34,375	34,375		
1.3	GRASSING						
а	GRASSING (EXISTING NON MAINTANE LAWNS)						
	Providing and dibbing of Fine Dacca grass where required, including mud filling/leveling and contour shape preparation confirming to the criteria outlined in the Specifications, complete in all respects as per Drawings, Specifications and as approved by the Engineer.	Sft	21,413	7	149,891		
b	GRASSING (NEW LAWNS)						
	Providing and dibbing of Fine Dacca grass, including mud filling/leveling and contour shape preparation confirming to the criteria outlined in the Specifications, complete in all respects as per Drawings, Specifications and as approved by the Engineer.	Sft	26,766	11.25	301,118		
1.4	TREE / SHRUBS (SPREADING)						
	Providing and planting tree / shrub as listed and as arrangement and type shown in the Drawings, in pits of size 305mm x 305mm. Dug in improved soil 610mm. deep filled by adding 10% cow dung manure and confirming to the criteria outlined in the Specifications, complete in all respects and to the satisfaction of Engineer.						
а	Trees 18" pot 6'-7' - Terminally, Cassia Fistula, Bauhinia Variegated, Alstonia Choirs, Ficus Yellow, Ficus Black, Jacaranda, Pilken, Mangifera etc.	No's	109	1,500	163,500		
b	Trees 12" pot 3'-4' - Polyalthia Long folia, Terminally, Cassia Fistula, Bauhinia Variegated, Latonia Choirs, Delonix Regia, Ficus Yellow, Focus Black, fichus Starlight, Melaluca, Mimuspps, Pine, Ficus Amestal, Pilken, Palms etc.	No's	25	270	6,750		
С	Plantation of Fruit Plants in the vacant area 12" pot 3'- 4' - Am rood, Jaman, Berri, Mango, Citrus. Including site preparation, plantation, watering and maintenance for six months.	No's	10	600	6,000		

From 1st Revised to onward

In the light of decision made during the Progress Review Meeting of
Revamping of DHQ/THQ Hospitals held on 01-01-2018 under the
Chairmanship of Chairman, P&D Board; it was inter alia decided as
under:

"It would be made sure by the P&SH Department that the outsourcing would be shifted to the non-development side from 1st July 2018 next FY".

In view of above, Outsourcing cost has been excluded from this PC-I whereas

Rs. 0.048 million has been charged in this scheme against Design Consultancy from development side before the above said decision, hence it is reflected in this PC-I.

	OOOT EOTHINATE											
			0	rigina	l	From 1st Revised to onward						
1.5	Shrubs and Ornamental Plants 10° pot Pittosporum Variegated, Murray Small, Ixora Coccinea, Juniper Varigated, Hibiscus Varigated, Carronda Dwarf Spp, Jasmine Sambac(Mottya), Leucophyllum Frutescens(Silvery), Rose, Nerium, Lantana, Canna, Asparagrass, Conocarpus, Acalypha, Callistemon Dwarf, Cestrum, Thabernaemontara Variegated etc.	No's	9,733	69	671,577							
а	Shrubs and Ornamental Plants 12" pot Pittosporum Varigated, Ixora Cochineal, Juniper Variegated, Carronade Dwarf, Jasmine Thai, Plumier Robar, Cassia Malacca, Largest mea, Euphorbia, Jestropha Thai etc	No's	1,529	195	298,155							
1.6												
	Providing and planting ground covers as listed and as arrangement and type shown in the Drawings, in pits of size 150mm x 150mm x 150mm. Dug in improved soil 610mm deep filled by adding 10% cow dung manure and confirming to the criteria outlined in the Specifications, complete in all respects and to the satisfaction of Engineer.											
	Ground Cover Plastic Bag Plants Alternant Hera, Dianella, Iresine (Red), Hemercollis(Daylily), Duranta etc	No's	10,395	12	124,740							

	1				_	
			О	rigina		From 1st Revised to onward
1.7	PALMS					
	Providing and planting palms as per Drawings, specifications and to the satisfaction of Engineer .					
а	Palm 18" pot - Queen Palm, Wodyetia Bifurcate, Washingtonian Palm, Biskarkia etc.	No's	12	3,675	44,100	
b	Palm 18" pot - Phoenix Palm, Cyrus Palm	No's	17	1,800	30,600	
1.8	CREEPERS					
	Providing and planting Creepers as listed and as arrangement and type shown in the Drawings, in pits of size 305mm x 305mm x 305mm. Dug in improved soil 610mm. deep filled by adding 10% cow dung manure and confirming to the criteria outlined in the Specifications, complete in all respects and to the satisfaction of Engineer. Creepers 12" Pot - Bougainvillea, Bonsai, Qusqualus,					
	Bombay Creeper etc.	No's	52	195	10,140	
2	HARD LANDSCAPE					
2.1	WALK WAYS					
а	Excavation of walkways and edging including brick ballast under 12"X14" curb stones fixing with1:2:4 PCC, supply of 7000PSI tuff tiles 60mmas per approved design fixing on 4" brick ballast compacted and grouting with sand.	Sft	2141	150	321,150	
2.2	BENCHES					
	Concrete Bench 5' wide complete in all respects and to the satisfaction of Engineer as per approved design.	No's	10	14,698	146,980	
2.3	DUSTBINS					
	Complete in all respects and to the satisfaction of Engineer as per approved design.	No's	7	27,700	193,900	
2.4	PLAYING EQUIPMENTS Complete in all respects and to the satisfaction of Engineer as per approved design. PLANTERS	No's	1	544,939	544,939	
2.5	Concrete planters 2' X 2-1/2' complete in all respects and to the satisfaction of Engineer as per approved design.	No's	9	3,850	34,650	
2.6	WATER POINTS (Injector Pump 1HP)	No's	2	45,000	90,000	
3	SOFT LANDSCAPE MAINTENANCE (Including maintenance and up keeping of site for 6 months) after development as per specifications and to the satisfaction of Engineer.	Sft	53,532	7.50	401,490	
4	CONSTRUCTION OF PLANTERS					
4.1	Large Size with keystones fixed with cement with top concrete slab as per design and to the satisfaction of Engineer.	No's	208	550	114,400	
4.2	Medium Size with keystones fixed with cement with top concrete slab as per design and to the satisfaction of Engineer.	No's	27	550	14,850	

		Original				From 1st Revised to onward
4.3		No's	50	550	27,500	
5	slab as per design and to the satisfaction of Engineer. GAZEEBO Construction of Gazebo 12' X 12' with top fiberglass 3 layer canopy as per approved design and to the satisfaction of Engineer.	No's	1	200,000	200,000	
	Total Amount of - Landscaping				4,243,085	
	PRA(16%)				678,894	
	Design Consultancy				100,000	
	TPV (3%)				127,293	
	Grand Total				5,149,271	
					5.149	

To.

PH #048-9230371 July 20

The Chief Executive Officer, District Health Authority, Sargodah.

No. 4780/EST

Dated

10/08/2022

Subject:

WORK THE ROUGH COST **ESTIMATE** "PROGRAMME FOR REVAMPING OF ALL THO HOSPITAL IN PUNJAB ONE AT KOT MOMIN " DISTRICT SARGDOAH.

Rough Cost Estimate amounting to Rs.49.281 (M) for the scheme cited as subject based on the plinth area rates 2nd Bi-annual 2022 is forwarded herewith duly vetted for arranging Administrative Approval / Funds from the competent authority.

DA/Estimate

Superintending Engineer, Building Circle, **∱Sargodha**

No.

Dated

/2022

A copy is forwarded to the Executive Engineer Buildings Division, Sargodha, for information with reference to his letter No.2384/EST dated 30.07.2022. Recured foday

Establishment Br.

Budget & Actt: Br.

P&D/Audit Cell.

P. Cell/DQCB Br.

O(DHA) Sargodha

General Br.

LT.LAB.

HETCO

DA/Nil

Superintending Engineer,

Building Circle, Sargodha Diary No. - 5/9/

Date:

RECEIVED

Deputy M Finance

Proces Outsou

Infrastrees Planning & Say

Operations

Health Legal

18 C BERG

Mr Anon

Page 82

CIRCLE

SARGODHA

DEPARTMENT

WORKS & SERVICES

DISTRICT

SARGODHA

DIVISION

BUILDING DIVISION SARGODHA

SUB DIVISION

BUILDING SUB DIVISION KOTMOMIN

NAME OF WORK

ROUGH COST ESTIMATE FOR THE WORK "
REVAMPING OF THQ HOSPITAL
KOTMOMIN DISTRICT SARGODHA

MRS

2nd BI-ANNUAL 2022 (1ST July. 2022 TO 31st december 2022)

HEAD OF ACCOUNT

HEALTH DEPARTMENT

ESTIMATED COST

49·28/(m) -49.688 (M)

RS=

Page 83

(3

DETAILED ESTIMATE FOR THE WORK "REVAMPING OF T.H.Q HOSPITAL KOTMOMIN DISTRICT SARGODHA.

HISTORY

The Govt. of Punjab is taking keen interest to provide the basic facilities in all THQs in Punjab one at THQ Hospital Kotmomin Consequently, The Technical Team of Primary & Secondary Health Care Department Govt. of the Punjab Lahore has conducted a joint visit with Buildings Department Sargodha on 18.07.2022 to propose basic facilities to THQ hospital Kotmomin.

Hence this rough cost estimate amounting to Rs.49.688 (M) has been prepared for Administrative Approval and funds from the competent authority

SCOPE OF WORK.

1	Renovation / Improvement of existing main building
2	Relaying of settled tuff Paver
3	Provision of street lights

SPECIFICATION.

The work will be carried out in accordance with Building department specification latest edition and entire satisfaction of Engineer In charge

RATE.

Rate 2nd Bi-annual 2022

TIME LIMIT

It will take (12) Months for actual date of Acceptance.

COST

The Total Cost comes to Rs: 49.688 (M)

Que'

Sub Divisional Officer
Buildings Sub Division
Kotmomin

Executive Engineer Buildings Division Sargodha.

CHECK LIST FOR IDENTIFICATION OF SCOPE FOR REVAMPING OF HEALTH FACILITY

THQ KOT MOMIN 19-07-22

Sr No	Item	OPD Block GF+FF	Operation Theatre	indoor Wards (male+female)	Laboratory	X-ray Room	Remarks
1 ,	Tile replacement	Full Body Porcelain tiles needs to be fixed on floor of ground floor & First Floor by dismantling existing terrazo and providing new PCC layer of specified thickness.		Full Body Porcelain tiles needs to be fixed on floor by dismantling existing terrazo and providing new PCC layer of specified thickness.	Full Body Porcelain tiles needs to be fixed on floor by dismantling existing. terrazo and providing new PCC layer of specified thickness.		Tiles specifications, brand, size and Installation specification will be as per specified C&W standards.
2	Porcelain Wall Tile replacement	Full Body Porcelain tiles needs to be fixed on walls up to height of 6ft. Or height as per C&W Standards (for corridors, wards, waiting areas) and 6" skirting (inside rooms/offices) after dismantling of existing surface terrazoo surface.		Full Body Porcelain tiles needs to be fixed on walls up to height of 6ft. (for corridors, wards, waiting areas) and 6" skirting (inside rooms/offices) after dismantling of existing surface.	Full Body Porcelain tiles needs to be fixed on walls up to height of 6ft. (for corridors, wards, waiting areas) and 6" skirting (inside rooms/offices) after dismantling of existing surface.		Tiles specifications, brand, size and Installation will be as per specified C&W standards.
3	Wooden Doors flush or Solid/ Main Doors	Doors need to be replaced with aluminium doors of similar existing design to keep the pattern same.	Main entrance door of OT should be provided of Aluminium	Doors need to be replaced with wooden doors of similar existing design.	Doors need to be replaced with wooden doors of similar existing design.	Doors need to be replaced with wooden doors of similar existing design.	Specifications, wood/type of door, polish, door locks and handles will be as per specified C&W standards.

4	Verandah opening (opening to open area)/ MS Windows on Façade	Half of the Verandah openings are already having aluminium windows. Therefore, new verandah openings will also be made of aluminium to keep the pattern same.					Specifications will be as per C&W standards
5	Existing Internal Windows	All Existing internal MS windows need to be replaced with Aluminum Windows	All Existing internal MS windows need to be replaced with Aluminum Windows.	All Existing internal MS windows need to be replaced with Aluminum Windows.	All old MS internal windows need to be replaced with Aluminum Windows	All old MS internal windows need to be replaced with Aluminum Windows.	Specifications, Aluminum and glass color will be as per specified C&W Standards
6	Internal Corridors	Wall Panelling to be removed from walls and seepage issues to be addressed rectified.		Wall Panelling to be removed from walls and seepage issues to be addressed rectified.			
7	Internal Electrification including fittings	All Electric fittings including switch boards, plates, sockets, wires & DBs should be replaced and installed at standard height from Finish Floor level and all must be identical. Internal wiring should be replaced with new wiring if existing wiring is damaged.	All Electric fittings including switch beards, plates, sockets, wires & DBs should be replaced and installed at standard height from Finish Floor level and all must be identical.	All Electric fittings including switch boards, plates, sockets, wires & DBs should be replaced and installed at standard height from Finish Floor level and all must be identical.	All Electric fittings including switch boards, plates, sockets, wires & DBs should be replaced and installed at standard height from Finish Floor level and all must be identical.	All Electric fittings including switch boards, plates, sockets, wires & DBs should be replaced and installed at standard height from Finish Floor level and all must be identical.	Model Specifications/ Brands, should be as per specified C&W Standards

_								, .
								Model
	8	Lighting	All corridors and rooms should lit with SMD's with	SMDs need to be installed.		Remove ceiling & install SMD lights.	SMDs need to be installed.	Specifications/ Brands and
-		Fixtures	concealed wiring.	;		Sivid lights.		distance should be as per specified
							·	C&W Standards
				All washrooms				
	,		All washrooms need to be	need to be revamped	,	All washrooms need to		Vanity, wash basin
		,	revamped completely by fixing full body porcelain	completely by fixing full body	All washrooms need to be revamped completely by	be revamped completely . by fixing full body	All washrooms need to be	water closets, bath
		•	tiles on floor and full body	porcelain tiles on floor and full body	fixing full body porcelain tiles on floor and full body	porcelain tiles on floor, and full body porcelain	revamped completely by fixing full body porcelain	room accessories, tile size and color
	9	Revamping of Public Toilets	a minimum height of 7 ft. All existing fixtures should	[wall up to a	porcelain tiles on wall up to	tiles on wall up to a	tiles on floor and full body porcelain tiles on wall up to	will be as per specified C&W
1			be replaced with new fixtures along with	minimum height of 7 ft. All existing	existing fixtures should be:	minimum height of 7 ft. All existing fixtures	a minimum height of 7 ft. All existing fixtures should be	All Washroom doors.
1		,	complete repair of existing	fixtures should be replaced with new	along with new water supply	1	replaced with new fixtures along with new water supply	
			water supply and sewerage connections	fixtures along with new water supply		new water supply and sewerage connections.	and sewerage connections.	having specified C&W Standards.
				and sewerage connections.				
	,			dominionid.				
L		<u> </u>	<u> </u>	<u> </u>		<u> • </u>		

10		of walls should be	All Walls should be painted after complete scrapping of existing paint and surface of walls should be prepared after plastering in patches (where required only) and wall Putty prior to paint works.	All Walls should be painted after complete scrapping of existing paint and surface of walls should be prepared after plastering in patches (where required only) and wall Putty prior to paint works.	All Walls should be painted after complete scrapping of existing paint and surface of walls should be prepared after plastering in patches (where required only) and wall Putty prior to paint works.	All Walls should be painted after complete scrapping of existing paint and surface of walls should be prepared after plastering in patches (where required only) and wall Putty prior to paint works.	Plaster Cement Ratio, wall putty brand specifications, paint specifications, brand and color will be as per C&W standards.
11	Roof Treatment	Half of the hospital building (Old Building) requires roof treatment. Remaining half portion is in good conditon.					
12	Nursing Counter			Nursing counter will be provided upto 2.5' height with granite marble on top. Change tile on counter front with full body porcelain tile.			
13	and Railing	All stairs with terrazo on steps need to be replaced with Marble/Granite on steps. Stair railing needs to be replace with SS stair rail.					Marble/Granite type and installation technique will be as per C&W Standards.

· · · · · · · · · · · · · · · · · · ·		0					·
14 . `		Chequered tile & SS hand railing will be fixed on ramps.			•		
15	Façade Uplifting	Façade treatment should be executed on front elevation.					
16	Lead linning Walls (X-Ray)					Lead lining of x-ray room needs to be done.	
- 17	Anitmicrobial Treatment (OTs)		Anti-microbial treatment is required in operation theatre (Dampa Ceiling, Anti-microbial wall panelling, anti-static flooring).				
18	Extèrnal Weather Shield	Weather shield to be done on all external walls other than façade		Weather shield to be done on all external walls other than façade	Weather shield to be done on all external walls other than façade	Weather shield to be done on all external walls other than façade	
19		SS Edge Protection needs to be fixed on all corners up to Dado height	/	SS Edge Protection needs to be fixed on all corners up to height of 5 ft. till the height of Wall/Dado tiles.	SS Edge Protection needs to be fixed on all corners up to height of 5 ft. till the height of Wall/Dado tiles.		

20 .	Columns SS Cladding						
21	Plumbing	Damaged Water supply & sewerage pipes causing seepage to be repaired & rectified.	Damaged Water supply & sewerage pipes causing seepage to be repaired & rectified.	Damaged Water supply & sewerage pipes causing seepage to be repaired & rectified.	sewerage pipes causing	Damaged Water supply & sewerage pipes causing seepage to be repaired & rectified.	
22	Fire Alarm System	Required	Required	Required	Required	Required	
23	Roof Treatment	Only 50% of the hospital (old building) requires roof treatment.					
24	of Building	All expansion joints of building should be properly filled, sealed & covered SS strip. Joint must not be covered with Tile/Flooring	Treat expansion joint of building properly & cover it with SS patti	Treat expansion joint of building properly & cover it with SS patti	Treat expansion joint of building properly & cover it with SS patti		

25	Any Other item	There is a stair leading to first floor in emergency which is quite narrow. It may be dismantle and reconstruct again properly. Glass covering a pergola is broken. It may be replaced.				Marble will be provided on counter top. Wooden shelves should be made under counter.		•	
26	External Electrification	All external main cables of h Earthing system and lightnin	ospital which are ha g arresters. Similar	anging in Air should rly, existing DB's nee	be conce d to be r	ealed in all respects along verblace as per site condition	uith provision of prop if required.	er	

ROUGH COST ESTIMATE FOR THE WORK "REVAMPING OF THQ HOSPITAL KOTMOMIN DISTRICT SARGODHA

S.#		Plinth		Rates		,			,
	Description of items	Area	B.P	E.I	S.I	Total .	Unit	Amount	Remarks
1	?	3	4	7	8	9	10	42886833	. 12
1	Rennovation / Improvement of existing main building							42886833 -48211440	Estimate prepared on Plinth Area Rates for the 2nd Bi-Annual 2022
2	Relaying of settled tuff Paver							. 1364972	Detailed Attached
3	Provision of street lights	•						2342052	Detailed Attached
, - <u>-</u> -							. Total Rs.	46593857 _46918465	
4	credit of old materials							574500	Detailed Attached
				· · · · ·			Total Rs.	574000	
							Net Rs.	46019857 	
	Add 1% Horticulture charges	·						460198	
	Add 5% PRA Tax							2300 992	
	Wapda / Gas connection charges						•	.500000	
		7.24.0.10					Total Rs.	4928/04	
							Say Rs/	492 8 100 -49688000	
•			,				R Rs/ In Millions	44.201	

Sub Engineer

Sub Divisional Officer, Buildings Sub Division Kotmomin

Executive Engineer

Buildings Division

Sargodha

Building Circle

ROUGH COST ESTIMATE FOR THE WORK " REVAMPING OF THO HOSPITAL KOTMOMIN DISTRICT SARGODHA

GENERAL ABSTRACT OF COST

41637702

Rs. 41952854-

MAIN BUILDING

Total

41637702 Rs-41952854

1249131

Rs. 1258586

Add 3% contingency Rs. 41952854

G.Total

Sub Divisional Officer, Buildings Sub Division,

Kotmomin

Executive Engineer Building Division SARGODHA

ROUGH COST ESTIMATE FOR THE WORK "REVAMPING OF THO HOSPITAL KOTMOMIN DISTRICT SARGODHA

GENERAL ABSTRACT OF COST MAIN BUILDING

				•
1	•	Buildi	ng P	ortion

32198000

E.I. Portion 2

4482301 Rs.-4522301.00

3 S.I. Portion

146 4327 Rs. 1514979.00

Sub Main Electric system

Rs. 3493074.30

Total:-

41637702 -Re-41952854.30

Executive Engineer

Building Division

/ Sub Divisional Officer, Buildings Sub Division,

Kotmomin

ROUGH COST ESTIMATE FOR THE WORK " REVAMPING OF THQ HOSPITAL KOTMOMIN DISTRICT SARGODHA

		MAIN BU	ILDING			,	
Dismantling of PCC (1:2:4)					.*	•	
Eye/spe/wait 4	x 11 1/4 .	x 15 1/4	x 1/6	115	Cft	•	
	x 72	x 8	x 1/6	96 15			•
- 4 6	x 11 1/4 x 5	x 2 x 5 3/4	x 1/6 x 1/6	29		,	7, ,
Crush hall	x - 29 1/2	x 56	x 1/6 .	276			*
work shop 1	x 11 1/4	x 6	x 1/6	11			
Emergency 1	x 23 1/4	_	x 1/6 x 1/6	59 17			
waiting !	x 11 1/4 x 11 1/4	x 9 x 6	x 1/6	:11			-
store 1 ramp 2	x 11 1/4 x 57	x · 8	x 1/6	152		•	
1	x 30	x · 8	x 1/6	40	· .		
3 1/7	x 14	x 14 .	x 1/6	· 103		•	
old building	x 8 x 9 1/4	x 22 x 22	x 1/6 x 1/6	34			•
	$\frac{x}{x} = \frac{91/4}{22}$	x 22 x 22	x 1/6	81			
gyn 1 1	x 22	x 22 °	· x 1/6	81			
ward * 1	x 25 3/4	x 22	x 1/6	. 95			
1	x 11 1/2	x 22	x = 1/6 x = 1/6	42 15			
scrap	x 8 x 8	x 11 ¹ x -10 5/8	x 1/6 x 1/6	13			
change I O1 I	х 8 х 16	x 22	x 1/6	59			
ward	x 26	x · 22	x 1/6	96			
1	x 9	x 16	x 1/6	24	٠.,		
1	x 9	x 7 1/2	x 1/6 x 1/6	11. 8	•		
,	x 9 x 9	x 5 x 5	x 1/6 x 1/6	. 8	•		
<u>.</u>	x 9	x 22	x 1/6	33	٠	-	
labour 1	1.6	x 22 ·	x 1/6	59		•	
1	x -8	x 6	x 1/6	8. 23			
1	x 16	x 8 1/2 x 18 1/2	x 1/6 x 1/6	52 52		•	•
pathology 1	x 16 7/8 x 11	x 18 1/2 x 18 1/2	x 1/6	34	•		•
store,	· x 5 1/2	x 6	x 1/6	. 6			
inspector 1	x 11.7/8	x 10 1/4	x 1/6	.20			•
0.	x 8 1/2	x 7 1/2°	x 1/6	11		•	• • • •
medicine 1	- x 13 3/4	x 18 1/2 x 5	x 1/6 x 1/6	42 5			
l.	x 5 1/2 x 21	x 5 x 11 3/4	x 1/6	41.			•
ward I	x 27 1/4	x . 8	x 1/6	.36			
DMS . 1	x 13 3/4	N 18 1/4	x 1/6	42	,		
Hall · 1	x 20	x 28	x 1/6	94.			•
<u> </u>	x 12	x 18 1/2 x 18 1/2	x 1/6 x 1/6	37 37	,		
	$\begin{array}{c cc} x & 12 \\ x & 20 \end{array}$	x 18 1/2 x 18 1/2	x 1/6	62	,		
1	x 102 ·	x 8	x 1/6	136	•	. ,	
	x 72 ·	x: 8 ;	x 1/6	192			
2	x 44	x 8	x · 1/6	. 118 115	,		•
\mathbf{FF} , \mathbf{F}	x 11 1/4 x 43	x 15 1/4 x 8	x - 1/6 x 1/6	57			
1	x 43 x 8 1/2	x 8 x 11 1/4	x 1/6	16		•	
	x 29 7/8	x 35	x 1/6	175.			
2	x 11 1/4	x 7 1/2	x 1/6	28			
ward	x 23 1/4	x 16	x 1/6	62 62			
1	x 23 1/4	x 16 · · x 6	x 1/6 x 1/6	. 35	1	. '	
Bath , 7	x 5 x 4 1/2	x 6 x 5	x * 1/6	. 38			. · · · · ·
. 10 ,	x 5	x 7	x 1/6	6			
4	x 5	x 4	x 1/6	13	CF		
	• .		Total:-	3216 11209.45	Cft %Cft		Rs. 360496/-
en de la companya de	a tiloa lata	•	@	11207.43	/0CIL		
2 Dismantling glazed or encaustic				,		•	•
Eye/spc 4 (11.1/4) 2	x 3	636			
1 (72	1 8	,) 2,	x 3	480	,	: D o	ge 107
						га	gc 10/

work shop 1 (11 1/4 + 6 6) 2 x 1/2 17 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 3 231 122 23 102 33 122 23 102 33 122 33 122 33 122 34 122 34 122 33 122 34 122 34 122 34 122 34 122 34 122 34 122 34 122 34 122 34 122 34 122 34 122 34 122 34 122 34 122 34 144 34<		•							10tal.•	2391.85	%Sft
work shop 1 (11 1/4 + 6 6) 2 x 1/2 1/7 1/7 1/7 1/7 1/7 1/7 1/7 1/7 1/7 1/7		4	(5	-†-	4	٠.	2	· X			Sft
work shop 1 (11 1/4 + 6 6) 2 2			`			j 1					
work shop	•		· .) }	•				
work shop	Bath)					* *
work shop	D.:45	l La)					
work shop 1 () 11 1/4 + 6	ward	· I)					
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 14) 2 x 3 122 store 1 (14 + 14)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 222)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 180 gyn 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (11 1/2 + 22)) 2 x 3 264 ward 1 (8 + 10 5/8) 2 x 3 201 scrap 1 (8 + 10 5/8) 2 x 3 228 ward 1 (16 6 + 22)) <td>, </td> <td>ے ۔ ا</td> <td>•</td> <td></td> <td></td> <td>)</td> <td></td> <td>•</td> <td></td> <td></td> <td></td>	, 	ے ۔ ا	•)		•			
work shop 1 (23 1/4 + 15 1/4) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 19) 2 x 3 122 store 1 (11 1/4 + 14) 6) 2 x 1/2 17 ramp 2 (57 + 8 8)) 2 x 3 228 old building 1 (8 + 222)) 2 x 3 168 old building 1 (8 + 222)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (8 + 10 5/8)) 2 x 3 21 change 1 (8 + 10 5/8)) 2 x 3 114 <td></td> <td>1</td> <td></td> <td></td> <td></td> <td>)</td> <td></td> <td></td> <td></td> <td></td> <td>•</td>		1)					•
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 1/2 17 ramp 2 (57 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (11 1/2 + 22)) 2 x 3 264 ward 1 (8 + 10 5/8)) 2 x 3 114 change 1 (8 + 105/8)) 2 x 3 114 change<		1				.)					
work shop		1)			_		
work shop	r.r	4)	,2				
work shop			`)					
work shop	•)					
work shop			-)	<i>∠</i>				
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergeney 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 231 waiting 1 (11 1/4 + 6)) 2 x 3 122 store 1 (14 + 14)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (8 + 110 5/8)) 2 x 3 114 change 1 (8 + 10 5/8)) 2 x 3 114 change 1		1	•)	<u> </u>				
work shop	• • •	, 1	•)		-			
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 3 122 ramp 2 (57 + 8)) 2 x 3 122 ramp 2 (57 + 8)) 2 x 3 128 1 (30 + 8)) 2 x 3 128 1 (14 + 14)) 2 x 3 128 1 (14 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 214 change 1 (8 +		1	-			<i>)</i> 1				•	
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 3 122 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (8 + 11)) 2 x 3 201 scrap 1 (8 + 10 5/8) 2 x 3 112 OT 1 (16 + 22	ı tali	1	•) 1					
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (8 + 11) 2 x 3 211 change		1	•) }					
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 3 122 ramp 2 (57 + 8) 2 x 3 780 1 (30 + 8)) 2 x 3 780 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22) 2 x 3 168 old building 1 (8 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (8 + 110 5/8) 2 x 3 114 change 1 <td></td> <td>1</td> <td>•</td> <td></td> <td></td> <td>) Y</td> <td></td> <td></td> <td></td> <td></td> <td></td>		1	•) Y					
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 3 122 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 old building 1 (8 + 22)) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 287 ctap 1 (8 + 11	ward		• •			, 1					
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 3 1/2 17 ramp 2 (57 + 8) 2 x 3 228 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 180 1 (9 1/4 + 22) 2 2 x 3 180 2 (9 1/4 + 22) 2 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (8 + 11) 2 x 3 201 scrap 1 (8 + 11) 2 x 3 214 change 1 (16 + 22) 2 x 3 228 ward 1 (26 + 22) 2 x 3 228 ward 1 (26 + 22) 2 x 3 228 range 1 (16 + 22) 2 x 3 228 ward 1 (16 + 22) 2 x 3 228 ward 1 (16 + 22) 2 x 3 228 ward 1 (16 + 22) 2 x 3 228 ward <t< td=""><td></td><td>ì</td><td></td><td></td><td></td><td>)</td><td></td><td></td><td></td><td></td><td>.•</td></t<>		ì)					.•
work shop 1 (11 1/4 + 6) 2 x 3/2 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 3 1/2 17 ramp 2 (57 + 8) 2 x 3 228 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 180 1 (14 + 14) 2 x 3 180 1 (9 1/4 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 201 scrap 1 (8 + 11) 2 x 3 114 change 1 (16 + 22) 2 x 3 228 ward 1 (26 + 22) 2 x 3 228 ward 1 (26 + 22) 2 x 3 228 ward 1 (16 + 22) 2 x 3 288 1 (16 + 22) 2 x 3 228 ward 1 (16 + 22) 2 x 3 228 ward 1 (16 + 22) 2 x 3 228 ward 1 (16 + 22) 2 x 3 228<		1		-1-)		×	3		
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 3 122 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 188 gyn 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (8 + 11)) 2 x 3 114 ch	medicine	1				•					
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (8 + 11)) 2 x 3 287 OT 1 (16 + 22)) 2 x 3 228 ward 1 (26 + 22) </td <td>1</td> <td>1</td> <td>•</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>	1	1	•								
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 3 122 store 1 (130 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 188 gyn 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (8 + 11)) 2 x 3 114		1	•	-{	10 1/4)		· x	1/2	22	
work shop 1 (1.1 1/4 + 6) 2	store .	4		-1	6.)		х	1/2	12	
work shop 1 (1.1 1/4 + 6) 2	i	1	(11	-1-	18 1/2)		х			
work shop 1 (11 1/4 + 6) 2	pathology	1 .	•	+)		Х			
work shop		, 1	•)	2				
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 old building 1 (8 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22)) 2 x 3 201 scrap 1 (8 + 11)) 2 x 3 114 change 1 (8 + 10 5/8) 2 x 3 228 ward 1 (2		1-	. •	•)					
work shop	labour	[•)					•
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 1/2 17 ramp 2 (57 + 8) 2 x 3 780 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180 1 (9 1/4 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 287 1 (11 1/2 + 22) 2 x 3 201 scrap 1 (8 + 11) 2 x 3 114 change 1 (8 + 10 5/8) 2 x 3 112 OT 1 (16 + 22) 2 x 3 288 1 (9 + 16) 2 x 1/2 25 1 (9 + 71/2) 2 x 1/2 17 1 (9 + 5) 2 x 1/2 14 1 (9 + 5) 2 x 1/2 14	1.1	í	•)					
work shop 1 (111/4 + 6) 2 x 1/2 17 Emergency 1 (231/4 + 151/4) 2 x 3 231 waiting 1 (111/4 + 9) 2 x 3 122 store 1 (111/4 + 6) 2 x 1/2 17 ramp 2 (57 + 8) 2 x 3 780 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (253/4 + 22) 2 x 3 264 ward 1 (253/4 + 22) 2 x 3 287 1 (111/2 + 22) 2 x 3 201 scrap 1 (8 + 11) 2 x 3 114 change 1 (8 + 105/8) 2 x 3 112 OT 1 (16 + 22) 2 x 3 288 1 (9 + 16) 2 x 1/2 25 1 (9 + 16) 2 x 1/2 17 1 (9 + 71/2) 2 x 1/2 14		1	•		•	<i>)</i> 1					
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 1/2 17 ramp 2 (57 + 8) 2 x 3 780 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180 1 (9 1/4 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 201 scrap 1 (8 + 11) 2 x 3 114 change 1 (8 + 10 5/8) 2 x 3 112 OT 1 (16 + 22) 2 x 3 228 ward 1 (26 + 22) 2 x 3 228 ward 1 (26 + 22) 2 x 3 228 ward 1 (9 + 16) 2 x 1/2 25 1 (9 + 16) 2 x 1/2 25 1 (9 + 16) 2 x 1/2 25		1	`			<i>)</i>					
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 1/2 17 ramp 2 (57 + 8) 2 x 3 780 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180 1 (9 1/4 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 201 scrap 1 (8 + 11) 2 x 3 114 change 1 (8 + 10 5/8) 2 x 3 112 OT 1 (16 + 22) 2 x 3 288 1 (9 + 16) 2 x 1/2 25		1 .	` .) }					
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 1/2 17 ramp 2 (57 + 8) 2 x 3 780 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180 1 (9 1/4 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (8 + 11) 2 x 3 287 I (11 1/2 + 22) 2 x 3 114 change 1 (8 + 10 5/8) 2 x 3 112 OT 1 (16 + 22) 2 x 3 288 ward 1 (26 + 22) 2 x 3 288						ì					
work shop 1 (111/4 + 6) 2 x 1/2 17 Emergency 1 (231/4 + 151/4) 2 x 3 231 waiting 1 (111/4 + 9) 2 x 3 122 store 1 (111/4 + 6) 2 x 1/2 17 ramp 2 (57 + 8) 2 x 3 780 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180 1 (91/4 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (253/4 + 22) 2 x 3 264 ward 1 (253/4 + 22) 2 x 3 201 scrap 1 (8 + 11) 2 x 3 114 change 1 (8 + 105/8) 2 x 3 112 OT 1 (16 + 22) 2 x 3 112	. /	1				ή.	2				
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 3 780 1 (30 + 8) 2 x 3 780 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180 1 (9 1/4 + 22) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 201 scrap 1 (8 + 11) 2 x 3 114 change 1 (8 + 10 5/8) 2 x 3 112		1	•	-+ -	•)	2	. x	: 3	288	
work shop 1 (11 1/4 + 6)) 2	_	" 1		4-	•)		х	3	228	
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 264 ward 1 (25 3/4 + 22) 2 x 3 201	•	1	(8	. +-	· 10 5/8)	2	х		112	
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 1 (9 1/4 + 22)) 2 x 3 188 gyn 1 (22 + 22)) 2 x 3 264 ward 1 (25 3/4 + 22)) 2 x 3 287 1 (11 1/2 + 22)) 2 x 3 201	scrap	1	(8	+	, 11)	2	х	3	114	
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 1 (9 1/4 + 22)) 2 x 3 264 2 (22 + 22)) 2 x 3 264 3 (22 + 22)) 2 x 3 264 4 (25 3/4 + 22) 2 x 3 264		ī	(11 1/2	-†-)		· x			
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 1 (9 1/4 + 22)) 2 x 3 264 20 1 (22 + 22)) 2 x 3 264	ward	ŧ	•	++)		· X		287	
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22)) 2 x 3 180 1 (9 1/4 + 22)) 2 x 3 188 gyn 1 (22 + 22) 2 x 3 264		1	•	+ .)		X		1	
work shop 1 (11 1/4 + 6) 2 x 3 23 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9) 2 x 3 122 store 1 (11 1/4 + 6) 2 x 1/2 17 ramp 2 (57 + 8) 2 x 3 780 1 (30 + 8) 2 x 3 228 1 (14 + 14) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180 1 (9 1/4 + 22) 2 x 3 188	gyn	1	,	4.)					
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168 old building 1 (8 + 22) 2 x 3 180		1	•	-}-)		X			
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228 1 (14 + 14)) 2 x 3 168	old building	1 ·	•	•	_)		· x		-	
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4)) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780 1 (30 + 8)) 2 x 3 228		1	`)					
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17 ramp 2 (57 + 8)) 2 x 3 780		1	•)					
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122 store 1 (11 1/4 + 6)) 2 x 1/2 17	ramp		•			.)					
work shop 1 (11 1/4 + 6)) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231 waiting 1 (11 1/4 + 9)) 2 x 3 122			•),		^			
work shop 1 (11 1/4 + 6) 2 x 1/2 17 Emergency 1 (23 1/4 + 15 1/4) 2 x 3 231	_	-)				•	
work shop 1 ($1.1 \frac{1}{4} + 6$) 2 x $\frac{1}{2}$ 17			` .)	2		•		
	•		`)					,
Crush hall 1 ($29 \frac{1}{2} + 56$) 2 x 3 513	Crush hall	1	(29 1/2		56)	2			513	
$12 (5 + 53/4) 2 \times 3 \qquad 774$)					

3 - Removing door with chowkat

Total:- 25 Nos Nos (a) 448.45 Each

Rs. 362724/-

-A	to .			· .
44	 Removing 	window	22/16/2	abaudiat
	TO BOYING	WILLIAM	willi	CHOWKAL

1	recino i in	, ,	10 44 44	·	wkat														
	••				•	•	٠.				;		. 5	7 Nos					
				_			•			•	Tota	ıl:-	5	_	•			•	•
	•											@	350.45	Each					Rs. 19976/
5	5 Painting t	to win	dows	and do	or 2 co	bats or	ı old	surfa	ice			(5)							183. 17770/
	DI		•	8		x 5					2			~		. •			
	D2			26			, i 1/2	X		,			560		•				
	D3		•	20	•			Х		Χ			-1274						
	· D1 .			24			1/2	.X		X			840			-			
	D2	,					1/2	X					145						
				12			1/2	Х				•	714	ŧ	•				
	D5			. 11		× 5		X		Х			935	5					
	D4			16	>		1/2	. X	7	х			560) ' '					
	D3			10)	3		X	7	Х	2	_	420)					
											Tota	l:-	5448	Sft					
								٠				a	1694.65	%Sft					Rs. 92325/-
6	Painting to	o sesh	es, fan	ı light e	etc 2 c	oats o	n old	surf	ace		•			_					
	W۱			. 16	х	6		· x	5	٠,	. 3		. 1440						
	W2		. •	15	X			X	5		_								•
	W3			35	X	' _			5 .	Х	-		1125						
	. W4			22				X		X	_		1575						
•	CWI		-	18	X			·X	. 6	X .			. 792						•
	CW2				Х			X	5	Х	3		810	•			,		
				5	. X			X	6	Х	3 '		. 180		•				
	OLD W2			41	·X	.*		X	5	X	3		3690		•		•		
	W1			4	X			X	5	X	3		. 420						
	W4			8.	Х			X	5 .	X	3		960		•				
-	GRILL	•		6.	X	8		х	5	x	. 3	:	720		-				•
						1					Total	:	. 11712	Sft					1 '
-											(a)	1030.20	%Sft					Rs. 120657/-
- 7	Dismantlir	ıg bric	k or fl	agged	floori	ng with	hout	conc	rete found	dation	1.							•	1200L1/1-
	ē			1	х			· x.		•			~						
		•		1.	X	145					3		5115	Sft		-			
-				•	λ	143		X	56			_	8120						
	d/d ·			1.5		2					Total	-	13235	Sft					į.
_	u/u	•		15	х	2		·X	2.		(-)		60		•				
		•					•			٠	Net.		13175	Sft					
0								٥			· (6	D)	866.20	%Sft				R	ls. 114122/-
8	Rehandling	g of car	rth wii	th sing	le thro	w of k	Cassi								• '				
				1	. X	110	•	х	46 1/2	x	1/3		1688	Cft					
	•			1	x	145		X',	56	x	1/3		2680	CII					
									50		Total:	_	4368	C.C.					
	· ·							•						Cft				_	
9	Single layer	r of til	es 9"x	4½"x1	11/4" (2	25v11	3-40	} 122.12	Maid ow	·// U/	(<u>(</u>	y 4	2547.60	%0Cft				. 1	Rs. 11128/-
	1" (25 mm) mud	nlasti	er with	nout B	Shoosa 1	JA-10	utad	i) iaiu ove	31 4 (.100 m	ım) 2	cartn and			٠			
•	RCC roof sl	lah or	ovideo	t with	3/1 lbc	nov 0	, gic	,uteu	72 V a/C a	nent	sand I	:5 (on top of						
	blinded.i/c	ane las	er of	a wiiii nolyth	070 nb	. pc: 7	031t.	or i.	./2 Kg/Sq	.m bi	tumen	coa	ting sand						
	· · · · · · · · · · · · · · · · · · ·	· ·	, C. UI	Poryun	,			_	,					,					
				l	· x	110		X	46 1/2				5115	Sft	•			÷.	
				1	х	145	•	X	56				8120						,
									-	Ĩ	l'otal:-		13235	Sft					
	d/d			15	$_{,}\mathbf{X}$	2		X	2		(-) .		60						•
	•			-							Net.		13175	Sft					
											(a)	12	2377.05	%Sft			• •	. De	1630676/-
10	Khuras on ro	oof 2'x	2'x6"	(600 x	600 x	150 n	nm)							70071				173.	10500/0/-
			•			•	ĺ	•	1									•	,
							,						15	Nos		-	•	•	·
•					•	•				-	Net.		15	Nos					• •
, -,				_							(a)	8	866.40	Each				Rs	. 12996/-
11-	Applying we	eather	snield	d co at	a on o	ld surf	ace a	ılter-	scrapin g c	old'ed	loured	wa:	sh					·	,
	-												•						
	out side			1	· x	65		X	26		•		1690		,				
				2	X	155		x	15 1/2				4805	:					
	•	•		$\frac{2}{2}$	X	115		X	15 1/2				3565			•			•
			•	2 2	x	37 ·			15 1/2				1147	•					
	•			2	X	22			15 1/2				682					-	
	•				. •		,						V 7.	•	•				
																	7	^	111

, de	/	" .	•	•	•									•
/			٠.	2.	•	24	x .	15 1/2 .			744			
				2.	X	24 27		15 1/2			837			
				Z	X	21	X .	13 1/2		· · -		Sft		
-	٠.	:	•							Total:-	13470			Rs. 557894
		•								(a)	4141.75	%Sft_	•	188, 55/624
,1	2	P/L watering/ramm	ning bi	rick or	stone	e ballast 1.1	1/2"	to 2" guag	e w	ith 25% s	and mix			
	1	•						* ************************************		` .		. *		
		Eye/spe/wait		4	x	. 11 1/4	х.	15 1/4	х	1/3	229	Cft	`.	
		·.	-	j	х	72	x	8	X	1/3	192			
				4	x	11 1/4	x	2 .	X	1/3	30	•		•
				6	X	5 ·.	х .	5 3/4	X	1/3	57			•
		Crush hall		1	x	29 1/2	x	56	X	1/3	550			
		work shop		1	X	11 1/4	x	6	х	1/3	22	•		•
		Emergency		1	х	23 1/4	x	15 1/4	· x	1/3	118			
	٠.	waiting	-	1	X	11 1/4	X	.9	х	1/3	34	•		,
		store		1	X	11 1/4	\mathbf{x}^{\perp}	6	х	1/3	22		•	•
		ramp .	:	2	X	57	x.	8	х	1/3	304			
		rump .	-	1	X	30	X	8	х	1/3	80			
-				3. 1/7	X	14	X		. X		205			
		old building		1	· X	8	X	22	x	1/3	59			
		ora banang		. 1	л. Х	9 1/4	X	22	x ·	7. 7 3	68			
				1 .	X	22	X	22.	x	1/3	161			
	•	gyn		1		22	X	22.	X	1/3	161			•
		4	_	1	X	25 3/4	X	22	X	1/3	189		•	
		ward	•	1	X	11 1/2		22	X	. 1/3	84			
			•	L ·	. X		·X	11	. X	1/3	. 29	. '	•	
		scrap		ŀ	х.		X	10 5/8		1/3	28	1000		• • • • • • • • • • • • • • • • • • • •
		change	•		X	8	X		X		117	••		
	-	OT		!	X	16	X		Χ.					•
		ward		!	$\cdot \mathbf{X}$	26	Х	22	Х	1/3	190	4.5		
				!	х.	9	X	16	X	1/3	48			
•				1	· x •	9	X	7 1/2	X.		22			•
				ļ	X	, 9	χ ,	. 5	X	1/3	: 15	·		
	1			1	. X	9	Х	5	X	1/3	15			
•		•		1	Χ.	. 9	X	22	X_{\uparrow}	.1/3 .	66			
		labour	_	1	X	16	Х	22	X	1/3	117		٠.	
		,		1 .	X	8 •	X	6	Χ.	1/3	16	,		
•		•	•	1	X	16	Х	8 1/2	X	1/3	45		•	
		pathology		1	X	16 7/8	Х	18 1/2	X	1/3	104	•		•
				1	X	11 -	Х	18 1/2	X		68		•	
		store		.1	x	5 1/2	X	, 6	X	1/3	$f^{(1)} = 11$	•		
		inspector		. 1	X	11 7/8	X	10 1/4	X	1/3	41			
	_			I	X	8 1/2	X	7 1/2	\mathbf{X}		21	÷		
	_	medicine		1 -	x	13 3/4	X	18 1/2	X	1/3	85			
				1	Х	5 1/2	X	5	X	-1/3	9	, .		Ç.
				!	X	21	х	113/4	X	1/3 ·	82	•		
		ward,		1	x	27 1/4	\mathbf{X}^{-1}	8	X	1/3	73			
		DMS		1	X	13 3/4	X	t8·1/4	. X	1/3	. 84			
		Hall		1	х	20	х	28 .	X	1/3	186			
		,		1	X	12	х	18 1/2	Χ.	1/3	74			•
				1	x ·	12	х	18 1/2	Х	.1/3	74			•
				1	x	20	х		· x	1/3	123			
		•		1	x	102	х	8	X	1/3 💸	. 272	•		
				2	X.	72	X	8 .	Х	1/3.	384		4	•
			•	2	Χ.	44	χ.	8	Х		234	'		••
		FF		4	X	11 1/4	X	15 1/4	Х	1/3	229	•		
					: <u>X</u> .	43	X.	8	· x	1/3	- 115			•
		•		1	<u>х</u> х.	8 1/2	x	11 1/4	X	1/3.	32		•	
				1	X.	29 7/8	. X .	35	X	1/3	348			
		•	•	2	X X	11 1/4	X	. 7 1/2	X	1/3	. 56			
				∠ 1:		23 1/4		16	X	1/3	124			
		ward		. 1	X	23 1/4	X	16	· X	1/3	124			•
		Durah.		1 . 7	X		X	<u>.</u> .			70			
		Bath		10	X	5	X		X	- 1/3 1/3	75			
		e.		10	X	4 1/2	X	5 7	X	1/3	. 12	•	· · · · · · · · · · · · · · · · · · ·	•
		• .		i 4	X	5	X		X	1/3	27		•	•
		•		4	х	5	X	. 4	Х	_	6410	Cft	•	
		•	٠							Total:-			•	Rs. 597874
								•		@ _	9327.20	%Cft		ES. 57/6/4
1	3	P/L Plain cement of	oncret	c (1:2:	4) i/c	finishing						,		-
		Eye/spe/wait		. 4	x	11 1/4	x	15 1/4	X	1/8	86	Cft		
		-13 or oper truit		1	x	72	х	8	X	1/8	72		•	-
			•					•,				_	•	

•	4	x	11 1/4	x	2	· x	1/8	. 11	•
	.6	х	5	X	5 3/4	Χ '	1/8	22	
Crush hall	1	х	. 29 1/2	x	56	x	1/8	207	
vork shop	1	x	11 1/4	x	6 .	x	4/8	8	
Emergency	i	X	23 1/4	х	15 1/4	x	1/8	44	
vaiting	1	X	11 1/4	X	9	· X	1/8	13	
	1	X	11 1/4	x .	6	X	- 1/8	8	
tore	2	X	57	x	8	x	1/8	114	
amp	<i>≟</i> 1	X ·	30	X	8	X	1/8	30	
	1 2 1 /7		14	X	14	X	1/8	77	
	3 1/7	X	8		22		1/8	22	
ld building	1.	X		X		Х	1/8	25	
	l	х	9 1/4	X	22	X		61	
yn	1	Х	22	Х	22	X	1/8		
	1	Х	_22	x	22	X	1/8.	61	
vard	~ 1	X	25 3/4	X	22	Х	1/8	71	
79	1	X	11 1/2	X	22 .	Х	1/8	, 32	
crap :	Ī	X	8	X	11	X	1/8	11	
hange '	i	X	8.	X	10 5/8	X	1/8	11	
on G	1 ,	х	16	X	22	x	1/8	44	
vard ·	1	X	26 · `	х	22	X	1/8	72	
	1	X	9	х	.16	х	1/8	18	
•	1	x	9	x	7 1/2	х	1/8	8	
	1	X	9	x	5	x	1/8	6 .	
	. '	x	9	×	5	x	1/8	6	
,	i 1	X	9	X	22	x ·	1/8	25	
,	1		·16	x	22	X	1/8	44	
abour .	1	X	8		6 -	X	1/8	∴ 6	
	1	Х		X	8 1/2		- 1/8	17	•
	1 .	Х	16	Х		X		39	
athology	1	X	- 16,7/8	X	18 1/2	X	1/8		
	1 .	X	11	X	18 1/2	Х	1/8	25	
tore	1	X	5 1/2	х	6	Х	1/8	4	
nspector	1 .	Х	F1 7/8	X	10 1/4	X	1/8	15.	
	1	, x	8 1/2	X	7 1/2	X	1/8	8	•
nedicine	4	χ.	13 3/4	X	18 1/2	X	1/8	32	
• • • • • • • • • • • • • • • • • • • •	1.	x	5 1/2	Х	5	X	1/8	. 3	
	1	х	21	x	11 3/4	X	1/8	31	
vard	. 1	x	27 1/4	х	8 -	. x	1/8	27	,
DMS .	1	x	13 3/4	х	18 1/4	X	1/8	31-	
Iall	1	X	20	x	28	х	1/8 -	70	
iaii	i	X	12	x	18 1/2		1/8	· 28	
	1		12	X	18 1/2	X	1/8	28	
*	1	X			18 1/2	x	178	46	
	 	X	· 20	X	8		1/8	102	
•	1.	X	102	X		X		ો44	
	, 2	Х	72	Х	8	X	1/8 ′		
	2	X	44	х	8	X	1/8	88	
'F	4	\mathbf{x}	11 1/4	X	15 1/4	. X	:1/8	86	•
•	1	х	43	X	-8	Х	1/8	43	
-	. 1	· x	8 1/2	X	11 1/4	Х	1/8	12	
	1	x	29 7/8	. X	35	X	1/8	131	
	2	х	11 1/4	Х	7 1/2	, x	- 1/8	21	
vard ,	1 ;	х	23 1/4	х	16.	\mathbf{x}^{\cdot}	. 1/8	· 47	
	1	· X	23 1/4	X	16	X	• 1/8	47	
Potla	7	X	5	x	6	· X	1/8	26	
Bath	10		4 1/2	X	5	x	1/8	28	
		X.			7	X	1/8	4	
•	i	X	5	X	4		1/8	10	•
,	4	Х	5	X	. 4	Х	_	2408	Ci
					•		Total:-	38271.80	%C
	•						(a)	4×771XII	7/0[

Rs. 921585/-

Providing and laying superb quality Porcelain glazed tiles of Master brand, skirting dado of specified size, Color and Shade with adhesive/ bond over 1/2"thick (1:2) cement plaster i/c the cost of and scaler for finishing the joints, cutting grinding complete in all respect as approved and directed by the Engineer Incharge. (ii) 600mm x600 mm Size Floors

- 600inm xooo i	nm size fi	10015					
Eyc/spe/wait	•	4	x	11 1/4	X	15 1/4	· 686
Liy Grapo, wait		1	х	72	Х	8	576
		4	x	11 1/4	X	2	90
		6	x	5	х	5 3/4	173
Crush hall		1	X	29 1/2	х	56	1652
work shop		1	X	11 1/4	Х	6	68
Emergency		ľ	X	23 1/4	· x	15 1/4	355

Cft

								341.95
	4	^	J	<i>'</i> -	•		Total:-	19251
	4	X	5 ·	ÿ	4			80
	i,u	· X	5	X	7		4	. 35
Bath	, 10	· X.	3 4 1/2	X	5			225
45 A1	t 7	X	5	. X	6			210
ward.	I 1	- X - X	23 1/4	X	16			372
	. 1	χ̈́	23 1/4	· x	16			372
	· 1	X X	11 1/4	χ̈́	7.1/2			169
*.,	, i	X	29 7/8	X	35	_		1046
	′ l	X	43 8,1/2	X	11 1/4		•	96
FF-	. 1	X	43	X	8.			344
	2	X	44 11 1/4	X X	15 1/4			686
	2	Х	72	X	8			704
	1	X	102	, X	- 8 e			1152
	1	Х	20 .	X				816
	1	Х		X	18 1/2			370
•		Х	12 12	X	18 1/2		·	222
Hall	<u>.</u> .	. X.			18 1/2			222
DMS		X	13 3/4 20 °	- X X	28	٥		560
ward	. !	X	27 1/4	X	8 18 1/4			251
•	1	· X	21	X	8			218
	1	X	5 1/2	X	3 11 3/4			247
nedicine		X	13 3/4	X	5			, 28
	1	X	8 1/2	X	18 1/2			254
nspector	· , [X	11.7/8	, X	7 1/2			64
tore .	l •	X			0 . 10 1/4			122
	. !	x ·	5.1/2	X X	6.		•	33
athology	l •	X .	- 10 7/8 - 11.	X.	18 1/2			204
	l 1	X	16 7/8	X	18 1/2			312
	1	X	8 16	X X	8 1/2			136
ibour	٥ [X	8	X X	6			48
	l 1	X	i6 ·	X X	22	•		352
•	i 1	X	9	X	22			198
	. 1		9 .	X	5			45 .
-	, l	x x	9	X	5		•	.45
	, , <u>I</u> ,	X	9	· X	7 1/2			68
vard ·	' [•	X	20 9	X	16			. 144
OT .	1	X	26	X	22			572
hange	. j	X	16	X	22.			352
crap	l	X	8	X ·	10 5/8			85
• •	1 .	X	11 1/2 8	x x	11 .		•	88
ard .	l '	Χ.	25 3/4	, X	22			253
	. 1.	X	22 ·	X	22	•		567
yn 💉 🐪 🖠	. 1	Х	22 -	X	22 22			484
	1	X	9 1/4	X	²² .			484
ld building	.1	х	8 .	X	22 -		•	204
	3 1/7	X	14 .	Х	14			176
•	ı	X	30	X				615
	1							
mp	2	Х	57	Х	8			912 240

Rs. 6582879/

Providing and laying superb quality Porcelain glazed tiles of Master brand, skirting/dado of specified size, Color and Shade with adhesive/bond over 1/2"thick (1:2) cement plaster i/c the cost of and scaler for finishing the joints, cutting grinding complete in all respect as approved and directed by the Engineer Incharge. (ii) 600mm x600 mm Size Dado/Skirting

Eye/spe	. 4	(11 1/4	- -	15 1/4) .	2 .	X	6	1272
13ye/spc	1	(72 .	-1-	8)	2	X	6	960
	4	(11 1/4	-1-	. 2).	2	x	6	636
', R	12	(5*	-1-	5 3/4	`)	2.	X	6	1548
Crush hall	1	(29 1/2	1.	56)	2	х	·6	1026
work shop	1	(11 1/4	į.	6)	2	х	1/2	- 17
Emergency	i	(23 1/4	ł	15 1/4)	2	х	6	462
waiting	1 .	(11 1/4	-1-	. •9)	2	х	6	243
	1	(11 1/4	-1	6)	2	χ.	6	207
store	2	(57	-1-	8	ή.	2.	.x	6	1560
ramp -	1	(30		8)	2	. x	6	456
	ı	, 50		-	,				

ward Bath	1 2 1 1 14 10 1 4		8 1/2 29 7/8 11 1/4 23 1/4 23 1/4 5 4 1/2 5 5	+ + + + + + + + + + + + + + + + + + + +	11 1/4 35 7 1/2 16 16 6 5 7)	2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	x x x x x x x x x	6 6 6 6 7 7 7 7 Total:-	237 779 450 471 471 2156 1330 168 504 30434 341.95	Sft P.Sft
	1 1 14 10	((((((((((((((((((((29 7/8 11 1/4 23 1/4 23 1/4 5 4 1/2 5	-1- -1- -1 -1- -1- -1- -1-	35 7 1/2 16 16 6 5 7))))))))))))))))))))	2 2 2 2 2 2 2 2 2 2 2	x x x x x x x	6 6 6 7 7 7	779 450 471 471 2156 1330 168 504	
	1 1 14 10	((((((((((((((((((((29 7/8 11 1/4 23 1/4 23 1/4 5 4 1/2 5	-1- -1- -1 -1- -1- -1- -1-	35 7 1/2 16 16 6 5 7)))))))	2 2 2 2 2 2 2 2 2 2 2	x x x x x x x	6 6 6 7 7	779 450 471 471 2156 1330 168	
	1 1 14 10	((((((((((((((((((((29 7/8 11 1/4 23 1/4 23 1/4 5 4 1/2	-1· +- -1·. -1· -1· +-	35 7 1/2 ·16 16 6 5)	2 2 2 2 2 2 2	x x x x x x	6 6 6 7 7	779 450 471 471 2156 1330	
	1 1 14	((((((((((((((((((((29 7/8 11 1/4 23 1/4 23 1/4 5	-1- -+- -+- -4- -+-	35 7 1/2 ·16 16 6)	2 2 2 2 2 2	x x x x x	6 6 6 7	779 450 471 471 2156	
	1 1 .	((()	29 7/8 11 1/4 23 1/4 23 1/4	-1- -+- -1 -4-	35 7 1/2 ·16 16)	2 2 2 . 2	x x x x	6 6 6	779 450 471 471	
ward	1 2 1	(((29 7/8 11 1/4 23 1/4	-1- -1- -1	35 7 1/2 ·16)))	2 2 2	x x x	6 6 6	779 450 471	
	1 1 2	(29 7/8 11 1/4	-1· -+-	35 7 1/2)	2 2	x x	6	779 450	
	1 .	(29 7/8	-1-	35)	2	х	6 .	779	
	1	()					
	1	,			111/4					~~~	
	I	(43	-+-	8)	2	х	6	612	
r t	`4 .	. (11 1/4	-+-	15 1/4·)	2	X	6	1272	
FF	2	(•)	2	X	6 :	1248	
	_	/ <u>(</u>	44	-1-	.8)		X			
	2	, · 7	72	- -	8	.)	$\frac{2}{2}$		6	1920	
	1	(102	, -1-	8)(2	X	6	1320	
		(20	-]-	18 1/2)	2	X	6	. 462	
• .	1	ĺ	12	+	18 1/2)	$\frac{1}{2}$	X	6	366	~
	1	. (12	-+-	18 1/2	,) .	2	x	6	. 366	
Hall	1	Ì	20	4.	28)	2	. X	6	576	
DMS	1	Ì	13 3/4	4	18 1/4)	2	х	, 1/2	32	
ward	1	(27 1/4	4.	8)	2	x	6	423	
	1	(21	+	11 3/4)	2	· X	6	. 393	_
	1.	(5 1/2		5	.·)	2	· X	6	126	
medicine	1	, (13 3/4		18 1/2)	2	X	6.	387	
	1	. (8 1/2		7 1/2)	. 2	X	1/2	16	
inspector	1	. (11.7/8	-	10 1/4)	2	X	1/2	. 22	1
store	1	(5 1/2	ļ.	6)	. 2	X	1/2	12	
	ı	(11	+	18 1/2.)	2	. X	6	354	•
pathology	1-	(16 7/8	-1-	18 1/2	.)	2	х	6	425	-
.1 1	. !	(16	-[-	8 i/2)	2	х	6	294	
•	1	(-+-)	2	Х	6	168	-
140001	!	(8		6)		X			•
labour	1	\ ((16	- -	22)	2		6	31 456	
	1	. (9	₋ -	· 22)	2	x x	1/2		
1	1	(9	- -	5	,	² / ₂ .	X	1/2	14	
200	1.	(9	47	5 .)		, X	1/2	17	•
	1	(9	. •	7 1/2). }	2		1/2	-17	
ward	1	(9	· +	16	<i>)</i>	2 3	x X	1/2	25	
ward	→ ¦ .	(26	- ·	22		- 2 .	X	6	576	
change	1	. (8	'-	10 5/8)	. 2	X	6	224	•
scrap	1	(8	- -	11 -	, \	2	· x	6	228	
vraiu.	1	(11 1/2		22) \	2.	X	6	402	5
ward .	1	7	25 3/4		22)	2	X		573.	
5)		(22	-	22	,)	2	· x	6	528	
gyn		(22	-1-	22	,	2	χ̈́		528	
ord building	1	(9 1/4		22) }	$\frac{1}{2}$.	X		. 375	
old building	j	(8	- -	22)	2 .	X	6	· 360	
•	1	. (14	- -	14	}	. 2	· x	6	336	•

Rs. 10406906/-

16 Providing and fixing all types of partly fixed and partly openable glazed anodised/ powder coated aluminium doors, using delux section of M/s Al-Cop or Pakistan sections thickness is 2 mm. Cables, having chowkat frame of size 40 x 100 mm (11/2" x 4") and leaf frame of 60x40mm ($2\frac{1}{2}$ "x $1\frac{1}{2}$ ") wide sections including the cost of $\frac{1}{4}$ " (5 mm) thick imported tinted sections are of dull aluminimum glass with aluminium triangular gola and rubber gasket to shade, support the glass and leaf edging, using approved standard fittings, locks, 3" (75 mm) wide long handles etc., and hardware any required as approved by the local glass is used. engineer incharge.

DI	• ,		i	·x	8 1/2	x	8 1/2	. •	72	
D2			12	X	₂ 3 1/2.	x	. 8 1/2		357	•
D5 .			12	x	. 5	x	8 1/2		510	•
	-			•				Total:-	939	Sft
				-	•			(a)	1441.20	P.Sft

17	Providing and fitting all types of glazed aluminium windows of anodised/ powder
	coated partly fixed and partly sliding using delux sections of approved manufacturer
	section thickness is 1.2 mm. having frame size of 100 x 30 mm (4"x1-1/4") and leaf
	frame sections of 50 x 20 mm (2"x¾"), all of 1.6mm thickness including 5 mm thick
	imported tinted glass with sections are of dull aluminium rubber gasket using
	approved standard latches, hardware

shade, etc., as approved by the Engineer in-charge.

								(2)	125275	D
	•							Total:-	1425	S
CW	•	 22	X	4	-	X.	5	_	440	
W4		6	х.	8		X	`5	:	240	
W2		25	X	5		Х	5.		625	
WI		4	x	6	•	X	· 5		120	

Rs. 1929094/-

Providing and fixing Aluminum Fly screen comprising of Fiber/ Aluminum wire guaze (Malasian) fixed in aluminum frame of approved manufacturer / powder coated of size1.1/2"x1/2" and 1.6 mm thick with rubber gasket i/c cost of Hard wares as approved and directed by the engineer incharge, complete in all respect.

Take 1/2 Quantity of above

	713_	
Total:-	. 713	Sft
(a)	494.50	P.Sft

Rs. 352579/-

Providing and fixing M.S. grill fabricated with MS Square polished Vertical/horizontal Bars of specified size @ 4" c/c' passed through punched holes in MS Patti of 1-1/4"x1/8" i/c the cost of 1-1/4"x1/8" MS patti for Frame of windows and painting 3 coat complete in all respect as approved and directed by the Engineer Incharge. (i) 3/8" Squar Bars

Take Quantity of item no 10

	1425	
Total:-	1425	Sft
(a)	863.55	P.Sft

Rs. 1230559/-

20 P/F Stainless steel edge protector

	420	Kπ
Net.	420	Rft
(a)	700.00 600	P.Rft
-		• ,

21 P/F vinyle door with chowkhat

Rs. 458150/-

22 Providing and laying superb quality Porcelain glazed tiles of Master brand, skirting/dado of specified size, Color and Shade with adhesive/bond over 1/2"thick (1:2) cement plaster i/c the cost of and sealer for finishing the joints, cutting grinding complete in all respect as approved and directed by the Engineer Incharge. (Non-Skid Chegured Tiles) 300mmx300mm

O(4) D(4) V (10) V (10) V (10) V (10)	Old Dide	ے ا	¢ 24		480 200	
Old Bldg 1 x 20 x 10 200	Old Bldg	Ī			200	

Rs. 187440/-

Providing and fixing 2'-9" high stair railing comprising of non magnetic (304) Stain less steel 2" dia pipe railing of 18 SWG welded with vertical posts of 2" dia stainless steel round/ Squar pipe/ Tong (chimta) @ 2-ft c/c fixed on alternate steps with 3" long steel screws and brass rawal plugs, 3-Nos diagonal stainless steel pipes of 1/2" dia passes through goties fixed on vertical post, i/c stainles steel welding, fixing & polishing complete in all respects as approved and directed by the Engineer Incharge.

Rump 1 x 25 25 Rft 2 x 24

Rs. 220266/-

Rs. 272636/-

Rs. 642551/-

	Old Bldg	ı	x	20		· •	793	20	
.'	•			-			Total:-	93 2368.45	Rft P.Rf
24	Providing and laying Pre width of approved qualit mortor bed, complete in Incharge.3/4" thick	y laid y	with a	adhesive b	ond o	over 3/4" th	ick (1:2) cer	nent sand	٠
•	Shelfs .	1 .	х		X	4		88	Sft
		,2	X	15	. х	4 .	T-4-1.	120	C.C.
,	. :						Total:-	208 1310.75	Sft P.Sf
25	Providing and fixing 24" MDF board (Medium de comprising of 3/4" thick duly hot pressed on all ed the cost of self closing be Drawers & locking arran Engineer Incharge	nsity F lamina dges of ox type	iber to ted Market the second the	ooard) Shoot IDI* sheet shutters/ p es ,handle	eet bo i/c th anels es, scr	th side glaze e cost of 1 r drawers et ews, Glue a	ted shutters a mm thick PV te., with mac and rawal plo	and box C tape hine i/c	
	Cabinet	1	X	22	X	2 1/2	•	. 55	Sft
		2	X	15	Х	2 1/2	•	. 75	
		4	Х	8	Х	12	Total:-	384 514	Sft
	•			5			10tal;-	1250.10	P.Sf
26	Preparing surface and pa	inting s	with o	emulsion	naint	two coats		1200110	*
,	•				•			, (0)	
	Eye/spe/wait	4	X X	11 1/4 · 72		• 15 1/4 • 8		686 576	· Cft
		4	X X	11 1/4	X X	0 - 2		90	
		6.	X	5	X.	5 3/4		. 1.73	
	Crush hall	1	X	29 1/2	x	56	·	1652	
	work shop	1	x	11 1/4	X	6		68	
	Emergency	1 .	Х	23 1/4	X	15 1/4*	-	355	
	waiting	1	x	11 1/4	X	9		101	
	store	1	X	.11 1/4	. X	6	-	. 68	
	ramp	2	X	57 30	. X	8 8	·	· 912 240	
	1	3 1/7	X X	30 14	X X	o 14	•	615	•
-	old building	1	-X -YX	. 8	X	22 .		176	
	·	1.	x	9 1/4	x	22	-	204	
	gyn	1	. X	22	· x .	22		484	
	•	1	· x	22	x	22		484	
	ward	1 .	x	25 3/4	X	. 22		567	
		.1	X	11 1/2	X	22		253	
-	scrap	1 .	Х	8	X	11		. 88	•
	change	1	Х	8	Х	10 5/8		85 353	•
	OT.	1	X	16 26	Χ.	22 22		352 572	
	ward	1 .	X X	9	X X	16	,	'144	
		i .	x	ý .	. X	7 1/2	•	68	
	4	1	x	9 .	X	5 -		. 45	
		1	x	9	X	5 .		45	
		1	· x	9	X	22	•	198	
	labour	1	X	16	X	22	•	352	
		1	Х	8	X	6		48	v.
	4. 1]	Х	16	X	8 1/2		136	
	pathology	1	X X	16 7/8 11	X X	18 1/2 18 1/2		312 204	
	store	1	X X	5 1/2	X X	6		. 33	
	inspector "	i	X	11 7/8	X	10 1/4		. 122	
		1	x	8 1/2	X	7 1/2		64	•
	medicine	1	X	13 3/4	x	18.1/2		254	
		1	х	5 1/2	x	5		28	
		İ	X.	21	X	11 3/4		· 247	
	ward	1	x	. 27 1/4	x	8		218	
	DMS	1	х	13 3/4	Х.	18 1/4	÷	251.	
	Hāll	1	X	20	\mathbf{X}^{-1}	28 -		560	
		_	. X	12	х	18 1/2		222	

,	1 · x	12	х	18 1/2	•	222
	1 x	20.	X	18 1/2		370
•	1 x	102	x	8		816 -
	2 x	72	x	8		1152
	2 x	44	X	8	•	704
FF	4 x	11 1/4	X	15 1/4		686
	l x	43	X	8		344
	1 . x	8 1/2	х	11 1/4		96
•	1 x	29 7/8	x	35		1046
	ż x	11 1/4	x	7 1/2		169
ward	· 1 x	23 1/4	\mathbf{x}	16.		372
•	1 · x	23 1/4	x	16		372
Bath	7 x	5 '	Х	6		210
, ,	10 x	4,1/2	X	5		. 225
,	. 1 x	5	х '	7		35
•	4 x	5	X	4 .	/0	80
Eye/spe 4	(II 1/4 H	15 1/4)	2	x 5 1/2	1166
• 1	(72 ·-	8)	2	x 5 1/2	880
4 .	(11 1/4 -1	2 -)	2	x 5 1/2	583
12	(5 4	5 3/4	-)	2 .	x 5 1/2	1419
Crush hall 1	(29 1/2 +	- 56)	2	x 5 1/2	941 ⁻
work shop 1	(11 1/4 t	6)	2	x 11 1/2	397
Emergency 1	(23 1/4 +	15 1/4)	2	x 5 1/2	424
waiting 1	(11 1/4 +	.9)	2	x 5 1/2	223
store 1	(11 1/4 +	6)	2	x 5 1/2	190
ramp 2	(57 +	8)	. 2	x 5 1/2	1430
	(30 +	8 -)	.2	x 5 1/2	418
1	(14 +-	14)	2	x 5 1/2	. 308
old building [(8 .+	22)	2	x 5 1/2	330
olg ballanig 1	(3, 91/4)	22	•)	2 \	x 5 1/2	344
0.00		22.)	2	x 5 1/2	484
gyn l	(22 - 1	22)	2	x 5 1/2	484
. 1	(25 3/4 +	22	,	2 .	x 5 1/2	525
ward [`	•)	2		369
. ! ·	(11 1/2 +	22)	2 -		209
scrap I	(8 !	11)			205
change 1	.(8 +	10 5/8)	2 .	x 5 1/2	418
OT · 1	(16 . +	22)	2	x 5 1/2 x 5 1/2	528
ward 1	(26 +	22)	·2 :		575
, 1	(9, +	16).	2		380
1.	. (9 -1	7 1/2)	2		380
1 '	(9 +	-5)	2 .		.322
, I	(9	5)	2	x 11 1/2	713
. 1	(9	22.)	.2	x 11 1/2	418
labour	(16 +	22)	2	x 5 1/2	154
. 1	(8 4.	6)	2	x 5 1/2	
1 .	(* 16 +	8 1/2)	2 .	x 5 1/2	270 389
pathology 1	(16.7/8 +	18 1/2)	2 2	x 5 1/2	325
1	(11 +	18 1/2)		x 5 1/2	265
store 1	(5 1/2 +	6 .)	2	x 11 1/2	203 509
inspector 1	(11.7/8 .)	10 1/4)	2	x 11 1/2	
1	(, 8 1/2 +	7 1/2)	2	x 11 1/2	368
medicine 1	· (13 3/4 I·	18 1/2)	2	x 5 1/2/	355
i, i i	(51/2 +	5)	2	x 5 1/2	1.16
· . 1	(21 +	11 3/4)	2 .	x 5 1/2	360
ward I	_ (27 1/4 +	. 8: -)	2	x 5 1/2	388
DMS 1	· (13 3/4 · ··	18,1/4)	2 .	x 11 1/2	736
Hall I	(20 F	28)	2	x 5 1/2	528
• 1	(12 - +	18 1/2)	2	x 5 1/2	336
1	+ (12 +	18 1/2)	2	x 5 1/2	336
1	(√20 -1-	. 18 1/2	•)	2	x 5 1/2	424
. • 1	(102	8)	2	x 5 1/2	1210
2	(72 +	8)	2	x 5 1/2	1760
. 2	(44 =	8 .)	2	x 5 1/2	1144
FF , 4	(11 1/4 +	15.1/4	.)	2	x 5 1/2	1166
1	(43 1	.8	.)	2	x 5 1/2	561
1	(8 1/2 +	. 11 1/4)	2	x 5 1/2	217

Page 125

	- 1					•			•				•	· · · · · · · · · · · · · · · · · · ·
		1	(29 7/	′8 ⊦	35	·)	2	х	5 1/2	714		·		
		2	(11 1/		7 1/2	.)	. 2	X	5 1/2	. 413				•
.	word	1	(23 1/		16)	2	x	5 1/2	432				
	ward	1	(23 1/		16)	. 2	· x	5 1/2	432		•		
	Bath	14 -	(5		6))	2	X	4 1/2	1386				
	Datti	10	(4 1/2		5 5)	2 ·		4.1/2	855				
		10	•	∠ ⊤ 		<i>) .</i>	2.	X X	4 1/2	108				
		l 	(5		7. 4	,)	.2	X	4 1/2	324			•	
		. 4	(5	1:	4	`)	, 4	. ^	Total:-	50837				
	•									,				
	Deduction	١.			_		_			200		•		
	D1 .		8	. X	5	Х	7 .		•	280			•	
	D2		26	. X	3 1/2	Х	. 7			637				
	.D3		24	Х	2 1/2	Х	.7		•	420			-	
	D1	•	<u> </u>	X	8 1/2	Х	8 1/2			72			:	
	D2		12	X	3 1/2	X	8 1/2			357				
	D5		11	Х	5	Х	8 1/2			468				
	D4	•	16	Х	2 1/2	, X	7			280				•
	D3		10	Х	3	X	7			210				•
	W١		16	X.	6	x	5.	•		480				•
	W2 .		15	χ ·	5	X	5			. 375				
	W3	3	35	. Х.	3	x	5			525				
	W4		22	Х	2	X	6			. 264	•			
	CW1		· 18	х	.3	X	5			270				
	CW2		5	Х	2	· Χ	6			60		•		
•	OLD W2		41	Х	6	X	5			1230				
	W1		4	X	7	X	5		٥	140	•			
5	W4		. 8	х	8	X	5			320			į.	
	GRILL		6	X	8	X	5		- -	240			•	•
D/I	O door & W	indows 15%	% of abov	/e					Total:-	6628	,			
•									Net	44209	Sft			<u></u>
									. @	2065.65	%Sft		•	Rs. 913203/-
27	Anti-Micro									•				•
,	Installation	of X-ray/	C'l Scan	Room	(Consist	ing of	lead			•				
	Sheet 1.6m	m fix, Lead	d Sheet P	asted o	on Lassai	ni and	-		•	•				
	front finish	of SPM A	nti Bacte	rial sh	ect mplet	le		•					•	
	x-Ray	1	(12	-+-	14) .	2	x	1.1	572				95000
			•				•		Total:-	572	Sft			858000
									. @	-1600:00-	P.Sft			Rs. 915200/-
28	Anti-Micro	bial Walls								15000	•			•
	Option I													,
•	Anti-Micro	bial Wall (Cladding	with B	Built In (S	lilver I	on		,					
	Technology	y)			. ,									
	Kills Bacte	ria 24/7.	:											
	Size: 9.2 fe	et height x	4fect wid	dth .	•							•		
	Thickness:	2mm		*							-			
	Thermofor	med round	corners f	or ease	of main	tenand	ee	•					-	
	good chem	ical resistar	nt propert	ties, fe	wer joint	s.					•			
	Proven Ant	i-Microbia	l Techno	logy w	ith certif	ication	าร							
	Killing MR	SA, E-Col	i, Salmon	iella up	to 99.99	9%.								•
	Accredited	by: ECHA	, FDA, E	PA, H	ACCP &	is BD	R	٠.				•		
	Compliant										, .		ě	•
	Anti-Micro	bial Wall C	Cladding	Pasted	with Λd	hesive	on							,
	Frame of G	ypsum boa	rd and G	J.							•			
	(UK)		•			-					-			
		•	-											
	OT	1	(16	·I	20)	2		12	864	g/a	•	•	14956m
		· • •	•			•	•		Total:-	864	Sft			1 22000
,									@	1 795.00	P.Sft	•		Rs . 1550880 /-
										1650	٠.	٠		
•														

$\sim \sim$		/ 1	n.	171	•
2.0	<i>2</i> L	1 1/21	· FI Or	1.16	oring
~	-r	\sim			<i>八</i>

Option 1

Ambiance Ultra

Anti-Bacterial

Anti-Static

High performance homogeneous flooring suitable for heavy duty traffic

T Group : > best abrasion resistance

TVOC after 28 days indoor air quality

Exclusive and patented Evercare surface treatment Resistant to main chemical products used in healthcare. ((With Complete floor installation with coving, heat

welding))

Total Thickness: 2mm

Roll Size: 66 x 6.6 = 430sqft

OT

x .16

c 22.

352 Sft
Total:- 352 Sft

420.00

(a)

P.Sft

Rs. 147840/-

30 P/F dapa made false ceiling

OT

. 1

x 16

22

Total:- 352 Sft Sft Sft 430.00 P.Sft

Rs. 151360/-

Total:-

32198014

Say.

Sy = 32198+00/

Executive Engineer Building Division SARGODHA

A-Me

Sub Divisional Officer, Buildings Sub Division,

Kotmomin

ROUGH COST ESTIMATE FOR THE WORK " REVAMPING OF THO HOSPITAL KOTMOMIN DISTRICT SARGODHA

(MAIN BUILDING)

·				
		Portion		
i	S/E PVC pipe for wiring purpos recessed in walls complete item.	se		
a		•		
u	I" dia.		-	
		10500 10500 Rft	•	
				•
ь	2" dia.	@ 96.85	P.Rft _.	Rs. 1016925.00
		500		
¥ .		500 Rft	* * · · · ·	•
		@ 186.05	P.Rft	Rs. 93025.00
	4" dia.		,	103. 75025.00
		400	,	,
. •		400 RA	•	
		@ 293.75	P.RA	Rs. 117500.00
2	S/E PVC insulated copper conductor			1103. 117500.00
•	cable in pre-laid PVC pipe single			
•	core. (3/0.029")		•	
	•	25000 Rft		•
		25000 Rft		
ь	5 10.0504	@ 26.10	P.Rft	Rs. 652500.00
U	7/0.029" single core.			
	•	15000 Rft		
•	•	15000 Rft		
C	7/0.0448 -: 1	. @ 41.15	P.Rft	Rs. 617250.00
	7/0.044" single core. For AC			
	TOTAC	8850 Rft		
	•	8850 RA		
d	7/0.064" single core.	@ 75.60	P.Rft	Rs. 669060.00
_	For Sub Panel To Main Panell	4000 RA	•	
÷	Tanen To Main Failer	4000 Rft	•	
	• • • • • • • • • • • • • • • • • • • •	@ 176.15	P.Rû	D 704600 00
6	S/E of power plug 10/32 Amp combined	(6) 170.15	racit	Rs. 704600.00
•	Hi-Life			
		100 Nos.		
•		100 Nos.	•	
7	000 6 00	@ 757.80 ·	Each	Rs. 75780.00
	S/E of ceiling rose bakelite.	• •		
•	<u> </u>	250 Nos.		
		250 Nos.		
•	S/E of button holder bakelite.	@ 67.55	Each _.	Rs. 16888.00
	3/13 Of button holder bakelife.	200	•	• •
		200 Nos.		•
		200 Nos.		
	S/E PVC doble layer swith kit i/c cost of	@ 54.55	Each	Rs. 10910.00
` -	switch, dimar, socket etc made of	•		
	hilife/push			
	3 gangc	50 Nos.		
,		• 50 Nos.	•,	
		@ 745.80	Each	Rs. 37290.00
• •	4 gange			
4	· ·	20 Nos.	•	
		20 Nos.		Page 131
	•			

					. ,		(27)
		.(<u>a</u> 8	305.80	Each	-	Rs. 16116.00 ²
d	6 gange				•		
	•	8	30-1	Nos.	•		•
y W.	· · · · · · · · · · · · · · · · · · ·	8	<u>30</u> 1	Nos.	•	•	,
		. (<u>a</u> 1	1165.80	Each	-	Rs. 93264.00
10	S/O 56" sweep ceiling fans complete			• .			
	item.	4	10 1	Nos.			*
• •	-			Nos:			•
			@ ?	7500.00	Each		Rs . 300000.00
11	Errection of ceiling fans i/c carriage complete item.	,	. 6	6500	•	-	260000/
		. 5	50 1	Nos.			· · · · · · · · · · · · · · · · · · ·
,		. 5	5 0 1	Nos.		•	
•		(@ 4	169.65-	Each		Rs. 23483.00
12	S/E of exhaust fan 12" dia plastic body complete as approved by the Engineer		٠.			.:	• .
	incharge.			Nos.			S
		. 1	12]	Nos.	•		
· · · · · · · · · · · · · · · · · · ·		(@ 3	3134.75	Each		Rs. 37617.00
13	S/E of exhaust fan 18" dia steel body complete as approved by the Engineer		,				· .
	incharge.		9 1	Nos.			
	-			Nos.			
		7		1454.75	Each	,*.	Rs. 40093.00

Executive Engineer
Building Division
SARGODHA

Sub Divisional Officer, Buildings Sub Division,

Total:-

Rs. 4522301.00

9 = 448230/

Kotmomin

S.I. Portion P/F glazed earthen ware WC squatter type combined with foot rest I/c P trap (coloured). 15 Nos. 15 Nos. @2764.00 Each Rs. 41460.00 P/F low dówn flushing cistern 3 2475 gallons capacity plastic(colour). 15 Nos. 15 Nos. @ 2666.60 Rs. 39999.00 Each Providing and fitting one piece Europeon Coupled set of Water Closet (WC) and flushing Cistern of PORTA brand (fullsize) i/c the cost of CP/rubber connection, thimble, normal seat cover and rawal bolts complete in all respects as approved and directed by the Engineer Incharge. 5 Nos. 5 Nos. @ 20022.90 Each -Rs. 100115.00 P/F glazed earthen ware WHB 22"x16" complete item (white-with padestal). 15 Nos. 15 Nos. @ 5187.45 Each Rs. 77812.00 glazed earthen ware complete item (24"x18"). 4. Nos. 4 Nos. @ 3196.35 Rs. 12785.00 Each P/F gully trap complete item. 35 Nos. 35 Nos. @ 1129.40 Each, Rs. 39529.00 P/F CP Toilet Paper holder. 0 Nos. 0 Nos. Each Rs. 0.00 529.25 Providing and fixing Bathroom Accessories (7-piece set) Master brand - One Cosmetic Shelf, One Towel rod with bracket, One soap dish, One double hook, One towel ring, brush holder, toilet paper holder & looking glass i/c the cost of hardwares etc complete in all respect as approved and directed by the Engineer incharge, as per MRS

20 Nos. 20 Nos. @ 7600.00 P/F CP bib cock 1/2" dia.

120 Nos. 120 Nos.

@ 777.20

Each

Each

Each

Rs. 93264.00

Rs. 152000.00

P/F CP T stop cock 1/2" dia.

10.

250 Nos.

250 Nos. @ 957.20

Rs. 239300.00 Page 135

Executive Engineer
Building Division
#SARGODHA

Sub Divisional Officer,
Buildings Sub Division,
Kotmomin



1 Supply, installation, testing, commissioning of 200A with Incoming From , Indication Lamp. Insturement Protection Fuse, including 200A Main copper bus bar Suitable For Each Phase/Netural & link as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAK.AREVA.PEL etc. or equivalent make, of 16 SWG miled steel sheet fabricated, Indoor Type, Floor Mounting, Insulation class 600VAC. Incoming/Outgoing connection Top or Bottom as per site requirement, door to body Earth with flexibile copper cable, system voltage 415VAC, 5011Z, 3-Phase 4-Wire, degreased and derusted, zinc phosphated, finished with electro-static powder coating of 80-100 microt thickness in approved colour with hinged door, tockable handle, all live part coverd with safty sheet, internal control & power wring from protection & power, including cost of all necessary materials complete in all respects. All above ACB/MCCBs/MCBs. Make in Terasaki Japan/Schneider Eu.shall be installed inside the panel having a further M.S. protective sheet and accessible only by opening the front door. All MCCBs shall be rated at 50°C, and shall be of one make only and not to be mixture. Panel (36"x48"x12") Size Incoming 1 200A TP MCCB 25KA Terasaki/Schneider 1 200A TP MCCB 25KA Terasaki/Schneider 2 Digital Volt Meter 0-600V Eintes/Schneider 3 Volt Selector Switch GGT/Camsco 10 No. 5 Ampere Selector Switch GGT/Camsco 10 No. 1 Digital Ampere Meter 0-600A Fice/Metels 3 Nos. 7 Phase Indication Lamps, (R+Y+B) Schneider/Ilimel 30 Nos. 1 OUTGOING 1 60A TP MCCB 25KA Terasaki/Schneider 1 30A TP MCCB 25KA			T.H.Q HOSPITAL Provision/Installation of I						
Lamp. Instrumental Protection Fuse, including 200A Main copper bus has Suitable For Bach PheseNeutral & Init & as per above outgoing circuit braker, installed in cubelasts assembled with SHMINS, PEMPAKAREVA.PI3. de. or equivalent make. of 16 SWG midd select short districted. Indoor Type, Pion Mounting, Installation class 600VAC. Incoming/Outgoing connection Top or Bottom as per site coquirument, door to body Barth with Resibile copper cable, system voltage 415VAC, 2011V, 3-Phase 4-Wire, degreemed and devised, zince phosphated. Initiated with electro-static powder coating of 80-100 micron thickness in approved colour with hinged door, lockable handle, fall five part coverd with safty sheet, internal control & power wiring from protection & power. Including cost of all necessary materials complete in all respects. All above ACB/MCCB/MCB. Make in Termaski Japan/Schneider Eushall be installed inside the parel having a further Mrs. protective sheet and accessible only by opening the front door. All MCCBs shall be rated at 50°C, and shall be of one make only and not to be mixture. Panel (36°-48°-182") Size Incoming 1 200A TW MCCB 25KA 1 Termsaki/Schneider 1 200A TW MCCB 25KA 2 Diginal Voll Meter 0-600A 3 Inter-Scheender 1 100A TW MCCB 25KA 2 Diginal Angree Meter 0-600A 3 Inter-Scheender 3 Ampere Scheend Switch 3 GGT/Camson 1 100A TW MCCB 25KA 3 FlowMeter 4 Opidal Angree Meter 0-600A 5 Ampere Scheend Switch 6 Current Transformer 600°5A 7 Phase Indexined McCB 100 Transmit/Schneider 1 100A TW MCCB 25KA 1 1	S.#	T	Description			Qty:	Unit	Rate	Amount
Incoming 1 200A TP MCCB 25KA Terasaki/Schneider 01 No. 31654.3	1	Lar Eac asa mil Inc Ear deg 80- par inc AC pan doo	mp. Insturement Protection Fuse, including 200A ch Phase/Netural & link as per above outgoing combled with SIEMENS, PEMPAK, AREVA, PEL led steel sheet fabricated, Indoor Type, Floor Moning/Outgoing connection Top or Bottom as the with flexibile copper cable, system voltage preased and derusted, zinc phosphated, finished vertex and derusted, zinc phosphated, finished vertex and derusted, internal control & powelluding cost of all necessary materials computed by the protective sheet and action. All MCCBs shall be rated at 50°C, and shall	A Main copper bus bar S circuit breaker, installed etc. or equivalent make, of founting. Insulation class per site requirement, do 415VAC, 50HZ, 3-Pha with electro-static powder inged door, lockable han- er wiring from protection plete in all respects, eider Eu.shall be installed eccessible only by openin	uitable For in cubicals of 16 SWG at 600VAC, or to body se 4-Wire, coating of dle, all live & power., All above thiside the gethe front	<u>2</u>			
Incoming 1 200A TP MCCB 25KA Terasaki/Schneider 01 No. 31654.3			•	,					
Incoming 1 200A TP MCCB 25KA Terasaki/Schneider 01 No. 31654.3		Par	nel (36"x48"x12") Size		T .			54154	<u>- </u>
2 Digital Volt Meter 0-500V 3 Volt Selector Switch GGT/Camseo 01 No. Digital Ampere Meter 0-600A Entes/Schneider 01 No. CGT/Camseo 01 No. CGT/CGONC			Incoming						
3 Volt Selector Switch GGT/Camseo 01 No.	<u> </u>	1						31654.3	
4 Digital Ampere Meter 0-600A Entes/Schneider 01 No. 5 Ampere Selector Switch GGT/Canseco 01 No. 6 Current Pransformer 600/5A Fico/Metels 03 Nos. 7 Phase Indication Lamps, (R+Y+B) Schneider/Himel 03 Nos. 8 A Control MCB for Instrument Protection. Terasaki/Schneider 03 Nos. 9 Di*TGOING THE MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1									· · · · · · · · · · · · · · · · · · ·
6 Current Transformer 600/5A Fice/Metek 03 Nos. 7 Phase Indication Lamps, (R+Y+B) Schneider/Himel 03 Nos. 8 6A Control MCB for Instrument Protection. Terasaki/Schneider 03 Nos. 1 60A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 2 Supply. installation: testing. commissioning of with Incoming Indication Lamp. Instrument Protection Fuse, including 60A Main copper bus bar Suitable For Fach Phase/Netural & link as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAK.AREVA.PEL etc. or equivalent make, of 16 SWG miled steel sheet fabricated. Indoor Type. Ploor Mounting. Insulation class 600VAC. Incoming/Outgoing connection Type. Ploor Mounting. Insulation class 600VAC. Incoming of 80-100 micron thickness in approved colour with hinged door, lockable handle, all live part coverd with safty sheet, internal control & power wiring from protection & power. including cost of all necessary materials complete in all respects. All above ACB/MCCBs/MC		+		Entes/Schneider	01 No.				
7 Phase Indication Lamps. (R+Y+B) Schneider/Itimel 03 Nos. 8 6A Control MCB for Instrument Protection. OUTGOING 1 1 60A TP MCCB 25KA Terasaki/Schneider 07 Nos. 1 13640.1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 1 13640.1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 1 13640.1 2 Supply. installation: testing. commissioning of with Incoming Indication Lamp. Instrument Protection Fuse. including 60A Main copper bus bar Suitable For Each Phase/Netural & link as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAKAREVA,PEL etc. or equivalent make, of 16 SWG miled steel sheet fabricated, Indoor Type, Floor Mounting, Insulation class 600VAC, Incoming/Outgoing connection Top or Bottom as per site requirement, door to body Earth with flexibile copper cable, system voltage 415VAC, 501IZ, 3-Plause 4-Wire, degreased and derusted, zine phosphated, finished with electro-static powder coating of 80-100 micron thickness in approve'c colour with hinged door, lockable handle, all live part coverd with safly sheet, internal control & power wiring from protection & power, including cost of all necessary materials complete in all respects. All above ACB/MCCBs/MCBs Make in Terasaki Japan/Schneider Fushall be installed inside the panel having a further M.S. protective sheet and accessible only by opening the front door. All MCCBs shall be rated at 50°C, and shall be of one make only and not to be mixture. Panel (24"36"x6") Incoming I 60A TP MCCB 25KA Terasaki/Schneider I bigital Ampere Meter 0-600V Entes/Schneider J Digital Voll Meter-0-600V Entes/Schneider J Digital Ampere Meter 0-200A Entes/Schneider J Digital Ampere Meter 0-200A Entes/Schneider J Phase Indication Lamps, (R+Y+B) Schneider/Itimel J Nos. J Phase Indication Lamps, (R+Y+B) Schneider/Itimel J Nos. J CTGOING		+							
8 6A Control MCB for Instrument Protection. OUTGOING 1 60A TP MCCB 25KA Terasaki/Schneider 1 30A TP MCCB 25KA Terasaki/Schneider 1 7 Nos. 113640.1 2 Supply. installation: testing. commissioning of with Incoming Indication Lamp. Instrument Protection Puse. including 60A Main copper bus bar Suitable For Each Phase/Netural & link as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAK.AREVA.PEL.etc. or equivalent make. of 16 SWG miled skeel sheet fabricated, Indoor Type. Floor Mounting. Insulation class 600VAC. Incoming/Outgoing connection Top or Bottom as per site requirement. door to body Earth with flexibile copper cable, system voltage 415VAC, 501IX, 3-Phase 4-Wire, degreased and derusted, zine phosphated. finished with electro-static powder conting of 80-100 micron thickness in approved colour with hinged door, lockable handle, all live 4 part coverd with saffy sheet, internal control & power wiring from protection & power, including cost of all necessary materials complete in all respects. All above ACB/MCCBs/MCBs, Make in Terasaki Japan/Schneider Eushall be installed inside the panel having a further M.S. protective sheet and accessible only by opening the front door. All MCCBs shall be rated at 50°C, and shall be of one make only and not to be mixture. Panel (24"36"x6") Incoming 1 60A TP MCCB 25KA Terasaki/Schneider Terasaki/Schneider 1 No. 1 6324.3 2 Digital Voll Meter 0-600V Entes/Schneider 1 No. 2 Digital Ampere Meter 0-200A Entes/Schneider 3 Volt Selector Switch 4 Digital Ampere Meter 0-200A 5 Ampere Selector Switch 6 Current Transformer 200/5A 7 Phase Indication Lamps, (R+Y+B) Schneider/Ilimel 1 03 Nos. 8 6A Control MCB for Instrument Protection. 1 'Terasaki/Schneider 1 03 Nos.		+							•
1 60A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 2 Supply. installation: testing. commissioning of with Incoming Indication Lamp. Insturement Protection Fuse, including 60A Main copper bus bar Suitable For Each Phase/Netural & link as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAK.AREVA.PEL etc. or equivalent make, of 16 SWG miled steel sheet fabricated. Indoor Type, Floor Mounting, Insulation class 600VAC. Incoming/Outgoing connection Top or Bottom as per site requirement, door to body Earth with flexibile copper cable, system voltage 415VAC, 5011Z, 3-Phase 4-Wire, degreased and derusted, zinc phosphated, finished with electro-static powder coating of 80-100 micron thickness in approved colour with hinged door, lockable handle, all live part coverd with safty sheet, internal control & power wiring from protection & power, including cost of all necessary materials complete in all respects. All above ACB/MCCBs/MCBs, Make in Terasaki Japan/Schneider Fusshall be installed inside the panel having a further M.S. protective sheet and accessible only by opening the front door. All MCCBs shall be rated at 50°C, and shall be of one make only and not to be mixture. Panel (24"36"x6") Incoming 1 GOA TP MCCB 25KA Terasaki/Schneider 1 Incoming 1 GOA TP MCCB 25KA Terasaki/Schneider 1 Incoming 1 GOA TP MCCB 25KA Terasaki/Schneider 1 Incoming of the panel having a further 0-200A 1 Entes/Schneider 1 Incoming of the panel having a further 0-200A 2 Digital Voll Meter 0-600V Entes/Schneider 1 Incoming of the panel having a further 0-200A 3 Voll Selector Switch 4 Digital Ampere Meter 0-200A 5 Ampere Selector Switch 6 Current Transformer 200/5A 7 Phase Indication Lamps, (R+Y+B) 8 Chacintol MCB for Instrument Protection 1 Terasaki/Schneider 1 ON TOCOLNG 1 Terasaki/Schneider 1 ON TOCOLNG		8							
1 30A TP MCCB 25KA Terasaki/Schneider 07 Nos. 113640.1 2 Supply, installation: testing, commissioning of with Incoming Indication Lamp. Insturement Protection Fuse, including 60A Main copper bus bar Suitable For Each Phase/Netural & link as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAK.AREVA.PEL etc. or equivalent make, of 16 SWG miled steel sheet fabricated, Indoor Type, Floor Mounting, Insulation class 600VAC. Incoming/Outgoing connection Top or Bottom as per site requirement, door to body Earth with flexibile copper cable, system voltage 415VAC, 5011/2, 3-Phase 4-Wire, degreased and derusted, zine phosphated, finished with electro-static powder coating of 80-100 micron thickness in approved colour with hinged door, lockable handle, all live part coverd with safty sheet, internal control & power wiring from protection & power, including cost of all necessary materials complete in all respects. All above ACJB/MCCBs/MCDs, Make in Terasaki Japan/Schneider Fus.hall be installed inside the panel having a further M.S. protective sheet and accessible only by opening the front door. All MCCBs shall be rated at 50°C, and shall be of one make only and not to be mixture. Panel (24"36"x6") Panel (24"36"x6")									
2 Supply, installation; testing, commissioning of with Incoming Indication Lamp. Instrurement Protection Fuse, including 60A Main copper bus bar Suitable For Each Phase/Netural & Ink as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAK, AREVA, PEL etc. or equivalent make, of 16 SWG miled steel sheet fabricated, Indoor Type, Floor Mounting, Insulation class 600VAC, Incoming/Outgoing connection Top or Bottom as per site requirement, door to body Earth with flexibile copper cable, system voltage 415VAC, 501IX, 3-Phase 4-Wire, degreased and derusted, zine phosphated, finished with electro-static powder coating of 80-100 micron thickness in approved colour with hinged door. lockable handle, all live part coverd with safty sheet, internal control & power wiring from protection & power, including cost of all necessary materials complete in all respects. All above ACB/MCCBs/MCBs, Make in Terasaki Japan/Schneider Fu.shall be installed inside the panel having a further M.S. protective sheet and accessible only by opening the front door. All MCCBs shall be rated at 50°C, and shall be of one make only and not to be mixture. Panel (24"36"x6") Incoming	-	 							
2 Supply. installation: testing. commissioning of with Incoming Indication Lamp. Instrurement Protection Fuse. including 60A Main copper bus bar Suitable For Each Phase/Netural & link as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAK.AREVA.PEL etc. or equivalent make. of 16 SWG miled steel sheet fabricated. Indoor Type. Floor Mounting. Insulation class 600VAC, Incoming/Outgoing connection Top or Bottom as per site requirement. door to body Earth with flexibile copper cable, system voltage 415VAC. 501IZ. 3-Phase 4-Wire, degreased and derusted, zine phosphated. finished with electro-static powder coating of 80-100 micron thickness in approve' colour with hinged door, lockable handle, all live part coverd with safty sheet, internal control & power wiring from protection & power, including cost of all necessary materials complete in all respects. All above ACB/MCCBs/MCBs, Make in Terasaki Japan/Schneider Fu.shall be installed		 	30X TP MCCB 23KA	Terasaki/Schneider	07 Nos.	· · · · · · · · · · · · · · · · · · ·			
Insturement Protection Fuse, including 60A Main copper bus bar Suitable For Each Phase/Netural & Iink as per above outgoing circuit breaker, installed in cubicals asambled with SIEMENS, PEMPAK.AREVA.PEL etc. or equivalent make, of 16 SWG miled steel sheet fabricated, Indoor Type, Floor Mounting, Insulation class 600VAC, Incoming/Outgoing connection Top or Bottom as per site requirement, door to body Earth with flexibile copper cable, system voltage 415VAC, 5011Z, 3-Phase 4-Wire, degreased and derusted, zine phosphated, finished with electro-static powder coating of 80-100 micron thickness in approved colour with hinged door, lockable handle, all live part coverd with safty sheet, internal control & power wiring from protection & power, including cost of all necessary materials complete in all respects. All above ACB/MCCBs/MCBs, Make in Terasaki Japan/Schneider Eu.shall be installed inside the panel having a further M.S. protective sheet and accessible only by opening the front door. All MCCBs shall be rated at 50°C, and shall be of one make only and not to be mixture. Panel (24"36"x6") Incoming I		ļ	·					313088.5	626177
Incoming		Instr Pha- asan mile Inco Eart degr 80-1 part inch ACI pane door	urement Protection Fuse, including 60A Main ase/Netural & link as per above outgoing circ imbled with SIEMENS, PEMPAK, AREVA, PEL extends the sheet fabricated, Indoor Type, Floor Morning/Outgoing connection Top or Bottom as put with flexibile copper cable, system voltage reased and derusted, zine phosphated, finished with 100 micron thickness in approved colour with him coverd with safty sheet, internal control & power adding cost of all necessary materials comp 3/MCCBs/MCBs, Make in Terasaki Japan/Schne et having a further M.S. protective sheet and acceptable and MCCBs shall be rated at 50°C, and shall the sheet and acceptable and shall the sheet and sheet and sheet and shall the sheet and sheet	copper bus bar Suitable uit breaker, installed in the or equivalent make, o counting, Insulation class per site requirement, doo 415VAC, 50HZ, 3-Phas ith electro-static powder need door, lockable hander wiring from protection dete in all respects. A ider Eu.shall be installed cessible only by opening	For Each to cubicals for 16 SWG 600VAC, or to body to 4-Wire, coating of the all live & power All above inside the front	4			
1 60A TP MCCB 25KA								56074	:
2 Digital Volt Meter 0~600V Entes/Schneider 01 No.				Terasaki/Sebnoider	OI No			16374.3	
4 Digital Ampere Meter 0~200A Entes/Schneider 01 No. 5 Ampere Selector Switch GGT/Camseo 01 No. 6 Current Transformer 200/5A Fico/Metelx 03 Nos. 7 Phase Indication Lamps. (R+Y+B) Schneider/Himel 03 Nos. 8 6A Control MCB for Instrument Protection. Terasaki/Schneider 03 Nos. OUTGOING		2	Digital Volt Meter 0~600V					10324,3	
5 Ampere Selector Switch GGT/Camseo 01 No. 6 Current Transformer 200/5A Pico/Metelx 03 Nos. 7 Phase Indication Lamps. (R+Y+B) Schneider/Himel 03 Nos. 8 6A Control MCB for Instrument Protection. Terasaki/Schneider 03 Nos. OUTGOING	<u> </u>			GGT/Camsco	01 No.				
6 Current Transformer 200/5A Pico/Metelx 03 Nos. 7 Phase Indication Lamps. (R+Y+B) Schneider/Himel 03 Nos. 8 6A Control MCB for Instrument Protection. Terasaki/Schneider 03 Nos. OUTGOING									
7 Phase Indication Lamps. (R+Y+B) Schneider/Himel 03 Nos. 8 6A Control MCB for Instrument Protection. Terasaki/Schneider 03 Nos. OUTGOING 03 Nos.									
OUTGOING								···	
				****Terasaki/Schneider	03 Nos.				
1 20/A 1F MICCO 23KA FERSAKI/SCHREIGER 0 / NOS. 113640.1				Torogalit/Calan-14-	07 No.			112640	
186038 744154	_		20/A IF MICCO 23KA	r crasaki/Scrincider	U/ NOS.	-			44154

F				Qty:	Unit	Rate	Amour
F	Description upply, installation, testing, commissioning of , Indi	cation Lamp, Insturement	Protection		0	- Nate	Amoun
	use, including 60A Main copper bus bar Suitable F	or Each Phase/Netural &	link as per				
al	hove outgoing circuit breaker, installed in cu	ibicals asambled with S	IEMENS,				
р	EMPAK.AREVA.PEL etc. or equivalent make, of	16.SWG miled steel sheet I	l'abricated,			1	
	ndoor Type, Floor Mounting, Insulation class 600V				1		
	op or Bottom as per site requirement, door to bod						
	ystem voltage 415VAC, 50HZ, 3-Phase 4-Wi					1	
pl	hosphated, finished with electro-static powder coa	ting of 80-100 micron th	ickness in			1	
аг	proved colour with hinged door, lockable handle,	all live part coverd with s	afty sheet,				
	iternal control & power wiring from protection & po						
- m	esterials complete in all respects. All above ACR/Mi	CCRe/MCRe Make in Ter	geski	_	 		
3	Incoming				-	56074	<u> </u>
	I 30A TP MCCB 25KA	Terasaki/Schneider	01.31-	ļ <u></u> .		163243	
	2 Digital Volt Meter 0~600V		01 No.		-	16324.3	
	3 Volt Selector Switch	Entes/Schneider	01 No.				
		GGT/Camsco	01 No.	ļ	<u> </u>		
- 1		Entes/Schneider	01 No.	ļ			ļ
	5 Ampere Selector Switch 6 Current Transformer 200/5A	GGT/Camsco Fico/Metelx	01 No.		 	 	
7			03 Nos.			 -	+ ;
	B 16A Control MCB for Instrument Protection.	Schneider/Himel Terasaki/Schneider	03 Nos.		 	ļ	1
	OUTGOING	rerasaki/Senneiger	03 Nos.		ļ		
	1 15A DP MCCB 10KA	The second of th	1.5		 	1245115	
- 1	I ISA DE MCCB TORA	Terasaki/Schneider	15		<u> </u>	126514.5	110217
4 1.7	T POWER CABLE.	<u></u>			<u> </u>	198913	1193477
	apply at site, installation, testing and commissioning moured copper conductor cable 600/1000V grade						
	stalled shall be measured for payment. Actual lengt contractor before placing the order.	h of cables shall be measu					1
	confident before placing the order,		red at site				
	- Contractar betwee placing the order.		red at site		•		
1		Pakistan/Newage/Pionce	red at site	630	rft	1413.85	89072
	35mm sq. 4-Core, PVC/PVC Cable.		red at site	630	rft	1413.85	89072
5 E/	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM	Pakistan/Newage/Pionce	red at site	630	rft	1413.85	890724
i E/	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM upply, Installation, Drilling of earth bore 3" (75mm)	Pakistan/Newage/Pionce	red at site	630	rft	1413.85	890720
5 E/	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM upply, Installation, Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up 1 G.1 pipe 50mm dia 14-	red at site	630	rft	1413.85	890720
Su Su S	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM apply, Installation, Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore.	Pakistan/Newage/Pionce dia 70 to 80-ft deep or up 1 G.I pipe 50mm dia 14- re all G.I pipe accessories	red at site	630	rft	1413.85	89072
5 E/ Su t S	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM apply, Installation, Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected.	Pakistan/Newage/Pionce dia 70 to 80-ft deep or up a G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be	red at site	630	rft	1413.85	89072
Su Su t S lik in	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM apply, Installation, Drilling of earth bore 3" (75mm) be permanent water table, back filling ramming, with the work of the premade bore tees bends sockets etc G.I pipe shall be connected stalled at bottom of G.I pipe all nuts and bolts & ea	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up a G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of	red at site	630	rft	1413.85	89072
Su Su t S lik in st	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM apply, Installation, Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & eatlandard electrolytic copper conductor 70mm sq. to be	Pakistan/Newage/Pionce dia 70 to 80-ft deep or up a G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of the installed in prelaid G.I	red at site	630	rft	1413.85	89072
Su Su t S lik in st	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM apply, Installation, Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & eatlandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test	Pakistan/Newage/Pionce dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be inthing leads consisting of the installed in prelaid G.I link in man hole and from	red at site	630	rft	1413.85	89072
Su Su t S lik in st pip	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore te tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & cat tandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points e	Pakistan/Newage/Pionee dia 70 to 80-lt deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rithing leads consisting of the installed in prelaid G.I link in man hole and from consisting of copper plate	red at site	630	rft	1413.85	89072
Su Su t S lik in st pir tes	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & eattendard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points e 00mm longx50mm widex12.5mm thick to be installed.	Pakistan/Newage/Pionce dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of the installed in prelaid G.I link in man hole and from the onsisting of copper plate led. Construction of man	red at site	630	rft	1413.85	89072
Su Su t S lik in st pip tes	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & eattendard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points e 00mm longx50mm widex12.5mm thick to be install hole 450mmx450mm x600mm deep with 225mm to	Pakistan/Newage/Pionce dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of the installed in prelaid G.I link in man hole and from the onsisting of copper plate led. Construction of man thick wall with cement	red at site	630	rft	1413.85	89072
Su Su t S lik in st pip tes 30	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM apply, Installation, Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & catandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test set link to desired location, earth connecting points etc. 30mm longx50mm widex12.5mm thick to be installable 450mmx450mm x600mm deep with 225mm to ortar internal plaster 1:4, RCC 100mm thick man ho	Pakistan/Newage/Pionce dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of the installed in prelaid G.I link in man hole and from tonsisting of copper plate led. Construction of man thick wall with cement the cover lifting hooks and	red at site	630	rft	1413.85	890724
Su t Su lik in st pip tes 30	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & earth and connected to tinned copper spike and to test set link to desired location, earth connecting points etc. 30mm longx50mm widex12.5mm thick to be install hole 450mmx450mm x600mm deep with 225mm fortar internal plaster 1:4. RCC 100mm thick man home following words written with paint on cover "Earth."	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up a G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of the installed in prelaid G.I link in man hole and from tonsisting of copper plate led. Construction of man finick wall with cement the cover lifting hooks and thing Pit", horizontal and	red at site	630	rft	1413.85	890720
Su t Su lik in st pip tes 30	35mm sq. 4-Core, PVC/PVC Cable. ARTHING SYSTEM apply, Installation, Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & catandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test set link to desired location, earth connecting points etc. 30mm longx50mm widex12.5mm thick to be installable 450mmx450mm x600mm deep with 225mm to ortar internal plaster 1:4, RCC 100mm thick man ho	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up a G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of the installed in prelaid G.I link in man hole and from thick wall with cement the cover lifting hooks and ting Pit", horizontal and mm thick as main circuit	red at site	630	rft	1413.85	890720
Su t Su lik in st pip tes 30 mo	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected istalled at bottom of G.I pipe all nuts and bolts & catandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points etc 00mm longx50mm widex12.5mm thick to be install hole 450mmx450mm x600mm deep with 225mm to order internal plaster 1:4. RCC 100mm thick man home following words written with paint on cover "Ear ertical rising copper strip of size 25mm wide and 3r	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be inthing leads consisting of the installed in prelaid G.I link in man hole and from the construction of man thick wall with cement the cover lifting hooks and ting Pit", horizontal and mm thick as main circuit tion points and also fixed	red at site	630	rft	1413.85	890720
Su t Su lik in st pip tes 30 mo	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected istalled at bottom of G.I pipe all nuts and bolts & cat andard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points etc. 30mm longx50mm widex12.5mm thick to be install about 450mmx450mm x600mm deep with 225mm to order internal plaster 1:4. RCC 100mm thick man hot professional profession of the following words written with paint on cover "Ear ertical rising copper strip of size 25mm wide and 3r otective conductor. Terminating on earthing connections."	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be inthing leads consisting of the installed in prelaid G.I link in man hole and from the construction of man thick wall with cement the cover lifting hooks and ting Pit", horizontal and mm thick as main circuit tion points and also fixed	red at site	630	rft	1413.85	890720
Su t Su lik in st pip tes 30 mo	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & eatlandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points etc. St link to desired location, earth connecting points etc. Onmin longx50mm widex12.5mm thick to be install hole 450mmx450mm x600mm deep with 225mm to portar internal plaster 1:4, RCC 100mm thick man hot me following words written with paint on cover "Ear ertical rising copper strip of size 25mm wide and 3r officetive conductor. Terminating on earthing connect th sides for ILT/LT/SMPB/DB Panel & Cable tray	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be inthing leads consisting of the installed in prelaid G.I link in man hole and from the construction of man thick wall with cement the cover lifting hooks and ting Pit", horizontal and mm thick as main circuit tion points and also fixed	red at site	630	rft	1413.85	89072
Su t Su ik in st pip tes 30 mo	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & eatlandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points etc. St link to desired location, earth connecting points etc. Onmin longx50mm widex12.5mm thick to be install hole 450mmx450mm x600mm deep with 225mm to portar internal plaster 1:4, RCC 100mm thick man hot me following words written with paint on cover "Ear ertical rising copper strip of size 25mm wide and 3r officetive conductor. Terminating on earthing connect th sides for ILT/LT/SMPB/DB Panel & Cable tray	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be inthing leads consisting of the installed in prelaid G.I link in man hole and from the construction of man thick wall with cement the cover lifting hooks and ting Pit", horizontal and mm thick as main circuit tion points and also fixed	red at site	630	rft	1413.85	89072
Su t Su ik in st pip tes 30 mo	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & eatlandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points etc. St link to desired location, earth connecting points etc. Onmin longx50mm widex12.5mm thick to be install hole 450mmx450mm x600mm deep with 225mm to portar internal plaster 1:4, RCC 100mm thick man home following words written with paint on cover "Ear ertical rising copper strip of size 25mm wide and 3r officetive conductor. Terminating on earthing connect th sides for ILT/LT/SMPB/DB Panel & Cable tray	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of the installed in prelaid G.I link in man hole and from the construction of man thick wall with cement the cover lifting hooks and ting Pit", horizontal and ting Pit", horizontal and ting thick as main circuit tion points and also fixed or in cable ladder as per-	ted at site	630	rft	9635.35	89072
Su t Su ik in st pip tes 30 mo	35mm sq. 4-Core. PVC/PVC Cable. ARTHING SYSTEM apply. Installation. Drilling of earth bore 3" (75mm) to permanent water table, back filling ramming, with WG and tinned spike to be installed in premade bore tees bends sockets etc G.I pipe shall be connected installed at bottom of G.I pipe all nuts and bolts & eatlandard electrolytic copper conductor 70mm sq. to be and connected to tinned copper spike and to test st link to desired location, earth connecting points etc. St link to desired location, earth connecting points etc. Onmin longx50mm widex12.5mm thick to be install hole 450mmx450mm x600mm deep with 225mm to portar internal plaster 1:4, RCC 100mm thick man home following words written with paint on cover "Ear ertical rising copper strip of size 25mm wide and 3r officetive conductor. Terminating on earthing connect th sides for ILT/LT/SMPB/DB Panel & Cable tray	Pakistan/Newage/Pionee dia 70 to 80-ft deep or up in G.I pipe 50mm dia 14- re all G.I pipe accessories to tinned copper spike be rthing leads consisting of the installed in prelaid G.I link in man hole and from the construction of man thick wall with cement the cover lifting hooks and ting Pit", horizontal and ting Pit", horizontal and ting thick as main circuit tion points and also fixed or in cable ladder as per-		630	rft		

Sub Divisional Officer Buildings Sub Division KOtmomin

Executive Engineer Building Division Sargodha

Rs: 538511.00

Rs. 185380.00

Relaying of settled tuff Paver

Dismantling Brick or flagged flooring.

	1*300*20		6000 Cft			
•	1*275*20		5500		. •	
		- Total	11500 Cft	•		
			@ 866.20	%0Cft	, Rs. 9961.00	
•						•
2	P/L brick or stone ballast 1.1/2" in F&P	x2" size				
	1*300*20*0.5	•	3000 Cft			•
•	1*275*20*0.5		2750			٠
	· -	Total-	5750 Cft	. •		

Laying of old Tuff paver

1*300*20		6000 Sft	-
1*275*20	•	5500	
-	Total	11500 Sft	•
	Take 65 % of Total Qty	7475	•
	•	@ 24.80	P.Sft

P/F Tuff paver 60mm thick of supper tuff / Izhar Ltd., Taxila (7000-PSI concrete concept) with sand grouted i/c carriage and labour over bed of 2" thick sand complete item as approved by the Engineer incharge.

	· .	=		
1*300*20	•	6000	Sft-	
1*275*20		5500	•	
/	Total	11500	Sft	
	Take 35 % of Total Qty	4025	•	
/		(a)	156.80	•

@ 156.80 P.Sft Rs. 631120.00

Total:- Rs. 1364972.00

Executive Engineer
Building Division
SARGODHA

Sub Divisional Officer, Buildings Sub Division, Kotmomin

@ 9365.40 %Cft

	HOSPITAL KOTMOMIN DISTRICT SARGODHA	
	STREET LIGHT	
1	Supplying, installation testing and commissioning of Octagonal shape electric street light pole, made of hot dipped 4.5 mm thick (7 SWG) galvanized steel ,tappered from 225 mm at bottom to 100 mm at top, with 1500 mmx60 mm dia. arm for luminaire installation, duly G.I. welded with 470x470x20 mm base plate with the help of 4 no triangular stiffeners 100x350x20 mm of GI sheet, with built in junction box with shutter, i/c the cost of nuts & J-rag bolts, duly fixed in prelaid concrete foundation, foundation will be paid additionally as approved and directed by the Engineer Incharge. Single Arm upto 10 meter ht	
	8 Nos	•
2	@ 106336.15 Each Supply and erection of PVC pipe for wiring recessed in walls, including inspection boxes, pull boxes, hooks, cutting jharries, and	850689
	repairing surface, etc., complete with all specials. 2" dia 1500 Rft	
. 7	Total 1500 Cft @ 186.05 P.Rft	279075
3	Supply and erection of copper conductor cables for service connection, in prelaid pipe/G.l. wire/trenches, etc. (rate for cable only):- twin core 7/0.036"	
	550 Rft	
	Total 550 Rft @ 110.30 P.Rft	60665
4	twin core 7/0.064"	•
•	2000 Rft	•
	Total 2000 Rft @ 306.95 P.Rft	613900
5	Supplying, installation and commissioning of LED Cobra-head Luminaries of specified wattage and lumens conforming to IP 65, Philips/Osram/Thorn with corrosion resistant die casted aluminum housing, silicon gas kit, thermally hardened glass complete with LED drivers, surge protection i/c the cost of all accessories/components required for proper operation, fully flexible for future upgradation and easy replacements for maintenance purposes, bucket elevator	

charges as approved and directed by the Engineer Incharge.

(vii) 150 Watt with 21000 lumens

Nos

Total

Nos

@

477077

Suppling, Installation and comissioning of MCB (Miniature Circuit Breaker) of specified rating made of LEGRAND FRANCE/ GE U.S.A / SCHNEIDER GERMANY /SIEMEN GERMAN/TERASAKI JAPAN/ ABB SWITZERLAND in prelaid DBs and Panels i/c the cost of screwes,necessary wire complete in all respect as approved and directed by the Engineer Incharge.

(i) 6-63 Amp (10 KA) Double

Nos

Total Nos

> 5293.70 Each @

59634.60 Each

21175

Supplying Installation and commissioning of MCCB (Moulded Case Circuit Breaker) of specified rating made of LEGRAND FRANCE/ GERMANY / SCHNEIDER JAPAN/SIEMEN/ABB SWITZERLAND (with fixed Thermal-Magnetic Trip) in prelaid DBs and Panels i/c the cost of screws, necessary wire complete in all respect as approved and directed by the

(ii) 6-63 Amp (10 KA) Triple pole

Engineer Incharge.

Nos

Total

Nos @

11434.30 Each

11434

8

P/F wall mounted DB (Distribution Board) made with 16SWG Sheet (Recessded/Surface mounted Type), Powder coated Paint, i/c the cost of Lock, Indication lights, Thimble, Copper Comb, Wiring, Netural & Earth Bar, Door Earthing, Digital Voltmeter, Digital Ammeter, Volt Selector Switch, Ammeter selector switch, Current Transformers and Controles Complete in all respect as approved and directed by the Engineer Incharge (Breakers will be Paid Separately)..

i) 20~60A (18"x24"x6")

1x1:5x2x0.5

1.5

1.5 Cft Total

18691.40 P.Cft

28037

Total Rs.

Executive Engineer

Byjiding Division

SARGODHA

2342052

Sub Engineer

Sub Divisional Officer **Buildings Sub Division** Kotmomin

REVISED ROUGH COST ESTIMATE FOR THE WORK "REVAMPING OF THO HOSPITAL KOTMOMIN DISTRICT SARGODHA

CREDIT TO OLD METRIAL

1	Un service able Tiles.		X12131 XX174	≌	
	13235 x <u>50</u>	x <u>350</u>	Total:-	27794	•
	100	100	•	27794	•
2	Un service able Tiles blast.		@	4000.00 %0Nos	Rs. 111174/ -
-				6000	166764
	13235 x 40	x <u> </u>	Total:-	662	,00, 1
		. 8	,	662	
3	Old un service able Door.		@	1500.0 0 %Cft 2 000	Rs . 9926/-
	25	no	Total:-	-	1324
		e , ma		25	
4	Old un service able Window.		@	5500.00 Each	Rs. 137500/-
	57	по	Total:-	57	
			•		r
			@	4500.00 Each	Rs. 256500/-
				•	Rs ∈515100/-

Executive Engineer, Buildings Division Sargodha

Sur Divisional Officer.
Buildings Sub Division,
Kotmomin

Say



Quotation⁻

Javaid Rahim Govt Contractors

THQ Hospital Silanwali MR. SAROSH

Quote No:

QU-00418

Dated:

7th Mar 2022

Due Date: Reference No:

21st Mar 2022

110792

Rs 1,795,00

Ńο.

Description

Quantity

Amount Rate

Rs 1,795.00

Anti-Microbial Walls

Option 1

Anti-Microbial Wall Cladding with Built In (Silver Ion

Technology)

Kills Bacteria 24/7.

Size: 9.2 feet height x 4feet width

Thickness: 2mm

Thermoformed round corners for ease of maintenance good chemical resistant properties, fewer joints:

Proven Anti-Microbial Technology with certifications

Killing MRSA, E-Coli, Salmonella up to 99.99%.

Accredited by ECHA, FDA, EPA, HACCP & is BDR

Compliant

Anti-Microbial Wall Cladding Pasted with Adhesive on

Frame of Gypsum board and GI.

. (UK)

Rs 1,050.00

Rs 1,050.00

2 Anti-Microbial Walls

Option 2

SPM Walls Decochoc

Unique textured surface hiding impacts and

scratches, easy to clean

Resists to 320 kg at 3 km/h impacts Non-porous 100% antibacterial (ISO 22196)

Suitable for high infection risk areas

Welded joints possible for perfect water tightness between panels or with vinyl flooring

Resists to standard cleaning, disinfection and

antiseptic products (Anios and Bioquell test reports)

Bs2d0 - Heavy traffic - 100% antibacterial -

Sustainable formulation.

Size: 9.8 feet height x 4.3 feet width

Thickness: 2mm

Rs 3,800,00

Rs 3,800.00

Anti-Microbial Walls

Installation of X-ray/ CT Scan Room (Consisting of lead Sheet 1.6mm fix, Lead Sheet Pasted on Lassani and front finish of SPM Anti Bacterial sheet.



Rs 420.00 Rs 420.00 Gerflor Flooring Option 1 Ambiance Ultra Anti-Bacterial Anti-Static High performance homogeneous flooring suitable for heavy duty traffic T Group => best abrasion resistance TVOC after 28 days indoor air quality Exclusive and patented Evercare surface treatment Resistant to main chemical products used in healthcare. ((With Complete floor installation with coving, heat welding)) Total Thickness: 2mm Roll Size: 66 x 6.6 = 430sqft Rs 330.00 Rs 330.00 Gerflor Flooring Option 2 -Mipolam 180 Anti-Bacterial Anti-Static Easycare™ surface treatment Monolayer homogeneous flooring, pressed and calendered Protect surface treatment Improved resistance to scratching and scuffing TVOC after 28 days indoor air quality (With Complete floor installation with coving, heat welding) Roll Size: 66 x 6:6= 430 Sqft, Thickness: 2.0mm Rs 130.00 Rs 130.00 Floor Preparation Self Leveling Compound

- 70% advance payment 20% upon delivery and balance upon completion of work

Thickness: 2-3mm

Rs 7,525.00

Quotation Total



2 - Above prices are exclusive of all Taxes

3 - All civil work required will be under client's responsibility.

4 - Wastage to be charged as per actual dimensions.

Name : Abdul Rehman Bhatti

Phone: 03217563007

Email: abdulrehman@unimix.com.pk

8. ANNUAL OPERATING COST (POST COMPLETION)

Financial Components: Capital Grant Number: Government Buildings - (PC12042)

Cost Center:OTHERS- (OTHERS)

LO NO:LO22010025

Fund Center (Controlling):LE4203 A/C To be Credited:Account-I

PKR Million

Sr#	Object Code	2025-2026		2026-2027		2027-2028		2028-2029		2029-2030	
		Local	Foreign								
1	A05270-To Others	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
2	A12403-Other Buildings	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
Total		0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000

Financial Components: Capital Grant Number: Government Buildings - (PC12042)

Cost Center:OTHERS- (OTHERS)

LO NO:LO22010025

Fund Center (Controlling):LE4203 A/C To be Credited:Account-I

PKR Million

Sr # Object Code		2025	-2026	2026-2027		2027-2028		2028-2029		2029-2030	
		Local	Foreign	Local	Foreign	Local	Foreign	Local	Foreign	Local	Foreign
1	A12403-Other Buildings	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
2	A05270-To Others	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000
	Total	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000	0.000

8. Annual Operating and Maintenance Cost after Completion of the Project

The Annual operating and maintenance cost after completion of the project will be borne by the concerned District Health Authority (DHA) as well as Primary and secondary healthcare Department, Lahore.

9. DEMAND AND SUPPLY ANALYSIS

Semi modern health facilities and scientific diagnostics are presently available in this Hospital. This initiative of revamping Hospital will cover all departments and components of healthcare including Medical, Surgical, psychiatric, Cardiac, ENT, Ophthalmic and Pediatrician components. Moreover, women health components i.e. Gynecology and obstetric will also be emphasized upon. In emergency, calamities and natural disasters, valuable lives will be saved through revamping of Emergency Units.

10. FINANCIAL PLAN AND MODE OF FINANCING

10.1 FINANCIAL PLAN EQUITY INFORMATION

10.2 FINANCIAL PLAN DEBT INFORMATION

undefined

10.3 FINANCIAL PLAN GRANT INFORMATION

Attached

8. Financial Plan and Mode of Financing

The project will be executed / financed through Annual Development Program under the sector Primary and Secondary Healthcare Department, the Government of Punjab. Year wise financial utilization is as under:

Revenue Side

(Rs.in Million)

Year	2017-18	2018-19	2019-20	2020-21	2021-22	2022-23	Total
Funds Released	33.000	20.826	1.874	1.896	4.212	7.720	69.528
Utilization	11.647	20.077	1.812	1.740	3.907	0.957	40.143

Capital Side:

Year	2017-18	2018-19	2019-20	2020-21	2021-22	2022-23	Total
Funds	0.000	0.000	0.000	0.000	0.000	E 000	F 000
Released	0.000	0.000	0.000	0.000	0.000	5.000	5.000
Utilization	0.000	0.000	0.000	0.000	0.000	0.000	0.000

Balance funds may be provided for completion of the project in subsequent years through ADP

10.4 WEIGHT COST OF CAPITAL INFORMATION

undefined

11. PROJECT BENEFITS AND ANALYSIS

11.1 PROJECT BENEFIT ANALYSIS INFORMATION

11.3 Social Benefits with Indicators

Social economic burden will be decreased due to availability of better medical services in the district. Time and money of community will be saved which were expended in other cities like Lahore Islamabad etc. on treatment of patients and for boarding and logging of attendants. The social status of community will rise.

11.3.1 Social Impact:

A number of patients lose their lives or suffer serious disabilities for want of timely access to the health facilities. The project will ensure that no one is left to reach the health facilities. The most important beneficiaries will be mothers having complicated delivery conditions. The number of patients transferred to the health facilities for treatment and lifesaving will serve as indicators for performance evaluation. In long term the project will help in improving socio-economic indicators of IMR and MMR.

11.2 ENVIRONMENTAL IMPACT ANALYSIS

11.5 Environmental Impact

It will have no hazardous effect on the environment. On the other hand, addition of horticulture and landscaping will provide healthy environment to the general public. All the more, the program is environment friendly having no adverse environmental effects. Simultaneously, this shall further improve environment by creating sense of responsibility among employed and beneficiaries of the service.

11.3 PACT ANALYSIS

undefined

11.4 ECONOMIC ANALYSIS

Employment Generation (Director and Indirect)

Revamping of this Hospital will lead to generation of employment for highly skilled /professional staff and unskilled staff leading to reduction of unemployment. Huge employments opportunity will be created from the establishment of the project. The Medical doctors and paramedics who are trained in this discipline or intended to specialize in this field can make maximum use of training. A large number of gazette and non-gazette posts will be available for employment directly or indirectly.

Impact of Delays on Project Cost and Viability

Delay in the implementation of the project will lead to increase in cost and increase financial burden on the Government and general population of Punjab. Since the project is one of the major needs and a long awaited desire of the community, therefore, Government of the Punjab contemplated plan for early execution of Revamping of Emergency Units. The delay will not only

deprive the patients of the state of the art facility but also distort the public image of the Government.

11.5 FINANCIAL ANALYSIS

Project Benefits and Analysis

Financial Benefits & Analysis

Tremendous public benefits will be accrued from revamping of Emergency Units:

The Targets of Sustainable Development Goals (SDGs) will be achieved

The Human Development Index of Pakistan (HDI) will improve

Infant Mortality Rate will decrease

Mother Mortality rate will be decreased

The international commitments of Pakistan will be accomplished

Health standard of public will

Better Health Facilities to mother and

Prompt and scientific facility for operation

Rehabilitation of disables and injured

Blindness in this area will be decreased and controlled

Better social and mental health to addict

Provision of better health facilities at doorsteps

Awareness and control for communicable

Survival of heart failure

Social indicators of Pakistan will improve

This will decrease load of patients on teaching hospitals and specialized institutions by promoting physical and mental health. By adopting preventive and Hygienic principles, the number of patients and diseases will decrease. Resultantly budget load of Government for treatment will decrease and saving will be utilized for development programs.

11.1.1 Financial Impact:

In the beginning, It is extremely difficult to put a money value on each life saved by taking/shifting a critically ill patient to the appropriate health facility for treatment. However, the exact amount spent shall be calculated against each patient shifted by analyzing data collected during operations.

11.2 Revenue Generation

Revenue will be generated from:

Indoor fee

Laboratory fees

Diagnostic facility fees

Dental fee

ECG fee

Private room charges

Ambulance charges

From other fees prescribed by Government

12. IMPLEMENTATION SCHEDULE

12.1 IMPLEMENTATION SCHEDULE/GANTT CHART

From September, 2017 to June, 2025

12.2 RESULT BASED MONITORING (RBM) INDICATORS

undefined

12.3 IMPLEMENTATION PLAN

Original Gestation period (From September, 2017 to June, 2019)

Extension in Gestation period for one year with no change in cost & Scope till June 2020.

1st Revised gestation period till June, 2021

2nd Revised gestation period till June, 2023.

3rd Revised gestation period till June, 2025

12.4 M&E PLAN

The Operation team will monitor the progress of the project and will hold regular weekly meeting to review the progress under the supervision of Project Director.

12.5 RISK MITIGATION PLAN

attached

RISK REGISTER

Programme for Revamping of all THQ Hospitals in Punjab

			itigation / C tative Assess		MITIGATION		
Risk Item No	No Risk Description/Event Cause Effect / Consequences		Effect / Consequences	Likelihood (1 to 3)	Impact (1 to 3)	Risk Score (1 to 9)	Mitigation / Actions
1	Due date for the completion of some hospital sites may be extended due to increase in scope from the Client	Direct instructions from the Medical Superintendents / Hospital Administration to revamp the remaining areas	Significant scope increase requested by the Hospital administration will result in: 1. Project delays 2. Contractor claims 3. Increase in project cost along with variations	3	3	9	Hospital administration is requested to finalize the scope during joint field visits of C&W and PMU
2	Various unexpected structural issues are being encountered	Unforeseen structural issues are expected to face during execution in hospital buildings approaching end of life	Stoppage of work Performance of the Contractor has affected Delays in the project	3	3	9	Various items which are unforeseen and expected to be used during execution may be taken in estimates so that those can be executed to address these issues
3	Change in management of the Client	Management change	Re-briefing is to be carried out	2	2	4	Acceleration of understanding for smooth and expeditious transition, without affecting the project
4	Financial Issues	Funds for these schemes should be provided as per the targets	Delay in tendering Effect on quality as the Consultant supervision will not take place Inconvenience to the patients	3	3	9	Approval of PCIs and early release of funds is requested
5	Nationwide spread of pandemic i.e. COVID-19 in 2nd and 3rd quarter of this year	Work delays during nationwide lockdown.	Delays in completion of works Claim requests received by Contractor and Consultant	3	3	9	Contractor will be asked to depute fully vaccinated labor

12.6 PROCUREMENT PLAN

undefined

13. MANAGEMENT STRUCTURE AND MANPOWER REQUIREMENTS

The Organogram of new Health Management Structure is available in PC-I

14. ADDITIONAL PROJECTS / DECISIONS REQUIRED

N/A

15. CERTIFICATE

Focal Person Name:Mr. KHIZAR HAYAT Designation:Project Director, PMU P&SHD

Email: Tel. No.:042-99231206

Fax No:

Address:31/E1, Shahrah-e-imam Hussain? Road? Block E 1 Gulberg III, Lahore, Punjab

15. It is certified that the project titled "Revamping of THQ Hospital Kot momin (3rd Revised)" has been prepared on the basis of instruction provided by the Planning Commission for the preparation of PC-I for Social Sector projects.

Prepared By:

(HISSAN ANEES)

DIRECTOR PLANNING & HR, PMU, PRIMARY & SECONDARY HEALTHCARE DEPARTMENT, LAHORE (042-99231206) (Oct-2022)

PROCUREMENT SPECIALIST, (PMU), PRIMARY & SECONDARY HEALTHCARE DEPARTMENT, LAHORE (042-99231206) (Oct-2022)

(HAMZA NASEEM)

PROJECT MANAGER CIVIL, PMU, PRIMARY & SECONDARY HEALTHCARE DEPARTMENT, LAHORE (042-99231206)

(Oct-2022)

Checked By:

(Dr. AYESHA PARVEZ)

DEPPUTY PROJECT DIRECTOR (PMU), PRIMARY & SECONDARY HEALTHCARE

> DEPARTMENT, LAHORE (042-99231206)

(Oct-2022)

Approved By:

(KHIZAR HAYAT)

PROJECT DIRECTOR (PMU)

PRIMARY & SECONDARY HEALTHCARE DEPARTMENT, LAHORE

(042-99231206) (Oct-2022)

(DR. IRSHAD AHMAD)

SECRETARY,

GOVERNMENT OF THE PUNJAB

PRIMARY & SECONDARY HEALTHCARE DEPARTMENT, LAHORE

(042-99204567)

(Oct-2022)

17. RELATION WITH OTHER PROJECTS